

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised June 10, 2003

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-26921
5. Indicate Type of Lease
STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
LG-0963

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name
Honeysuckle

8. Well Number
1

1. Type of Well:
Oil Well ☐ Gas Well ☒ Other Dry

2. Name of Operator
Concho Resources Inc.

9. OGRID Number
170181

3. Address of Operator 550 West Texas Avenue, Suite 1300
Midland, Texas 79701

10. Pool name or Wildcat
Vacuum Devonian, South

4. Well Location

Unit Letter B : 660 feet from the North line and 2084 feet from the East line

Section 21 Township 18S Range 35E NMPM County Lea

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
3918 GR

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐


COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.
See Attached

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

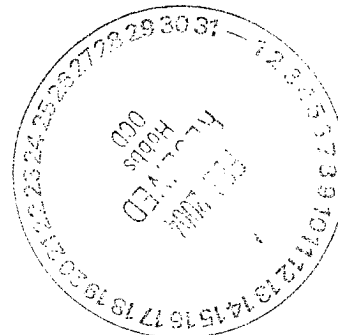

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Brenda Coffman TITLE Regulatory Analyst DATE 02/11/2004

Type or print name _____ E-mail address: _____ Telephone No. 3 2004
(This space for State use)

APPROVED BY Larry W. Wink TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER DATE FEB 23 2004
Conditions of approval, if any:

- 12-01-03 Pull rods & tbg. Notify OCD. MIRU. NU BOP. POH w/ 43 – 7/8" rods & pump. POH w/ 35 jts 2-7/8" tbg. RIH w/ gauge ring to 11,650'. POH. RIH w/ 5-1/2" CIBP & set @ 11,650'. Dump 35' cmt on top & SDON.
- 12-02-03 RIH & set CIBP @ 10,050'. Dump 35' cmt on top. RIH w/ MMCPI work string to 10,000'. Circ mud. POH to 7916' & SDON.
- 12-03-03 Spot 25 sx @ 7916' – 7800'. POH & ND BOP. Weld on pull nipple. RU csg jacks & SDON.
- 12-04-03 Freepoint csg @ 2800' +/- . OCD El Gonzales requested plug @ 4850'. RIH & spot 25 sx @ 4850' – 4597'. POH & cut csg @ 2787'. LD 67 jts. SDON.
(Note: Procedure called for perf @ 4850'.)
- 12-06-03 RIH & spot 40 sx @ 2837'. POH. WOC. SD due to high winds. Will tag Monday.
- 12-08-03 RIH & tag @ 2619'. Circ mud. POH & spot 35 sx @ 1700' – 1600'. POH. Test 8-5/8" csg to 800# per OCD. Perf (OCD request) @ 450'. Squeeze 125 sx. SDON.
- 12-09-03 POH w/ pkr. RIH & tag @ 297'. Spot 25 sx @ 60' to surf. Install dry hole marker. RD. Cut off WH & anchors. Level pit & cellar. Move out.

Well P&A – FINAL REPORT