

Submit 1 Copy To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Hobbs, NM 88210
District III
1000 Rio Blvd., Hobbs, NM 88240
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
October 13, 2009

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-005-00909
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Rock Queen Unit
8. Well Number 99
9. OGRID Number 247128
10. Pool name or Wildcat Caprock; Queen

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other Injector <input type="checkbox"/>	
2. Name of Operator Celero Energy II, LP	
3. Address of Operator 400 W. Illinois, Ste. 1601 Midland, TX 79701	
4. Well Location Unit Letter B : 660 feet from the N line and 1650 feet from the E line Section 34 Township 13S Range 31E NMPM County Chaves	
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- 1) Set cmt retainer @ 2600'-2625' and squeeze 100 sx Class C
- 2) Perforate (4), 10' above retainer and squeeze 35 sx; tag 100' above perforations
- 3) Perforate (4) at 2280', run packer and squeeze 35 sx Class C w/2% CaCl2. Tag at/above 2180'.
- 4) Perforate (4) at 1490', run packer and squeeze 35 sx Class C w/2% CaCl2. Tag at/above 1390'.
- 5) Perforate (4) at 321'. RU to casing, pump 110 sx Class C w/2% CaCl2 and circulate to surface on annulus.
- 6) Set P&A marker. Reclaim location.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Lisa Hunt

TITLE Regulatory Analyst

DATE 01/27/2011

Type or print name Lisa Hunt

E-mail address: lhunt@celeroenergy.com

PHONE: (432)686-1883

For State Use Only

APPROVED BY:

[Signature]

TITLE

STAFF MGR

DATE

2-2-2011

Conditions of Approval (if any):

CELERO ENERGY

FIELD: Caprock
LEASE/UNIT: Rock Queen
COUNTY: Chaves

DATE: Jan. 31, 2011
BY: MWM
WELL: 99
STATE: New Mexico

Location: 660' FNL & 1650' FEL, Sec 34B, T13S, R31ECM

SPUD: 2/56 COMP: 2/56


CURRENT STATUS: Injector

Original Well Name: C. A. Browning #6

KB = 4428'

GL = 4419'

API = 30-005-00909

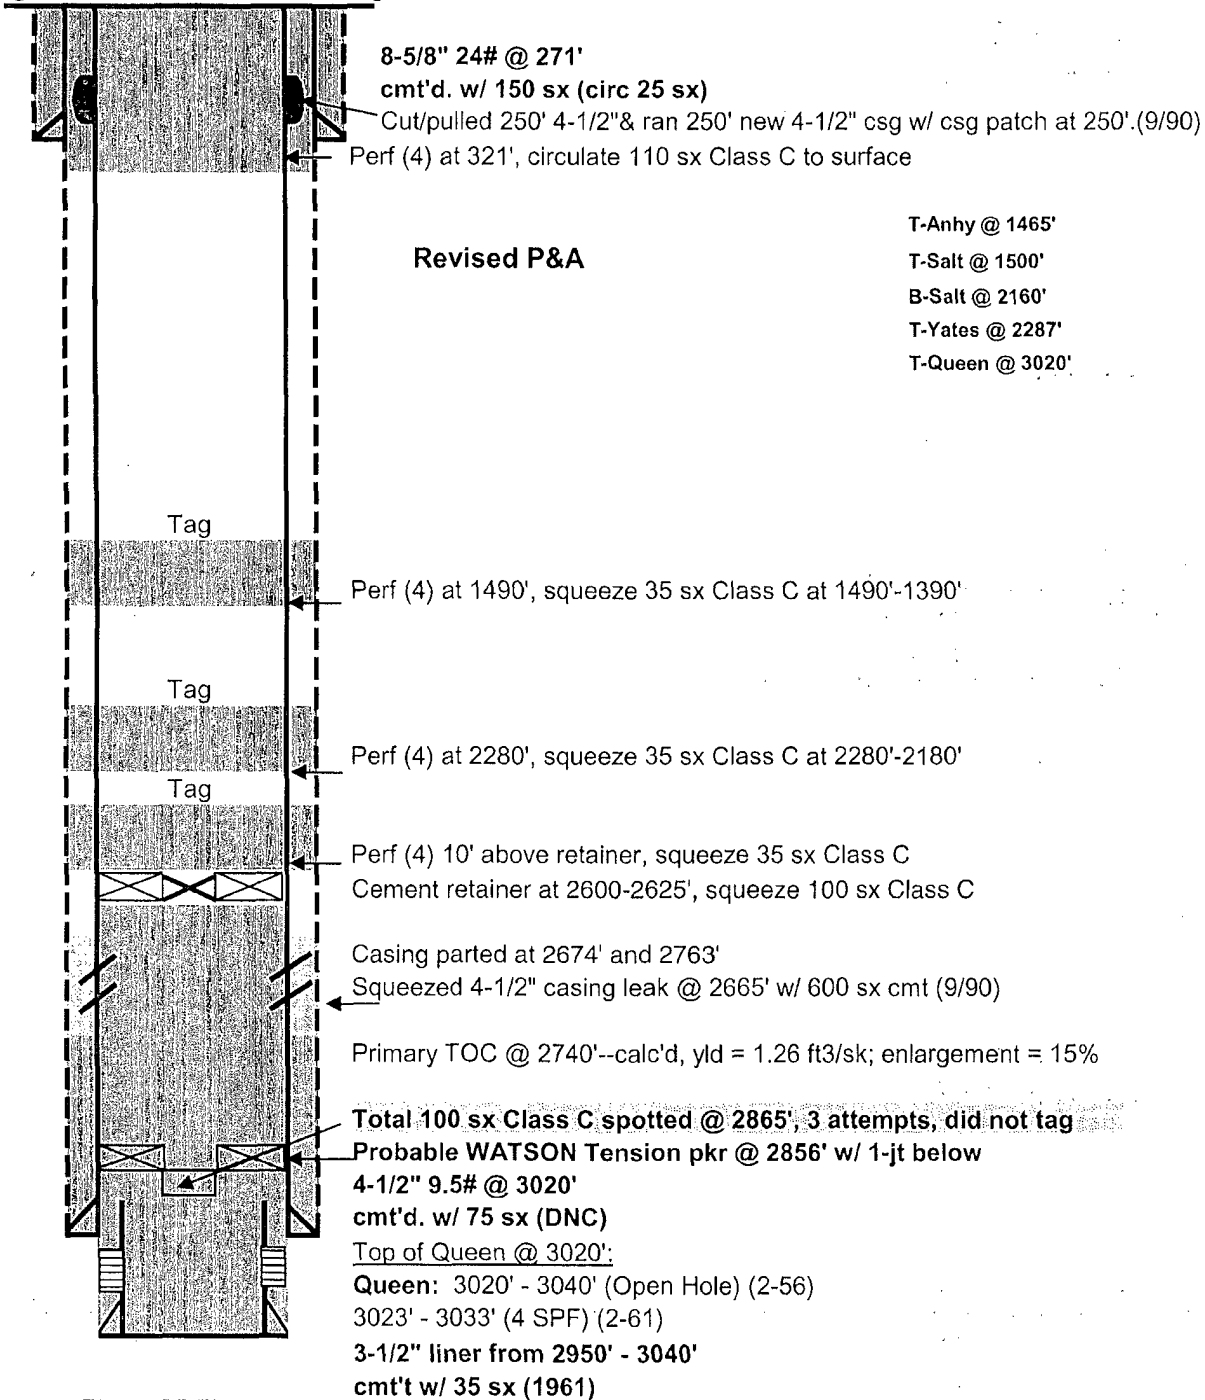

PBTD - 3040'
TD - 3040'