

Submit 1 Copy To Appropriate District
Office
District I
1625 N. Frey Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
October 13, 2009

HOBBS OCD

OIL CONSERVATION DIVISION

MAY 06 2011

1220 South St. Francis Dr.
Santa Fe, NM 87505

RECEIVED

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-36464
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator Pride Energy Company		6. State Oil & Gas Lease No. BO-1581-0012
3. Address of Operator P.O. Box 701950, Tulsa, OK 74170-1950		7. Lease Name or Unit Agreement Name Shelley 36 State
4. Well Location Unit Letter <u>N</u> : <u>1,980</u> feet from the <u>West</u> line and <u>660</u> feet from the <u>South</u> line Section <u>36</u> Township <u>19 South</u> Range <u>37 East</u> NMPM Lea County		8. Well Number <u>6</u>
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3,600' GR		9. OGRID Number <u>151323</u>
		10. Pool name or Wildcat Skaggs Abo North

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☒ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. A CIBP has been set at 6,800' + 35' of cmt. dumped on top of it and a CIBP has been set at 7,100' + 35' of cmt. dumped on top of it.
2. Propose to set a CIBP in the 5 1/2", 17#/ft. casing at 6,650' and dump 35' of cmt. on top of it.
3. Pressure up on the 5 1/2" casing to verify it will hold pressure.
4. Temporarily abandon well.

DENIED

LINE TEAM MUST BE
REPAIRED BEFORE
CIBP IS SET

Condition of Approval : Notify OCD Hobbs office 24 hours prior to running MIT Test & Chart

Spud Date:

Rig Release

MAY 19 2011

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE John W. Pride TITLE: Pres. of Pride Oil & Gas Co. Inc., as Gen. Partner of Pride Energy Company DATE: 5/4/11

Type or print name John W. Pride E-mail address: johnp@pride-energy.com PHONE: 918-524-9200

For State Use Only

APPROVED BY: _____ TITLE _____ DATE _____

Conditions of Approval (if any):

Temporarily Abandon

KB: 3618.0'
DF: 3617.0'
GL: 3600.0'
Datum: 18.0' above GL

Shelley 36 State #6

API # 30-025-36464

660' FSL & 1980' FWL
Sec 36-19S-37E
Lea Co., NM

8 $\frac{3}{8}$ " 24# H-40 STC @ 1515'
w/ 685 sx in 12 $\frac{1}{4}$ " hole
8 $\frac{3}{8}$ " TOC @ surface

5 $\frac{1}{2}$ " DV TOC @ 3046' , 2nd stage
w/ scattered cmt to 1,614'

5 $\frac{1}{2}$ " DV tool @ 4435'
5 $\frac{1}{2}$ " TOC @ 4435', Stage 1

Proposed CIBP @ 6,650'
w/ 35' of cmt. on top

4" TOL @ 6740' w/ 6' PBR


Drinkard perfs: 6858'-74', 3 spf, 48 holes

5 $\frac{1}{2}$ " K-55 ST&C @ 7025' w/ 1300 sx
in 7 $\frac{7}{8}$ " hole
7 $\frac{7}{8}$ " hole to 7225'
4 $\frac{3}{4}$ " hole to TD

Abo perfs: 7160'-63', 75'-77', 95'-98',
7224'-29', 92'-96', 3 spf, 51 holes, **SQZ'D**

Abo perfs: 7535'-38', 44'-46', 78'-80',
7655'-57', 3 spf, 27 holes

PBTD = 7734'
4" 11.34# L-80 FJ @ 7784'
w/ 75 sx in 4 $\frac{3}{4}$ " hole

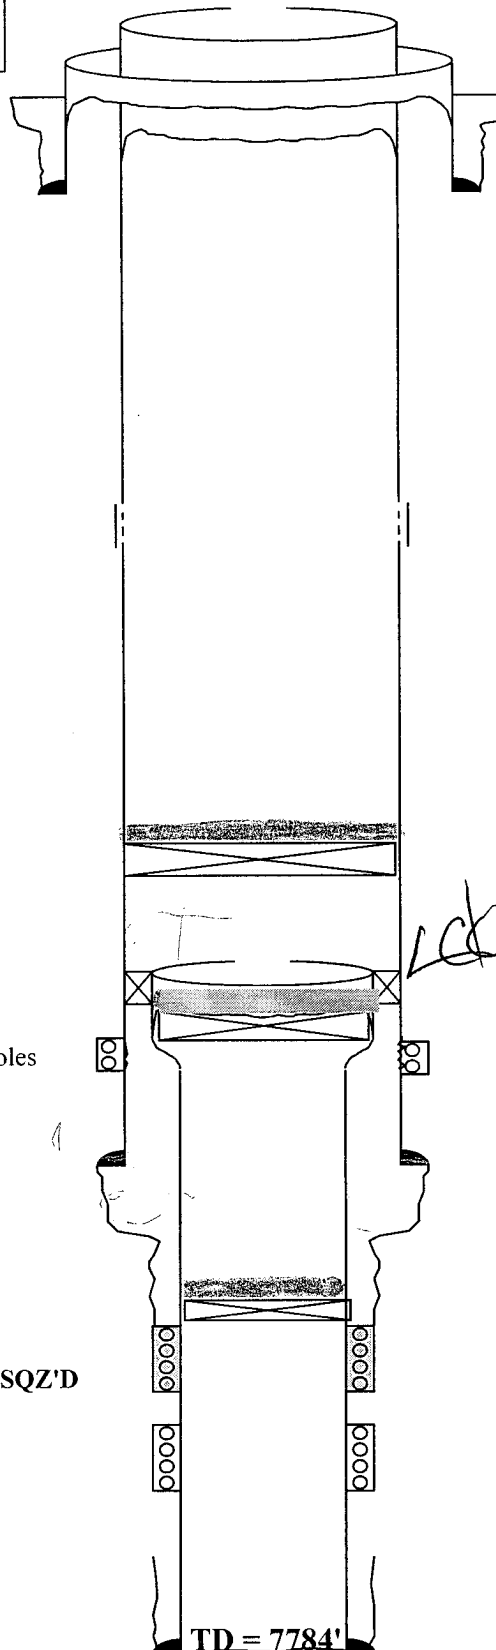

CIBP is set @ 6,800' w/ 35 sx cmt
on top

5 $\frac{1}{2}$ " Casing Detail:
15.5# surf - 6000'
17# 6000' - 7025'

CIBP is set @ 7,100 w/ 35 sx cmt
on top

TS @ 7722'

PRIDE ENERGY COMPANY

(918) 524-9200 ♦ Fax (918) 524-9292

Physical Address: 4641 E. 91st Street
Tulsa, OK 74137

Mailing Address: P.O. Box 701950
Tulsa, OK 74170-1950
Email Address: mattp@pride-energy.com

May 4, 2011

New Mexico Energy, Minerals and
Natural Resources Department
Oil Conservation Division
1625 N. French Drive
Hobbs, NM 88240

(0) (575) 393-6161
Via Certified Mail
Return Receipt #:
e-mail: cindy.herrera@state.nm.us

91 7108 2133 3939 3838 9365

ATTN: Cindy Herrera

RE: Shelley 36 State
Section 36-19S-37E: (Unit Letter N)
API No. 30-025-36464
Lea County, New Mexico

Dear Cindy,

In reference to the above well, please find attached the following documents:

1. Form C-103, dated May 4, 2011, (Notice of Intention to Temporarily Abandon).

Thank you and if there are any questions, please feel free to contact me at 918-524-9200.

Sincerely,



Matthew L. Pride
Pride Energy Company

mp12085.em

MAY 19 2011