

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

JPH Oil Producers

3. Address and Telephone No.

c/o Oil Reports & Gas Services, Inc., P.O. Box 755 Hobbs, NM 88241

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

660' FSL & 510 FWL Sec. 3, T12S R33E

5. Lease Designation and Serial No.

NM-0556674

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Amerada Federal #1

9. API Well No.

30-025-23505

10. Field and Pool, or Exploratory Area

North Bagley Penn.

11. County or Parish, State

Lea

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice


TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☒ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other _____
- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Work began 2/20/93 Set wire line bridge plug at 9225 & cap with 12' cement. Perf 9154-57, 9172-75, 9185-92 & 9203-9209 & treat with 500 gallons 15% acid. Swab 2% oil. Set wire line bridge plug at 9145 & cap with 12' cement. Perf 9087-91, 9107-13, 9119-22 & treat with 500 gallons 15% acid. Swab 8% oil. Set wire line bridge plug at 9076 & cap with 12' cement. Perf 9033-38, 8990-93 & treat with 500 gallons acid. Swab 50% oil. Reacidize with 2,000 gallons 15% acid. 3/14/93 pump 11 bbls oil & 10 bbls water. 9/29/93 Drilled out bridge plug at 9076 & start well to pumping. 10/8/93 pumping load.

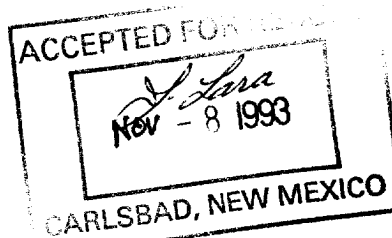

14. I hereby certify that the foregoing is true and correct

Signed Donna Holler

Title Donna Holler - Agent

Date October 11, 1993

(This space for Federal or State office use)

Approved by _____

Title _____

Date _____

Conditions of approval, if any: