

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE\*  
(Other instructions on reverse side)

Approved  
Budget Bureau No. 1004-0135  
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/> DRY HOLE		7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR MARSHALL & WINSTON, INC.		8. FARM OR LEASE NAME WILDLIFE FEDERAL
3. ADDRESS OF OPERATOR P. O. BOX 50880, MIDLAND, TX 79710-0880		9. WELL NO. 1
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface  1710' FSL & 750' FEL, SECTION 3, T9S, R33E		10. FIELD AND POOL, OR WILDCAT UNDESIGNATED ABO
14. PERMIT NO. 30-C25-31829		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA SECTION 3, T9S, R33E
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 4353.5' GR		12. COUNTY OR PARISH LEA
		13. STATE NM

15. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:


TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
(Other) <input type="checkbox"/>	

WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOTING OR ACIDIZING <input checked="" type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
(Other) <u>ATTEMPTED COMPLETION</u>	
(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)	

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

12/29/92

1. Drill out cement to 8710'. Test casing to 1500#, OK.
2. Ran cased hole logs from loggers TD of 8710' to 4000'.
3. Spot 500 gallons 15% DI NEFE acid from 8690' and perfed Abo interval 8670-8690' with 2 SPF (42 holes). Put away 500 gallons acid @ 4800# @ 0.2 BPM. Swab dry with no show of oil or gas.
4. Acidize perfs 8670-8690' with 2000 gallons 20% retarded acid @ 4800# @ 1 BPM. Swab dry with no show oil or gas. Started P&A operations on 1/7/93.

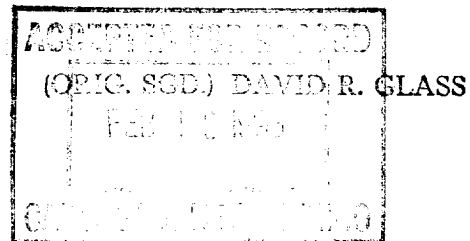

18. I hereby certify that the foregoing is true and correct

SIGNED M Brandt

TITLE Engineer

DATE 2/3/93

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

TITLE \_\_\_\_\_

DATE \_\_\_\_\_