

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR M & W of Lovington, inc.	8. FARM OR LEASE NAME Hayes Federal
3. ADDRESS OF OPERATOR P.O. Box 922, Lovington, N.M. 88260	9. WELL NO. 1
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1980/8 + E Sec. 30 (NWSE) Twn 8-S Rge 37E NMPM	10. FIELD AND POOL, OR WILDCAT Allison Penn
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.) 4045 DF
	16. COUNTY OR PARISH Roosevelt
	17. STATE N.M.

18. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF ☐ PULL OR ALTER CASING ☐
FRACTURE TREAT ☐ MULTIPLE COMPLETE ☐
SHOOT OR ACIDIZE ☐ ABANDON* ☒
REPAIR WELL ☐ CHANGE PLANS ☐
(Other) ☐

WATER SHUT-OFF ☐ REPAIRING WELL ☐
FRACTURE TREATMENT ☐ ALTERING CASING ☐
SHOOTING OR ACIDIZING ☐ ABANDONMENT* ☐
(Other) ☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- Attempt to retrieve tubing from 6849' to 9600' (csg. collapsed @ 6834' from surface) If able to retrieve: thg set plug @ T.D., ~~200'~~ (200' ~~100'~~ plug) 9600' approx. Tag plug
- Set plug @ ~~6800'~~ (100' plug) Tag plug
- Set plug @ ~~3920'~~ (100' plug) 50' in 4-1/2" liner & 50' into 3-5/8" csg. (8-5/8" csg cemented to surface) Tag plug
- Set plug 500' (100' plug). Tag plug
- Plug surface minimum 50' cement plug
- Work to begin within next 12 months

* If unable to retrieve tubing or get work-string passed collapsed section, set a cement retainer at 6800', squeeze below with 400+ cement. Cap retainer with 50' cement. Continue at step (3).

18. I hereby certify that the foregoing is true and correct

SIGNED Peter W. Chester TITLE President

DATE 4/22/89



(This space for Federal or State office use)

APPROVED BY _____ TITLE _____

CONDITIONS OF APPROVAL, IF ANY:

See above modifications and attached diagram.

*See Instructions on Reverse Side

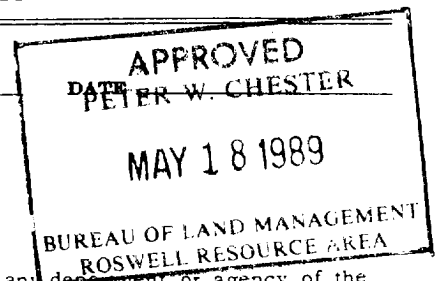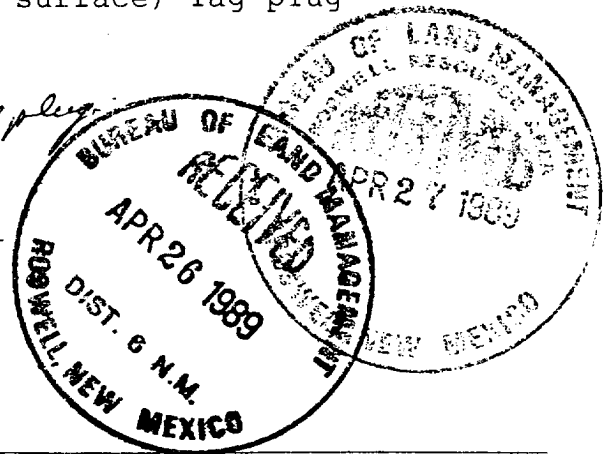

RECEIVED

JAN 30 1990

05
HOBBS C. 1990