

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRI
(Other instructio
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

N.M. 058677-A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Federal N. M. "B" /

9. WELL NO.

3

10. FIELD AND POOL, OR WILDCAT

South Prairie Penn11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA**Sec. 28, T-8-S, R-36-E**

12. COUNTY OR PARISH

Roosevelt

13. STATE

New Mexico1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Lone Star Producing Company

3. ADDRESS OF OPERATOR

Box 4815, Midland, Texas 797014. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)

At surface

**660' South of North Line & 1,980' East of West Line of
Section 28, T-8-S, R-36-E, Roosevelt County, New Mexico**

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

4,107.4' Ground

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☒CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☐(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

We desire your approval to plug and abandon Lone Star Producing Company's Federal N. M. "B" No. 3 well in the South Prairie Penn Field, Section 28, T-8-S, R-36-E. Location is 660' South of North Line and 1,980' East of West Line of Section 28. We plan to lay #1 plug, 25 sacks, from 9,690' up to 9,550'; #2 plug, 25 sacks, 20' below where 5 1/2" O.D. is out and pulled (approximately 7,200'); #3 plug, 25 sacks, from 5,500' up to 5,400'; #4 plug, 25 sacks, from 4,350' up to 4,250'; #5 plug 10 sacks in top of 8-5/8" O.D. protective casing; weld steel cap on top 8-5/8" O.D. casing; install marker 4' 6" above ground level. The 13-3/8" surface casing and 8-5/8" protective casing to be left in hole. These casing strings are circulated with cement. Fill cellar 1' above ground level, fill pits, pick debris off location and bury. Hole will be filled with heavy mud laden fluid.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Dist. Prod. Supt.

DATE

Feb. 9, 1966

(This space for Federal or State office use)


APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

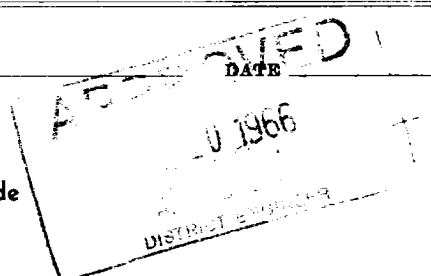

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.