

N. M. UEL CORR. COMMISSION
P. O. BOX 1980
HOBBS, NEW MEXICO 88240

Form 3180-5
(June 1990)

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT-" for such proposals

5. Lease Designation and Serial No.

LC 060978

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

Milnesand Unit

8. Well Name and No.

28

9. API Well No.

30-041-10151

1. Type of Well

Oil Gas
☒ Well ☐ Well ☐ Other

2. Name of Operator

MAERSK ENERGY Inc.

3. Address and Telephone No.

2424 Wilcrest, Suite 200, Houston, TX 77042-2753, 713/783-0376

10. Field and Pool, or Exploratory Area

Milnesand (San Andres)

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Unit Letter M: 660' from the West Line and 660' from the South Line SW SW Sec. 20
Township 8S, Range 35E

11. County or Parish, State

Roosevelt County, New Mexico

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment ☐ Change of Plans
☐ Recompletion ☐ New Construction
☐ Plugging Back ☐ Non-Routine Fracturing
☐ Casing Repair ☐ Water Shut-Off
☐ Altering Casing ☐ Conversion to Injection
☒ Other PERF & ACID ☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Work Described: Clean-out, reperforate and acid stimulate this shut-in San Andres Well.

Work Commenced: 06/11/93

Work Completed: 06/17/93

Operations Detail:

- 1) Move-in rig-up workover rig.
- 2) Pull rods, pump and tubing.
- 3) Clean-out well to PBTD of 4757' with a 3-7/8" bit.
- 4) Ran TDT-P log.
- 5) Perforated San Andres from 4661' - 4686', 4716' - 4720' and 4724' - 4750' with 4 SPF.
- 6) Cleaned perforations using fresh water and pressure fluctuation tool.
- 7) Acidized perforations with 4,000 gallons of 15% NeFe acid using pressure fluctuation tool.
- 8) Run tubing, tubing pump and anchor.
- 9) Run plunger and rods.
- 10) Place well on pump.

14. I hereby certify that the foregoing is true and correct.

Signed

Title

George Sheffer
Drilling Manager

Date

June 22, 1993

(This space for Federal or State office use)


Approved by

Title

Date

Conditions of approval, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

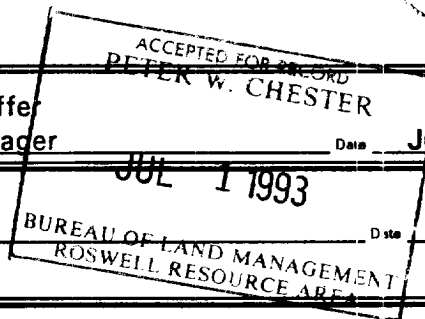

RECEIVED

JUL 12 1993

U.S. HOUSE
OF REPRESENTATIVES