

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☒ gas ☐
well well other

2. NAME OF OPERATOR
Champlin Petroleum Company

3. ADDRESS OF OPERATOR
P. O. Box 7946, Midland, TX 79708-0946

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 660' FEL & 1980' FSL
AT TOP PROD. INTERVAL: Same
AT TOTAL DEPTH: Same

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other)

☐
☐
☐
☐
☐
☐
☐
☒

5. LEASE

Federal NM 0108997

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Farrell-Federal

9. WELL NO.

3

10. FIELD OR WILDCAT NAME

Chaveroo (San Andres)

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 30, T7S, R33E


12. COUNTY OR PARISH
Roosevelt

13. STATE
New Mexico

14. API NO.

15. ELEVATIONS (SHOW DF, MRL AND WD)
4441 DF

(NOTE: Report results of multiple completion or zone change on Form 9-331-C)

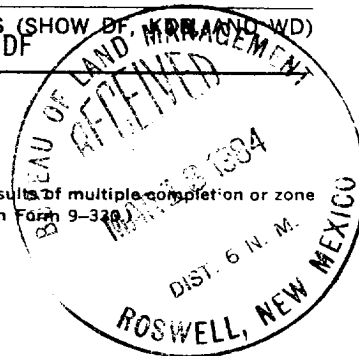

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

2/25/84 - MIRUSU - NDWH - NU BOP's - RIH w/4-1/2" CIBP on WL - set @ 4100' to abandon San Andres perms 4183-4387' - GIH w/2-3/8" tbq - displace hole w/10 ppg SW mud - spot 4 sx cmt plug on CIBP - TOC @ 4042' - POH w/tbg - ND BOP's - RU csg jacks - PU on 4-1/2" prod csg - est free point @ 1138' - RIH w/jet cutter - cut 4-1/2" prod csg @ 1050' - POH w/WL - POH w/1050' 4-1/2" prod csg - RIH w/2-3/8" tbq to 1716' - spot 60 sx Class "C" cmt plug 1116-834' - no fluid movement @ surface so TOC was not tagged - PU tbq to 421' - spot 65 sx Class "C" cmt plug 421-177' (surface csg shoe @ 361') - WOC - RIH w/WL - TU on TOC @ 247' - POH w/WL - spot 10 sx Class "C" cmt surface plug - cut off WH - instl dry hole marker - clean location of junk - will fill pits when dried up - RDMOSU 2/29/84
Well plugged 2/29/84
3392' 4-1/2" prod csg left in hole - 361' 8-5/8" surface csg left in hole

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Peter W. Chester TITLE Production Engineer DATE 3/9/84

APPROVED

(This space for Federal or State office use)

APPROVED BY (Sgt.) PETER W. CHESTER

TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:


APR 11 1984

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

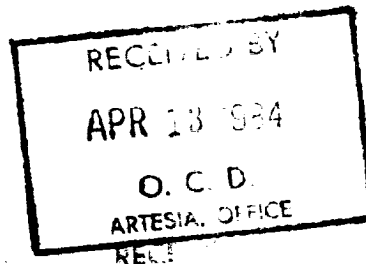

APR 17 1984

O. C. D.
HOPEL OFFICE