

UNITED STATES DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY
N. M. OIL CORP. BOHANNON
HOBBS, NEW MEXICO 88240

Form approved.
Budget Bureau No. 42 R1424
5. LEASE DESIGNATION AND SERIAL NO.

NM 4039-B

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		7. UNIT AGREEMENT NAME	
2. NAME OF OPERATOR Petroleum Production Management, Inc.		8. FARM OR LEASE NAME Will 693 Ltd.	
3. ADDRESS OF OPERATOR Suite 200/Sutton Place Bldg. Wichita, Kansas 67202		9. WELL NO. 3	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 510' FSL and 1980' FWL, Sec. 34, T-8-S, R-35-E		10. FIELD AND POOL, OR WILDCAT Vada Penn	
14. PERMIT NO.		11. SEC. T., R., M., OR BLK. AND SURVEY OR AREA Sec. 34, T-8-S, R-35-E	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 4194' KB 4182' GL		12. COUNTY OR PARISH Roosevelt	
		13. STATE N.M.	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:


TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
(Other) <u>Plug back and side track old hole</u> <input checked="" type="checkbox"/>	

SUBSEQUENT REPORT OF:

WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
(Other) <input type="checkbox"/>	
(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)	

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

1. Run tubing in hole to top of fish at 9764' depth.
2. Spot 550 sacks cement to bring top of cement to 5600' which is 100' above all bad spots in casing. Reverse out excess cement from 5600'. Tag top of cement.
3. Salvage 5 1/2" casing from 5000' depth.
4. Spot 100' cement plug from 50' inside 5 1/2" casing stub.
5. Side track hole in an easterly direction with a 7 7/8" bit. Drill a new hole to 9850' depth.
6. Run 5 1/2" casing to 9850' and cement.
7. Perforate Pennsylvanian (Bough "C") porosity.
8. Acidize as necessary to establish production.
9. Install producing equipment and restore well to production.

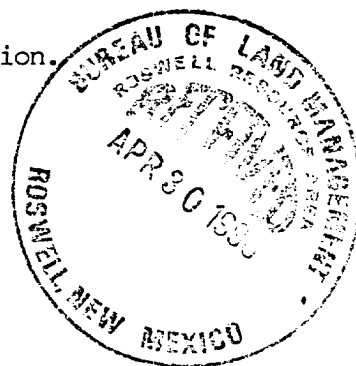

18. I hereby certify that the foregoing is true and correct

SIGNED

Wm. B. Bessick

TITLE

District Engineer

DATE

4-27-90

(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

See attached conditions

APPROVED
DATE

MAY 10 1990

*See Instructions on Reverse Side

BUREAU OF LAND MANAGEMENT
ROSWELL RESOURCE AREA



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

ROSWELL RESOURCE AREA

P.O. DRAWER 1857

ROSWELL, NEW MEXICO 80202-1857



IN REPLY REFER TO:

NM-4039-B


3-Will 693 Ltd

510'/S 1980'/W

34-8S-35E

CONDITIONS OF APPROVAL FOR SUNDRY NOTICE DATED 4/27/90

1. These operations shall commence as soon as practical after receipt, by the operator, of the approved application.
2. If the operations are not continued in a diligent manner the lease shall be terminated.
3. The operator shall submit to this office, every week, a report of the daily progress on this project.

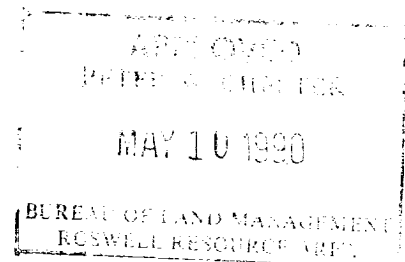

RECEIVED

MAY 14 1990

HOEBS OFFICE