

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on
reverse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM 11140

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Blockson-Federal

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Vada Penn

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 34, T-8-S, R-34-E

12. COUNTY OR PARISH
Roosevelt13. STATE
New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Sun Oil Company

3. ADDRESS OF OPERATOR

P.O. Box 1861 Midland, Texas 79702

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface

1980' FWL & 660' FSL, Sec. 34, T-8-S, R-34-E, Unit N

14. PERMIT NO.

Blanket

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

4258.7' GR

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☐CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT ☐(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-
nent to this work.) *

1978

1-3,4,5: MIRU, Inst BOP, pull Tbg, ran 4 3/4" bit & csg scraper to 9600',
POH, set CIBP 9575', dumped 5 sks cmt on BP, TOC, 95391-6,7,8: GO ran GR log 3800/5200, perf 5 1/2" csg @ 5100', ran ret on
WL to 5070', pmpd 200 bbls 9# brine atmpd to circ behind 5 1/2"
csg, unsuccessful, sqzd perfs @ 5100' w/150 sks, POH, GO perf
4712', TIH w/tbg & pkr to 4695', sqzd 4712 w/100 sks, reset pkr
4535', SD, crews off.1-9,10,11,12,13: GO perf 4688', set pkr 4659', pmpd 1 1/2 BPM @ 2800#, Rlsd pkr,
POH, GO ran GR neu log ran 4' csg gun, tagged TD 4698, Welox ran
GR log 3700/5028, ran 4 3/4" bit & CS to 4718, Welox reperf 4659,
pmpd 1/2 BPM @ 3000#, sptd 250 gals 15% acid, pmpd 3 1/2 BPM @
3200#, sqzd perfs 4712' & 4688' w/100 sks, WOC 2 1/2 hrs, rvsd
our cmt colored wtr, reset pkr @ 4226' press tbg 2000# & csg 500#,
POH, tag cmt 4549', POH, ran bit drld cmt 4555/4715'.1-14,15: POH, perf 4625, ran tbg & pkr to 4412, sqzd perfs 4625 w/100 sks,
crews off.This approval of temporary
abandonment expires 2-1-79

SEE ATTACHMENT

18. I hereby certify that the foregoing is true and correct


SIGNED Don BarryTITLE Office AssistantDATE 2-21-78

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

*See Instructions on Reverse Side

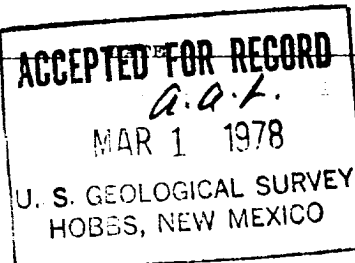

RECEIVED

MAR 8 1978

OIL CONSERVATION COMM.
HOUSTON, TEXAS