

N. M. O. C. & COPY
UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE
(Other instruction
reverse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM 0391191

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

None

7. UNIT AGREEMENT NAME

None

8. FARM OR LEASE NAME

Grynberg

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Caprock Queen

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

10-155-31E

12. COUNTY OR PARISH

Chaves

13. STATE

New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different zone.
Use "APPLICATION FOR PERMIT—" for such proposals.)1. OIL WELL ☒ GAS WELL ☐ OTHER ☐
MAY 11 11 32 AM '66

2. NAME OF OPERATOR

Charles B. Read

3. ADDRESS OF OPERATOR

P. O. Box 1822, Roswell, New Mexico

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface

1650' F#1 and 330' F#1 Sec. 10-155-31E

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

4415' DF

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐
☐
☐
☐
☐

PULL OR ALTER CASING

☐
☐
☐
☐
☐

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐
☐
☐

REPAIRING WELL

☐
☐
☒

FRACTURE TREATMENT

ALTERING CASING

SHOOTING OR ACIDIZING

ABANDONMENT*

(Other)

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-
nent to this work.)*

Well plugged and abandoned on July 27, 1965, as follows:

Pulled 2925' of 7/8" and 3/4" sucker rods and 2962' of 2 1/2" tubing. Shot
off 4 1/2" casing at 2514', pulled and recovered 2514' of 4 1/2" 9.5# J-55 casing.
Set cement plugs as follows:15 sx at total depth, 25 sx at 2464-2564, 25 sx at top of
salt 1350-1450', 25 sx at base of surface casing 350-450',
10 sx at surface.Heavy mud spotted between plugs. Installed dry hole marker inscribed as
follows:Charles B. Read #1 Grynberg
NE 1/4 NW 1/4 Sec. 10-155-31E

RECEIVED

AUG 11 1965

U. S. GEOLOGICAL SURVEY
ARTESIA, NEW MEXICO

18. I hereby certify that the foregoing is true and correct

SIGNED

Charles B. Read

TITLE

Operator

DATE

Aug. 9, 1965


(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

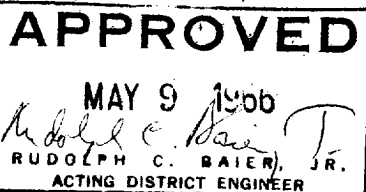

*See Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.