

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☐ Gas Well ☒ Other Plug & Abandon Well

2. Name of Operator

McClellan Oil Corporation

3. Address and Telephone No.

P O Drawer 730, Roswell, NM 88202-0730 505-622-3200

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

660' FNL & 330' FEL, Sec. 30-T15S-R30E, N.M.P.M.

5. Lease Designation and Serial No.

NM-10598

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Harris Federal #1

9. API Well No.

30-005-20359

10. Field and Pool, or Exploratory Area

Wildcat

11. County or Parish, State

Chaves, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☐ Subsequent Report
☒ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other Repair Well

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

6/23/2000

Plugged the Harris Federal No. 1 well as follows:

Cut out old dry hole marker.

Clean out hole to plug at 1320' and circulate clean.

Spot 100 sxs Class "C" Neat from 1150' - 1315'


Spot 125 sxs Class "C" + 4% CaCl₂ from 350' - 600'

Wait 2 hours and tag at 335'

Spot 25 sxs Class "C" Neat from surface to 60'. Witnessed by Stan Mayo of BLM.

Install dry hole marker - Fill in temporary pit and rip location.

Final Abandonment Notice.

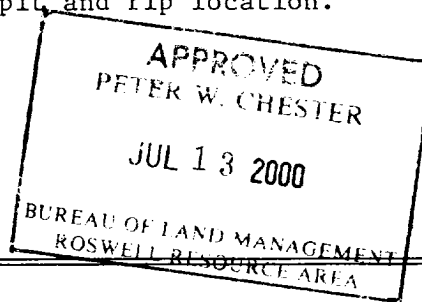

14. I hereby certify that the foregoing is true and correct

Signed Mark McClellan

Title President

Date 6/5/2000

(This space for Federal or State office use)

Approved by _____

Title _____

Date _____

Conditions of approval, if any: