

STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION

P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-78

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Armstrong Energy Corporation	8. Farm or Lease Name Sara
3. Address of Operator P.O. Box 1973 - Roswell, NM 88201	9. Well No. #2
4. Location of Well UNIT LETTER <u>K</u> , <u>1980</u> FEET FROM THE <u>south</u> LINE AND <u>1980</u> FEET FROM THE <u>west</u> LINE, SECTION <u>3</u> TOWNSHIP <u>11S</u> RANGE <u>3E</u> NMPM.	10. Field and Pool, or Wildcat Tower-San Andres
15. Elevation (Show whether DF, RT, GR, etc.) 4509.5' GL	12. County Chaves

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Proposed to plug and abandon, as follows:

Fill hole with mud-laden fluid.  
Spot 20 sx. cement plug 4160'-3865'.  
Cut and pull 4-1/2" casing @ 2500'+.  
Spot 35 sx. cement plug at 2550'-2414'.  
Spot 30 sx. plug 2230'-2113'.  
Spot 30 sx. plug @ 1480'-1363'.  
Spot 10 sx. cement plug 100' to surface.  
Install dry hole marker. Clean location.


18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Agent DATE 12/8/82

APPROVED BY JERRY SEXTON TITLE DISTRICT 1 SUPR. DATE DEC 10 1982  
CONDITIONS OF APPROVAL, IF ANY:

PROPOSED PLUG AND ABANDONMENT

Sara No. 2  
Armstrong Energy Corporation  
1980' FSL & 1980' FWL  
Sec. 3, T-11S, R-30E  
Chaves County, New Mexico

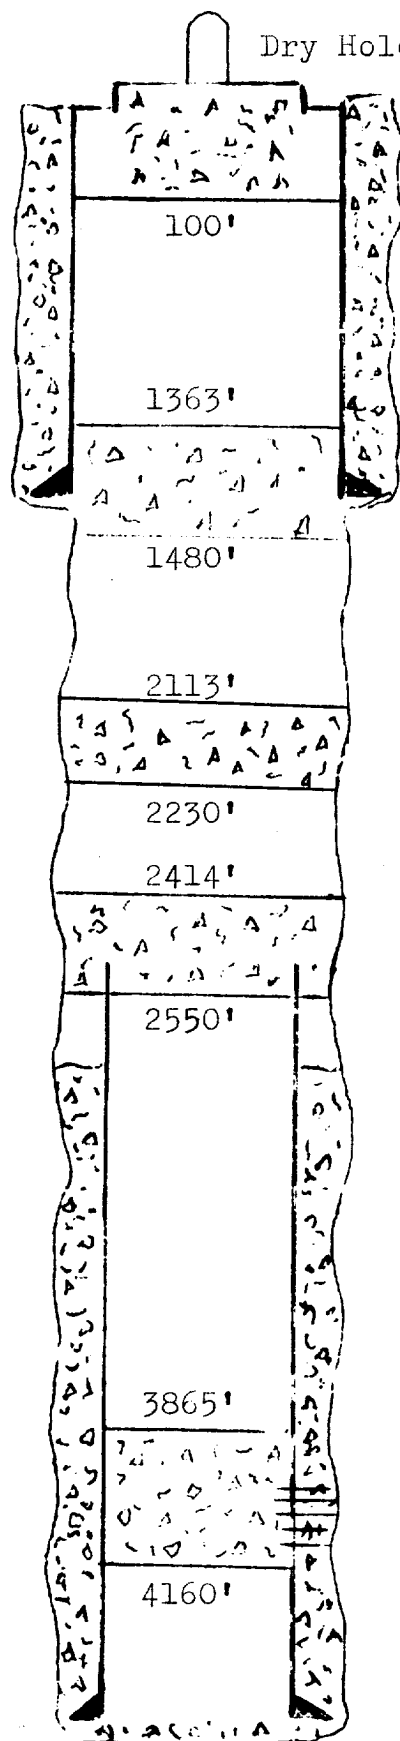

1475' - 8-5/8", 24#, K-55, ST&C

Surface shoe plug

Top Yates

FORMATION TOPS:

Yates - 2232'  
Seven Rivers - 2353'  
Queen - 2962'  
San Andres - 3495'

Est. TOC @ 2800'

Perfs: 4135'-4206'

4231' - 4-1/2", 10.5#, K-55, ST&C