

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☒ gas well ☐ other ☐

2. NAME OF OPERATOR
Flag-Redfern Oil Company

3. ADDRESS OF OPERATOR

P.O. Box 11050 Midland, TX 79702

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)

AT SURFACE: 660' FSL and 660' FEL

AT TOP PROD. INTERVAL:

AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

CHANGE ZONES ☐

ABANDON* ☐

(other) ☐

☐
☐
☐
☐
☐
☐
☐
☐
☒

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

3-27-84 MIRU Monument Well Service. RU Halliburton. Using 2 3/8" tubing, spotted 35 sx plug from 4140 to 3624. Pulled above plug. Loaded hole with mud laden fluid. Shot casing off at 2375'.

3-28-84 Pulled and layed down 2364' 4 1/2" casing. Using 2 3/8" tubing, spotted 25 sx plug from 2425 to 2325. Spotted 25 sx plug from 1678' to 1578'. Spotted 20 sx surface plug.

3-29-84 Cut casing off below ground level. Weld plate and 4" x 4' marker on casing stub, clean location.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Kelly J. Jansen TITLE Engineer DATE 4-18-84

APPROVED (This space for Federal or State office use)

APPROVED BY PETER W. CHESTER
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____ DATE _____

MAR 3 1986

BUREAU OF LAND MANAGEMENT
ROSWELL RESOURCE AREA See Instructions on Reverse Side

88216 ASE

USA NM-15677

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Hahn Federal

9. WELL NO.

1

10. FIELD OR WILDCAT NAME

Tom Tom (San Andres)

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 23, T-7-S, R-31-E

12. COUNTY OR PARISH

Chaves

13. STATE

NM

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)
4378 GR

PA Como Pasted



RECEIVED
MAR 10 1986
C.C.D.
HOBBS OFFICE

KE 4388
GR 4378


20 sx cement plug at surface

35 sx cement plug (1678' to 1578')

25 sx cement plug (2425' to 2325')

25 sx plug (4140 to 3624')

PBTD - 4156'

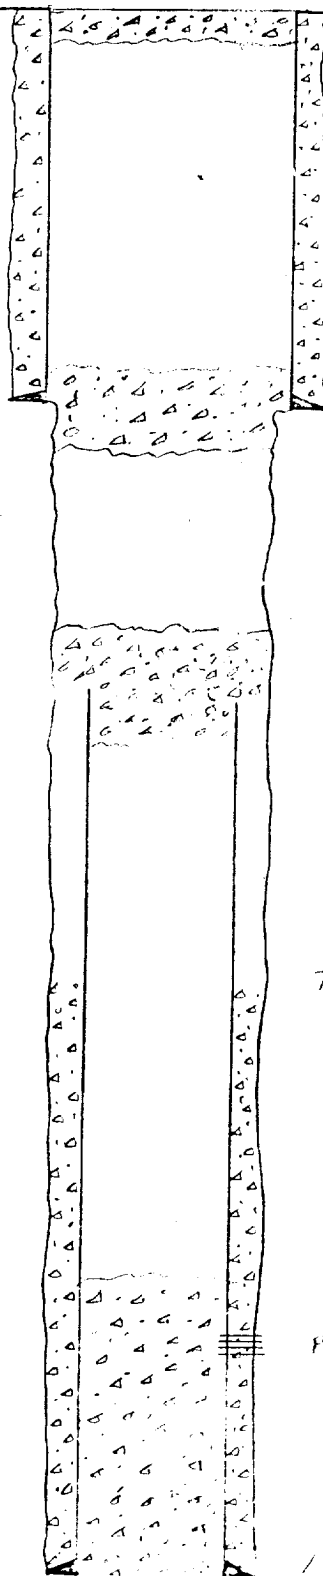

12 1/4" O.H. 25 1/2" 2A# J-56 STL
CSG set @ 1628' Cont. 11' 11"
200 SX 11' 11" 200 SX 11' 11"
Cont. 11' 11"

Casing stub @ 2375'

TOC calculated @ 3500'

Perfs 3988, 89, 90, 4002, 03 PA, 20, 21, 27, 53,
4028, 29, 34, 45, 52, 53, 54, 94, 95, 97,
4100, 02, 05, 06, 09, 10, 22, 26, 27, 28, 34,

1 7/8" O.H. 4 1/2" 10.5# K-55 STL
CSG set 4152' Cont. with 250 SX
50-50 21' 11" (Yield 150-155)

RECEIVED
MAR 10 1986
O.C.D.
HOBBS OFFICE