


4-15-93 Set retainer @ 2479'. Squeezed with 25 sx. Class "C", 25 sx. Micro Matrix, came out. Went back with bit, collars, etc. Shut down.

4-16-93 Drilled out retainer and cement, very little cement across perfs. Well would not test, good pressure came up from formation. Pulled bit, collars, etc. Shut down.

4-19-93 Set retainer @2516. Squeezed with 250 gals. Flow Check, 100 sx. cement.

4-20-93 Ran bit, collars, etc. Drilled out squeeze job. Tested @ 2640'. Test OK. See attached chart.

4-21-93 Ran tension packer, 82 jts. 2 3/8" plastic coated tbg. Packer set @ 2667.93. Preparing to begin water injection.

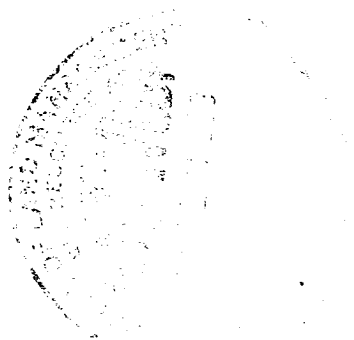

**RECEIVED**

**MAY 14 1993**

**OOD HOBBS OFFICE**