


UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE
(Other: Indicate on
reverse side)

Budget Bureau No. 1004-0135
Expires August 31, 1985
5. LEASE DESIGNATION AND SERIAL NO.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

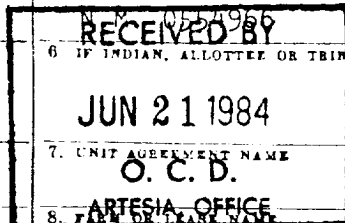

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	2. NAME OF OPERATOR HILLIARD OIL & GAS, INC.	7. UNIT AGREEMENT NAME O. C. B.
3. ADDRESS OF OPERATOR 3000 N. Garfield, Ste. 120, Midland, TX 79705	8. FIELD OR OFFICE ARTESIA OFFICE	9. WELL NO. 1
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At Surface 1900' FNL & 990' FEL 25 miles East of Hagerman, N.M.	10. FIELD AND POOL, OR WILDCAT Wildcat (Atoka) (Wolfcamp)	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 17, T-15-S, R-30-E
14. PERMIT NO.	15. ELEVATIONS (Show whether FF, RT, GR, etc.) 4059 GR	12. COUNTY OR PARISH Chaves
		13. STATE New Mexico

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐
FRAC TREAT ☐	MULTIPLE COMPLETION ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐
REPAIR WELL ☐	CHANGE PLANE ☐
(Other) ☐	

WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRAC TREATMENT ☐	ALTERING CASING ☐
SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☒
(Other) ☐	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

1. MI & RU, NU BOP.
2. Released pkr. & circ. 10.0 ppg gel brine. POH w/tbg. RU wireline unit, dump 35' cmt. on CIBP @ 8660'. WIH & set CIBP @ 8148'. TIH w/open end tbg. to top CIBP @ 8148' & spot 4 sks cmt. fr 8148' to 8112'. POH w.tbg.
3. RU csg. jacks, found csg. 60% free @ 4810'.
4. Cut csg. w/jet cutter @ 4810'.
5. POH w/115 jts. (4810') 5 1/2" csg. Ran 2-3/8" tbg to 4860' (50' in top 5 1/2" csg) & spot 35 sks C1 "H" cmt plug fr 4860'-4760'. WOC. WIH w/tbg. & tag top plug @ 4740'.
6. PU & set tbg @ 4550' & spot 35 sks C1 "H" cmt plug fr 4550' to 4450'. WOC. Tag plug @ 4430'.
7. Set tbg @ 2968' & spot 40 sks C1 "H" cmt. plug fr 2968'-2868'. WOC. Tag plug @ 2968' w/tbg & spot 40 sks C1 "H" cmt plug 2928'-2828'. WOC. Tag plug @ 2862'.
8. Set tbg @ 580' & spot 30 sxs cmt plug fr 580'-478'.
9. PU & spot cmt plug fr 50' to base of cellar.
10. Cut off 8-5/8" csg.
11. Installed permanent dry hole marker 6-5-84.
12. Presently cleaning location & upon completion of clean up, Bureau of Land Management shall be notified for inspection of wellsite.

18. I hereby certify that the foregoing is true and correct

SIGNED W. L. Motley
W. L. MOTLEY
(This space for Federal or State office use)

TITLE Sr. Production Engr.

DATE 6-14-84

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

DATE _____

*See Instructions on Reverse Side



LTR



Job separation sheet

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
Artesia, NM 88210

NEW MEXICO STATE TRIBAL COMMISSION
(Other Governmental Agency)

Budget Bureau No. 1004-0135
Expires August 31, 1985

LEASE DESIGNATION AND SERIAL NO.

N. M. 0554966

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR Hilliard Oil & Gas, Inc.	8. FARM OR LEASE NAME Harris Federal
3. ADDRESS OF OPERATOR 3000 North Garfield, Suite 120 Midland, Texas 79705	9. WELL NO. 1
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 1900' FNL & 990' FEL 25 miles East of Hagerman, New Mexico	10. FIELD AND POOL, OR WILDCAT Wildcat (Atoka) (Wolfcamp)
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.) 4059 GR
12. COUNTY OR PARISH Chaves	13. STATE New Mexico

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF	PULL OR ALTER CASING
FRACTURE TREAT	MULTIPLE COMPLETE
SHOOT OR ACIDIZE	ABANDON*
REPAIR WELL	CHANGE PLANE
(Other)	

WATER SHUT-OFF	REPAIRING WELL
FRACTURE TREATMENT	ALTERING CASING
SHOOTING OR ACIDIZING	ABANDONMENT*
(Other)	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Prior Operations: Perfs 10315'-10323' CIBP @ 10305'. Perfs 10240'-10286' CIBP @ 10207'.
Perfs 10150'-10156' CIBP @ 10100'. Perfs 8736'-8752' CIBP @ 8660'. Present perfs @ 8160'-8166'.

Proposed Operations:

1. MIRU csg. pullers. Release pkr. Circ hole w/mud-laden brine. POOH w/tbg & pkr.
2. Dump 35' cmt on CIBP @ 8660'. See CIBP @ 8150'; dump 35' cmt.
3. Weld on lift nipple and get 5 1/2" csg free point.
4. Cut csg w/jet cutter.
5. POOH. Lay down 5 1/2" csg.
6. Run 2 3/8" tbg. Spot 100' cmt plug 4550'-4450'.
7. Spot 100' cmt plug across 5 1/2" stub 50' in and 50' out and tag.
8. Spot 100' cmt plug at 8 5/8" shoe 2868'-2968' 50' in and 50' out and tag.
9. Spot 100' cmt plug at 13 3/8" shoe 478'-578' 50' in and 50' out.
10. Cut off 8 5/8" csg head 40" below G.L.
11. Spot 50' surface cmt plug.
12. Weld plate on 8 5/8" and install P & A marker
13. Cover reserve pit, re-seed, clean location.

P & A to begin when equipment available. P & A due to non-commercial oil or gas.

18. I hereby certify that the foregoing is true and correct

SIGNED Jack Bledsoe TITLE Production Superintendent DATE May 15, 1984

(This space for Federal or State agency use)

APPROVED PETER W. CHESTER TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

MAY 18 1984

*See Instructions on Reverse Side

RECEIVED BY
MAY 21 1984
O. C. D.
ARTESIA, OFFICE

RECEIVED
MAY 28 1984
O.C.D.
HOBBS OFFICE