


OIL CONSERVATION COMMISSION

Santa Fe, New Mexico

MISCELLANEOUS REPORTS ON WELLS

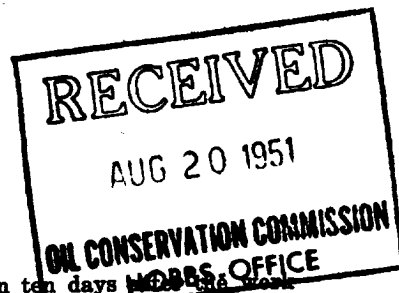

Submit this report in triplicate to the Oil Conservation Commission or its proper agent within ten days ~~after the work~~ specified is completed. It should be signed and sworn to before a notary public for reports on beginning drilling operations, results of shooting well, results of test of casing shut off, result of plugging of well, and other important operations, even though the work was witnessed by an agent of the Commission. Reports on minor operations need not be signed and sworn to before a notary public. See additional instructions in the Rules and Regulations of the Commission.

Indicate nature of report by checking below.

REPORT ON BEGINNING DRILLING OPERATIONS		REPORT ON REPAIRING WELL	
REPORT ON RESULT OF SHOOTING OR CHEMICAL TREATMENT OF WELL		REPORT ON PULLING OR OTHERWISE ALTERING CASING	
REPORT ON RESULT OF TEST OF CASING SHUT-OFF		REPORT ON DEEPENING WELL	
REPORT ON RESULT OF PLUGGING OF WELL	<input checked="" type="checkbox"/>		

August 15, 1951

Hobbs, New Mexico

Date

Place

OIL CONSERVATION COMMISSION,
SANTA FE, NEW MEXICO
Gentlemen:

Following is a report on the work done and the results obtained under the heading noted above at the _____
Stanolind Oil and Gas Co. **Lois Wingard** Well No. **1** in the

NE 1/4 Company or Operator **24** Lease
of Sec. **12-S**, T. **12-S**, R. **37-E**, N. M. P. M.,
Unamed Field, **Lea** County.

The dates of this work were as follows: **July 10, - August 6, 1951**

Notice of intention to do the work was ~~submitted~~ submitted on Form C-102 on **July 9** 19**51**
and approval of the proposed plan was ~~obtained~~ obtained. (Cross out incorrect words.)

DETAILED ACCOUNT OF WORK DONE AND RESULTS OBTAINED

The above well was abandoned as follows:

Set 20 sack cement plug 9940-9934, shot off 7" casing at 5157' and pulled same. Spotted 20 sack plug in 7" stub at 5157' and 15 sack plug in the bottom of the 9-5/8" casing at 1698. 9-5/8" casing was shot off at 1265' and pulled. 20 sack plug was spotted in 9-5/8" stub. 20 sack cement plug was placed at 320' and 15 sack plug at surface. All intervals between plugs were filled with heavy mud laden fluid. A 4" pipe marker was erected to extend 5' above surface and location leveled to conform with surrounding terrain.

Witnessed by **K. W. Hulatt** **Stanolind Oil and Gas Co.** **Farm Boss**
Name Company Title

Subscribed and sworn before me this **15th**

day of **August** 19**51**

H. B. Frederick

Notary Public

I hereby swear or affirm that the information given above is true and correct.

Name **B. P. Nichols**

Position **Production Foreman**

Representing **Stanolind Oil and Gas Co.**

Company or Operator

My commission expires **Aug 28-1952**

Address **Box F, Hobbs, New Mexico**

Remarks:

APPROVED
AUG 20 1951

Date

Ray Garbrough
Oil & Gas Inspector Name
Title

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000