

State of New Mexico
Energy, Minerals and Natural Resources Department

DISTRICT I

P.O. Box 1980, Hobbs NM 88240

DISTRICT II

P.O. Drawer DD, Artesia NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-041-20688
5. Indicate Type of Lease	State <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.	

SUNDARY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name
WILCOX TS


1. Type of Well
OIL GAS
WELL WELL OTHER

2. Name of Operator
Yates Petroleum Corporation

3. Address of Operator
105 South 4th., Artesia, NM 88210

4. Well Location
Unit Letter **G** : **1980** Feet From The **NORTH** Line and **2310** Feet From The **EAST** Line
Section **19** Township **7S** Range **32E** NMPM **ROOSEVELT** COUNTY

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
4467' GR

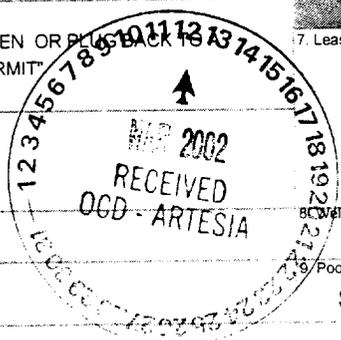

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER <input type="checkbox"/>		OTHER <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

YATES PETROLEUM CORPORATION requests permission to plug & abandon as follows:

MIRU - ND wellhead; NU BOP.TOH w/ tubing.
 RU wireline. RIH w/ 4-1/2" CIBP & set @ 3980'. Dump 35' cement on plug.
 TIH w/ tubing & circ hole w/ 9.5# mud.
 RIH w/ casing cutter & cut casing @ 3100'. RD wireline.
 TOH w/ 4-1/2" casing.
 Rig up cementers; TIH w/ tubing to 3150'. Spot 100' cement plug 3150-3050'. WOC & tag.
 Spot 100' cement plug 1622-1722'. — TAG
 Spot 60' cement plug at surface.
 Cut off wellhead & install regulation marker.
 SPOT 100' CEMENT PLUG F/400'-300'

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

I hereby certify that the information above is a true and complete to the best of my knowledge and belief.

SIGNATURE *Donna Clack* TITLE **Operations Technician** DATE **3/11/02**

TYPE OR PRINT NAME **DONNA CLACK** TELEPHONE NO **505-748-1471**

(This space for State Use)

APPROVED BY **GARY W. WINK** DATE **MAR 19 2002**

CONDITIONS OF APPROVAL, IF ANY

5
C