

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.
LC 029406 B

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
Mitchell

9. WELL NO.
5

10. FIELD AND POOL, OR WILDCAT
Maljamar Gbr SA

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA
5 - 17 - 32

12. COUNTY OR PARISH
Lea

13. STATE
N. M.

SUNDRY NOTICES AND REPORTS ON WELLS
(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER WIW

2. NAME OF OPERATOR
Ryder Scott Management Company

3. ADDRESS OF OPERATOR
922 - 8th Street, Wichita Falls, Texas 76301

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface
2310' FNL 330' FWL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)
4072' G. L.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

| NOTICE OF INTENTION TO: | | SUBSEQUENT REPORT OF: | |
|--|---|--|--|
| TEST WATER SHUT-OFF <input type="checkbox"/> | PULL OR ALTER CASING <input type="checkbox"/> | WATER SHUT-OFF <input type="checkbox"/> | REPAIRING WELL <input type="checkbox"/> |
| FRACTURE TREAT <input type="checkbox"/> | MULTIPLE COMPLETE <input type="checkbox"/> | FRACTURE TREATMENT <input type="checkbox"/> | ALTERING CASING <input type="checkbox"/> |
| SHOOT OR ACIDIZE <input type="checkbox"/> | ABANDON* <input type="checkbox"/> | SHOOTING OR ACIDIZING <input type="checkbox"/> | ABANDONMENT* <input checked="" type="checkbox"/> |
| REPAIR WELL <input type="checkbox"/> | CHANGE PLANS <input type="checkbox"/> | (Other) <input checked="" type="checkbox"/> | |

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

7-17-69 Set cast iron bridge plug @ 3640' in 5-1/2" csg. with 3 sx cmt ontop.
(Top perforation @ 3748')
Shot csg. at 1491' - filled hole with mud laden fluid.

Set 38 sx cmt. plug @ 1491' to 1391' - in & out of casing shoe.
" 32 " " " 960' to 860' - in & out of surface pipe.
" 10 " " " 31' to 0' - in & out of top of s.p.

Erected 4" metal marker & cleaned location.

Pulled 1455.09' of 5-1/2" casing.

18. I hereby certify that the foregoing is true and correct


SIGNED James S. Halsey TITLE Agent DATE 11-19-69

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

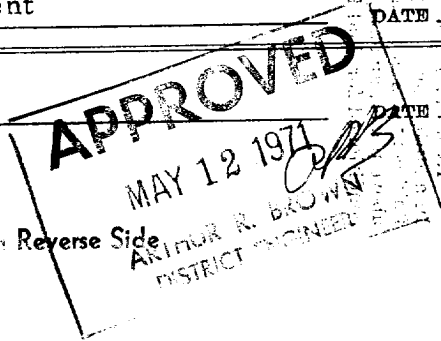

RECEIVED

MAY 10 1971

OIL CONSERVATION COMM.
HOBBS, N. M.