

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☒ gas well ☐ other

2. NAME OF OPERATOR
Chevron U.S.A. Inc.

3. ADDRESS OF OPERATOR
P. O. Box 1660, Midland, Texas 79702


4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: Unit 0, 660 FSL & 1980 FEL
AT TOP PROD. INTERVAL: Sec. 9, T-17-S, R-32-E
AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☒
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other)

SUBSEQUENT REPORT OF:

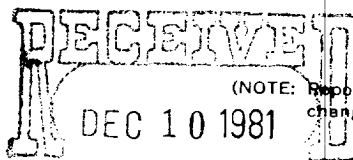

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

OIL & GAS
U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- 1) MIRU PU. Hot oil tbg., POOH w/rods & pump. NDWH. NUBOP.
- 2) Tally out of hole w/tbg.
- 3) RIH w/bit & scraper. CO if necessary. POOH w/bit & scraper.
- 4) Hydro-test tbg. in hole w/pkr. Set pkr. @3700' ±.
- 5) Treat well w/gyp solvent. Swab back for clean up.
- 6) Pump gyp inhibitor followed by 2000 gals. 15% NE HCL.
- 7) Swab back load. POOH w/pkr.
- 8) RIH w/prod. tbg. NDBOP. NUWH. RIH w/rods & pump.
- 9) Conduct production tests.

Subsurface Safety Valve: Manu. and Type

Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Steven C. Hamme TITLE Eng. Asst.

DATE 12-8-81

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

APPROVED

DEC 10 1981

JAMES A. GILLHAM
DISTRICT SUPERVISOR