

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☒ gas ☐ other ☐
well well well
2. NAME OF OPERATOR
CONOCO INC.
3. ADDRESS OF OPERATOR
P. O. Box 460, Hobbs, N.M. 88240
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 1980' FSL & 660' FEL
AT TOP PROD. INTERVAL: ☒
AT TOTAL DEPTH: ☒

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☒
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other) Inhibit ☒

SUBSEQUENT REPORT OF:

☐
☐
☐
☐
☐
☐
☐
☐
☐

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Please amend as follows sundry notice for the subject well dated 9/30/82 and approved 10/06/82. C.O. to 4400'. Set RBP @ 4270'. Perforate the following intervals w/ 2 JSPP @ 4083'-4094', 4099'-4105', 4111'-4121', 4139'-4147', 4155'-4162', 4226'-4240'. TOTAL 112 SHOTS. Set pkr. @ 4050'. Acidize 4083'-4240' w/ 3000 gal. 15% HCL LSTNE. Pump 400 lbs. rock salt, 12 lbs. guar gum. Flush to 4240' w/ 2% KCL TFW. Swab. Inhibit 4083'-4240' w/ one drum chemical mixed in 10 bbl. 2% KCL TFW. Rel. pkr. Reset RBP @ 4025'. Spot 95 gal. 15% HCL LSTNE from 3896'-3990'. Perforate the following w/ 2JSPP 3896'-3900', 3946'-3952', 3986'-3990'. TOTAL 28 SHOTS. Set pkr. @ 3870'. Acidize from 3896'-3990' w/ 1400 gal. 15% HCL LSTNE. Flush to 3990' w/ 2% KCL TFW. Swab. Inhibit 3896'-3990' Same as above. Rel. pkr. Subsurface Safety Valve: Manu. and Type and RBP Run Production Equipment. Test. Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Wm A. Butterfield TITLE Administrative Supervisor DATE 4-04-83

APPROVED

(This space for Federal or State office use)

(Orig. Sig.) PETER W. GINTER

APPROVED BY: CONDITIONS OF APPROVAL, IF ANY:

TITLE DATE

APR 7 1983

5. LEASE
LC-061842
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
8. FARM OR LEASE NAME
MILLER BX
9. WELL NO.
2
10. FIELD OR WILDCAT NAME
MALJAMAR (G-SA)
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec. 14, T-17S, R-32E
12. COUNTY OR PARISH
LEA
13. STATE
NM
14. API NO.
15. ELEVATIONS (SHOW DF, KDB, AND WD)

RECEIVED

(NOTE: Report results of multiple completion or zone change on Form 9-331-C)

U.S. GEOLOGICAL SURVEY
HOBBS, NEW MEXICO

RECEIVED
APR 3 1983
O.C.D.
ACBS OFFICE

N. M. OIL CONS. COMMISSION
P. O. BOX 1980
HOBBS, NEW MEXICO 88240

Form Approved.
Budget Bureau No. 42-R1424

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☒ gas ☐
well well other

2. NAME OF OPERATOR
CONOCO INC.

3. ADDRESS OF OPERATOR
P. O. Box 460, Hobbs, N.M. 88240

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 1980' FSL & 660' FEL
AT TOP PROD. INTERVAL: ☒
AT TOTAL DEPTH: ☒

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☒
SHOOT OR ACIDIZE ☒
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other) ☐

SUBSEQUENT REPORT OF:

☐
☐
☐
☐
☐
☐
☐
☐

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
Miller BX

9. WELL NO.
2

10. FIELD OR WILDCAT NAME
Maljamar (G-SA)


11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec. 14 T-17S 32E

12. COUNTY OR PARISH
Lea

13. STATE
N.M.

14. API NO.

15. ELEVATIONS (SHOW DE KDB AND WD)

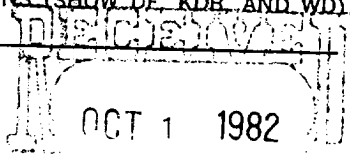

(NOTE: Report results of multiple completion or zone change on Form 9-330.) & GAS
U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

C/O to 4430'. Set RBP at 4300'. Swab. Perf following intervals w/ 2 JSF:

From	To	Feet	Shots
4240'	4226'	14	28
4162'	4155'	7	14
4147'	4139'	8	16
4121'	4111'	10	20
4105'	4099'	6	12
4094'	4083'	11	22

Set pkr. at 4200' and acidize 4226'-4240' w/ 1000 gals of 15% LSTNE-FE HCL. Flush w/ 30 bbls TFW. Reset RBP at 4200' & pkr. at 4130' and acidize 4139'-4162' w/ 1000 gals. (If communication indicated, reset pkr. at 4050' & acidize 4083'-4112' w/ 2000 gals.) Reset RBP at 4130' & pkr. at 4050' and acidize 4083'-4121' w/ 1000 gals. POOH w/ RBP, pkr. & working. Return well to production.

Subsurface Safety Valve: Manu. and Type

Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED D. E. Bingham

TITLE Administrative Supervisor DATE 9/30/82

APPROVED

(This space for Federal or State office use)

APPROVED BY JAMES A. GILLHAM
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____ DATE _____

OCT 6 1982

FOR
JAMES A. GILLHAM
DISTRICT SUPERVISOR

*See Instructions on Reverse Side

RECEIVED
OCT 8 1982
S.C.D.
HOBBS OFFICE