

Submit 3 Copies To Appropriate District Office.

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Ave., Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.  
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO.

30-025-03734

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

E9335-5

7. Lease Name or Unit Agreement Name:

STATE "T"

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator

Pronghorn Management Corporation

8. Well No.

1

3. Address of Operator

P. O. Box 1772 Hobbs, NM 88241

9. Pool name or Wildcat

Townsend Permo Upper Penn

4. Well Location

Unit Letter M : 2970 feet from the South line and 330 feet from the West line

Section 6

Township 16S Range 36E NMPM Lea County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)  
3965 RKB

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐


COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Set CIBP @ 10,100'. Cap w/ 35' cement.
2. Circulate hole with mud laden fluid.
3. Nipple up to 5 1/2" casing. Stretch, cut and pull 5459' casing.
4. Spot cement plug 50' in and out of stub. WOC and tag 5407'.
5. Spot 100 cement plug @ Int. csg. shoe. WOC and tag @ 4675'.
6. Spot 100' cement plug @ Top of Salt. WOC & tag @ 1925'.
7. Spot 100' cement plug @ 13 3/8" shoe. WOC & tag @ 245'.
8. Spot 10 sx. surface plug.
9. Erect dry hole marker. Clean location. 03/29/02

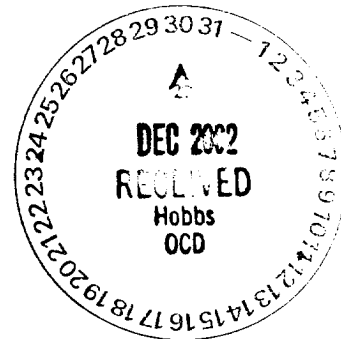

*Loc Rel 1-3-03 BEP*

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

TITLE

Partner

DATE 12/11/02

Type or print name

G. A. Baber

Telephone No. 505-393-9176

(This space for State use)

APPROVED BY

GARY V. WINK  
TITLE  
CC FIELD REPRESENTATIVE II/STAFF MANAGER

DATE JAN 03 2003

Conditions of approval, if any: