

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease State ☒ For ☐
5. State Oil & Gas Lease No. B-1505

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. Unit Agreement Name
2. Name of Operator ARCO Oil and Gas Company Division of Atlantic Richfield Company	8. Farm or Lease Name State 182 "A"
3. Address of Operator P. O. Box 1710, Hobbs, New Mexico 88240	9. Well No. 4
4. Location of Well UNIT LETTER <u>K</u> <u>1650</u> FEET FROM THE <u>South</u> LINE AND <u>2289.54</u> FEET FROM THE <u>West</u> LINE, SECTION <u>31</u> TOWNSHIP <u>16S</u> RANGE <u>37E</u> NMPM.	10. Field and Pool, or Wildcat Lovington Abo
15. Elevation (Show whether DF, RT, GR, etc.) 3813' GR	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☒	PLUG AND ABANDON ☐	REMEDIAL WORK ☒	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rig up, kill well, install BOP. POH w/compl assy.
2. Retrieve BP @ 8390'.
3. RIH w/pkr, set @ 8300' & press test csg. Isolate & cmt squeeze csg if necessary w/amt & kind of cmt to be determined.
4. Reset pkr @ 8385', swab test Abo perfs 8400-8430'. Cmt squeeze Abo perfs 8400-8430' if tested interval is uneconomical.
5. Set RBP @ 8320'.
6. Perforate additional Abo @ 8260, 62, 70, 73, 80, 82, 84, 90, 92, 95, 8302, 04' w/12 JS. Set pkr @ 8230' & acidize w/4000 gals 15% NE acid. Swab test.
7. POH w/pkr, retrieve BP. RIH w/compl assy & return to production.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Jerry Sexton TITLE Drlg. Engr. DATE 7/13/82


ORIGINAL SIGNED BY

JERRY SEXTON

APPROVED BY DISTRICT 1 SUPR.
CONDITIONS OF APPROVAL, IF ANY:

TITLE

JUL 15 1982

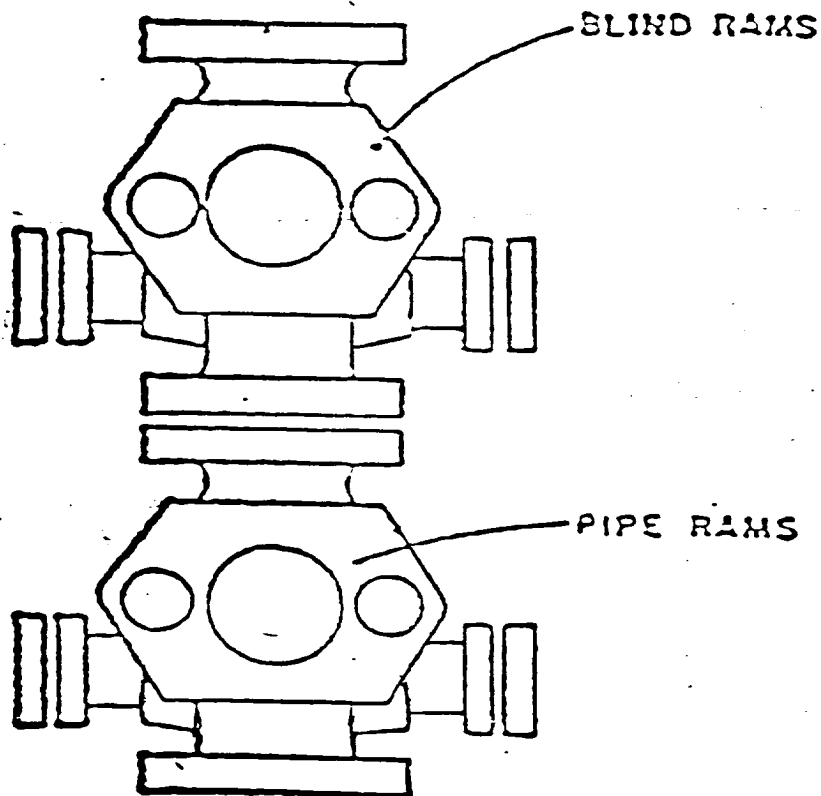

ARCO Oil & Gas Company

Division of Atlantic Richfield Company

Blow Out Preventer Program

Lease Name State 182 "A"

Well No. 4

Location 1650' FSL & 2289.54' FWL
31-16S-37E, Lea County

BOP to be tested when installed on well and will be maintained in good working condition during drilling. All wellhead fittings to be of sufficient pressure to operate in a safe manner.

RECEIVED

JUL 14 1982

RECORDS OFFICE