

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-015-12747
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. B-4062-3
7. Lease Name or Unit Agreement Name MCA Unit <i>Unit</i>
8. Well No. Well No. 10
9. Pool name or Wildcat Maljamar (G-SA)

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☐ GAS WELL ☐ OTHER ☒ Injection	
2. Name of Operator Conoco Inc.	
3. Address of Operator 10 Desta Drive West Midland, TX 79705	
4. Well Location Unit Letter <u>P</u> : <u>250</u> Feet From The <u>East</u> Line and <u>250</u> Feet From The <u>South</u> Line Section <u>16</u> Township <u>17-S</u> Range <u>32-E</u> NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4009' GL	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

The following procedure is recommended to permanently plug and abandon MCA Unit Well No. 10:

- 1) Pull out of hole w/plastic coated injection tbgs. and tension set pkr.
- 2) Run in hole w/bit and scraper to 3100'. POOH.
- 3) Run in hole & set 7" cement retainer @ 3100', and fill csg. & squeeze the Grayburg 6th & San Andres 7th perforations w/100 sacks of cement, and dump 25 sacks on cement retainer.
- 4) Set cement plug 7" csg. from 840'-2065' to cover salt section.
- 5) Shoot squeeze holes in 7" csg. @ 750' & circulate cement to surface in the 7" x 12-1/2" annulus & the 12-1/2" x surface hole annulus. A surface plug from 750' to surface will also be set.
- 6) All csg. strings will be cut 3' below surface, capped w/a steel plate & the cellar back filled w/sand to contour.
- 7) Install a 4" P&A marker. Clean and reseed location.

VERBAL APPROVAL 11/30/90
via Eddy Seay w/NMOCD

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Judson Wasson TITLE Administrative Supervisor DATE 12/3/90

TYPE OR PRINT NAME: Judson J. Wasson

TELEPHONE NO. (915) 686-6540


(This space for State Use)

Orig. Signed by
Paul Kautz
Geologist

DEC 13 1990

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

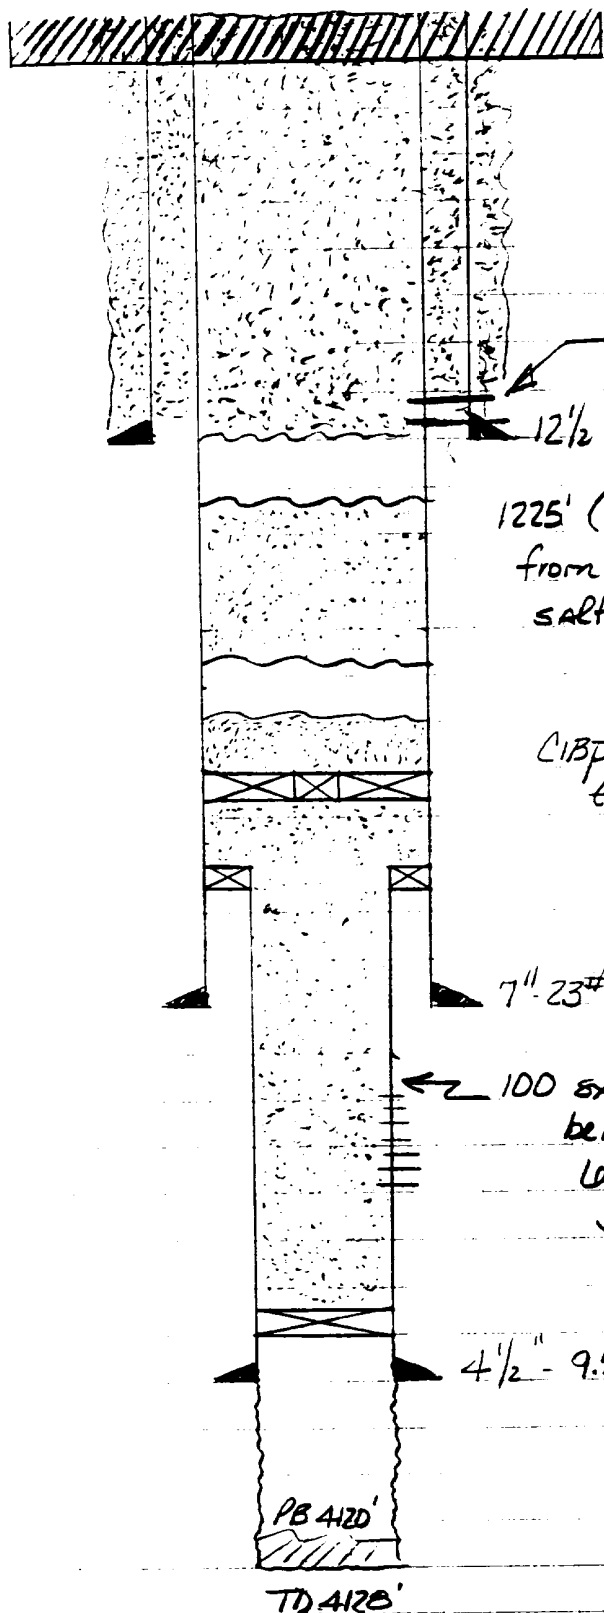

CELLAR BREAK filled to conform w/ sand
 & CS9. CUT 3' BELOW GL
 4" P&A marker to be installed

Squeeze holes @ 750' w/ cmt circulated
 to surface in both 7" & 12 1/2" annuli
 Surface plug in 7" from 750' to surface.
 (± 800 ex cmt)

TOP SALT - 942'
 Base SALT - 1965'

1225' (240 ex) CEMENT plug
 from 840' - 2065' TO COVER
 SALT SECTION + 100' OVER LAP

CIBP @ 3100' w/ 25 ex cmt
 to form a 125' plug from 2975' - 3100'.

7" 23# CS9 A 3232' (NOT CEMENTED)

100 ex of CEMENT pumped
 below CIBP to squeeze off the
 6th & 7th zone perforations from
 3750' - 4007' (interval) & form a CS9 plug.

4 1/2" 9.5# J-55 liner from 3135' - 4032'
 w/ 150 ex cmt

P&A 4120'

TD 4120'

Made By HED
 Checked By _____
 Date 11-15-90
 Page _____ of _____

Conoco Inc.
 Calculation Sheet

Title MCA No. 10
Proposed P&A sketch

Job No. _____
 Field _____
 State _____