

Form 3160-5
(June 1990)

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.
LC 029410B

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.
MCA # 323

9. API Well No.
30-025-24234

10. Field and Pool, or Exploratory Area

11. County or Parish, State
MAL JAMAR GRAYBURG SAN ANDRE
LEA, NM

SUBMIT IN TRIPLICATE

1. Type of Well
☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator
CONOCO INC.

3. Address and Telephone No.
10 Desta Drive STE 100W, Midland, TX 79705 (915) 686-6551

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
1345' FSL, 1380' FWL
SEC. 30, T-17S, R-32E, UNIT LTR 'K'


12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION
☐ Notice of Intent	☐ Abandonment
☒ Subsequent Report	☐ Recompletion
☐ Final Abandonment Notice	☐ Plugging Back
	☐ Casing Repair
	☐ Altering Casing
	☒ Other CASING LEAK
	☐ Change of Plans
	☐ New Construction
	☐ Non-Routine Fracturing
	☐ Water Shut-Off
	☐ Conversion to Injection
	☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

8-12-94 MIRU. POOH W/RODS & PUMP. POOH TBG. RIH W/BIT & SCRAPER TO 1500'. POOH. RIH W/RBP TO 1000'. PERF @ 750'. RIH W/13 STANDS. DUMPED SAND. POOH W/TBG 13 STANDS. RIH W/PKR & SET AT 527'. CMT WELL. RELEASE PKR. POOH W/TBG. RIH W/DRILL COLLARS & BIT. TAG CMT @ 606'. DRILL OUT CMT. POOH. RIH W/17 JTS & PKR. SET PKR. BJ SQZ WELL. UNSET PKR. POOH W/TBG. RIH W/BIT, SCRAPER, COLLARS, & TBG. TAG CMT @ 548. DRILLED OUT CMT. TEST CSG. BAD. POOH W/ TBG & COLLARS. RIH W/PKR TO FIND HOLE & SQZ HOLE. POOH W/TBG & PKR. RIH W/OPEN ENDED 25 JTS. RU HALLIBURTON & PUMP CMT. POOH. RIH W/ BIT, SCRAPER, & COLLARS. TAG CMT. DRILLED OUT CEMENT. POOH. TEST OK. CIRC SAND OFF RBP. POOH. RIH W/PROD. RIH W/PUMP & RODS. RD 8-23-94

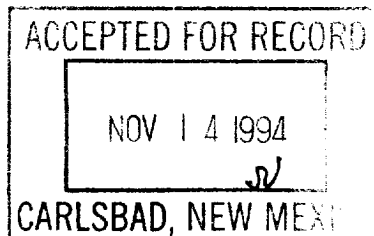

14. I hereby certify that the foregoing is true and correct
Signed [Signature] Title STAFF REGULATORY ASSISTANT Date 11-2-94

(This space for Federal or State office use)

Approved by _____ Title _____ Date _____
Conditions of approval, if any:

