

Details of bop test

Frank ., Aston, & Fair, Ltd.


Az . State #4

5/18/76

Contractor: Moranco Drlg. Rig 3

Test by Yellow Jacket Tools and Services, Inc.

=====Transposition of the pressure recorder chart=====

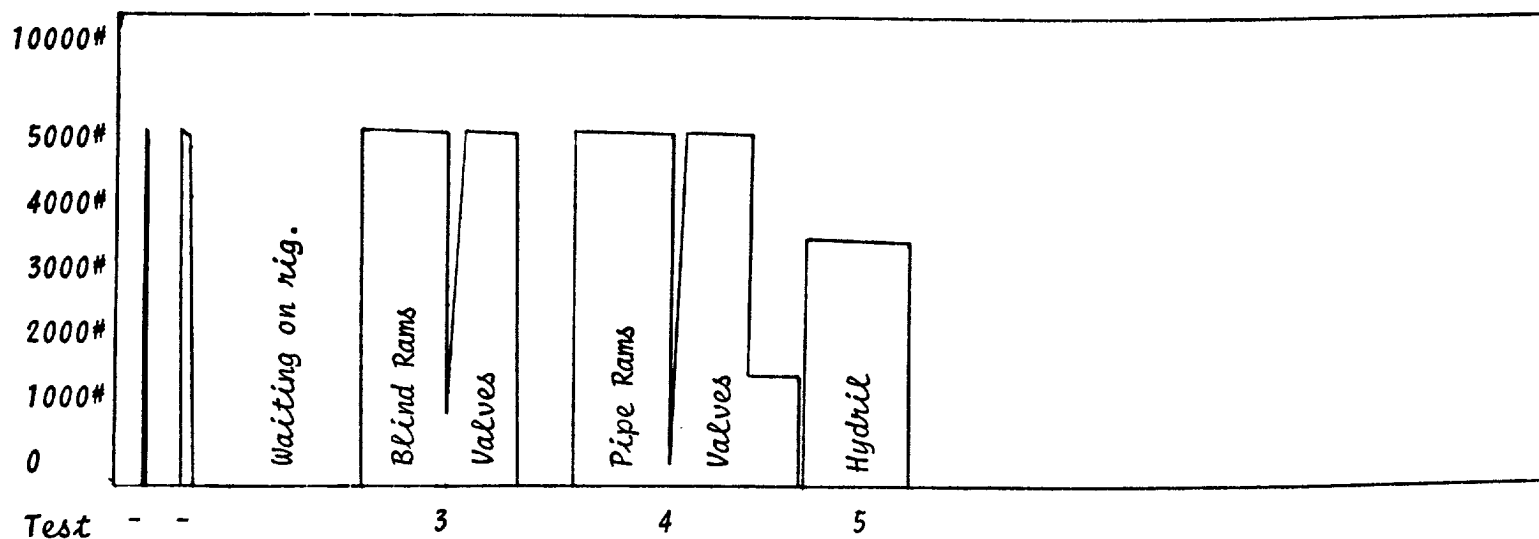

The above is a transposition of the pressure recorder chart covering test to the blowout control equipment in service on your well drilling in the Maljamar Area, Roswell District, New Mexico. Test was made with test plug landed in casing head with the following test results:  
Arrived location - rig coming out of hole.

TESTING: Blind Rams with inside valve closed next to stack on kill line, outlet valve closed off choke-manifold cross, and inside wing valves closed off manifold cross - pressure applied thru guage connection.

Test #1 Pressured to 5000# with leak to flange between outside valve off stack and chokeline. Tightened.

Test #2 Repeated test. Pressured to 5000# with leak to blind flange of blind rams bop (doghouse side). Tightened.

Waiting on rig.

Test #3 Repeated test. Pressured to 5000# with loss of approximately 100# during first nine minutes then