"ED STATES DEPARTMEINT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

			FORM APPROVED
			OMB NO. 1004-0135
N M	Oil	Can	Expires: November 30, 2000 5. Leas Schall No.
4.141.	OII	COLIS	o. UVISION.
100-			J. Lease beimar Mo.

Title 18 U.S.C. Section 1001, and Title 43 U.S.C. Section 1212, makes it a crime for any per of \$\frac{3}{2}\$ States any false, fictitious or fraudulent statements or representations as to any matter within 18 per


SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an Hobbs, NM 88240 lian, Allottce or Tribe Name

abandoned well. Use For	m 3160-3 (APD) for suc	h proposals.	,	- 10			
SUBMIT IN TRIPLICATE -	7.	7. If Unit or CA/Agreement, Name and/or No.					
		NMNM 71040A					
1. Type of Well		8. Well Name and No.					
X Oil Well Gas Well Other		SEMGSAU #9					
2. Name of Operator							
Cross Timbers Operating Company		9. API Well No.					
3a. Address	i	Phone No. (<i>include are</i> 915/682-8873	[30	30-025-01378			
3000 N. Garfield, Suite 175 Midlar		10. Field and Pool, or Exploratory Area Maljamar Grayburg San Andres					
4. Location of Well (Footage, Sec., T., R., M., or Survey	IVIA	LIJAHAI GIA	young san Aimes				
2310' FSL & 940' FWL, Sec. 33, T175	1	11. County or Parish, State					
				Lea NM			
12. CHECK APPROPRIATE	BOX(ES) TO INDICA	ATE NATURE OF N					
TYPE OF SUBMISSION	PE OF ACTION						
THE OF GODWIGSTON							
X Notice of Intent	Acidize	Deepen	Production (Sta	art/Resume)	Water Shut-Off		
	Alter Casing	Fracture Treat	Reclamation		Well Integrity		
Subsequent Report	Casing Repair	New Construction	Recomplete	Г	Other		
_			Temporarily A	bundan.			
Final Abandonment Notice	Change Plans	·					
	Convert to Injection	Convert to Injection Plug Back Water Dis			sposal		
Cross Timbers Operating Company 1 1) Dump 35' cmt on top of CIBP (2) Set 100' cmt plug from 2860' 3) Set 100' cmt plug from 1400' 4) Perf 4-1/2" csg @ 376' w/4 j: 5) Circ cmt through perfs @ 376 6) Set 100' cmt plug from 376'- 7) Set 50' cmt plug fr/50'-surfa 8) Cut off wellhead. 9) Set dry hole marker. 10) Fill pit and clean location. Wellbore diagrams attached.	4540'. Circulate -2760' (Yates). -1300' (Rustler). spf @ 90 deg phasin ' and up 4-1/2" x 8 276'.	hole w/9.5 ppggg.	mud.	ice.			
				, -			
14. Thereby certify that the foregoing is true and correct Name (Printed/Typed) D. Patrick Darden	Title Sr. Og	perations Engir	neer				
		Date 2/14/20 6	01				
THI	S SPACE FOR FEDER	AL OR STATE OF	FICE USE				
Approved by (ORIG. SGD.) DAVID	R. GLASS	PETROLEU	M ENGINEER	Date	FEB 2 8 2001		
Conditions of approval, if any, are attached. Approval certify that the applicant holds legal or equitable title twhich would entitle the applicant to conduct operations	of this notice does not warra o those rights in the subject	nt or Office	E ATTACH		-		

- CHRENT WB CANDITION

ELEV: KB 4061' GL 4049'

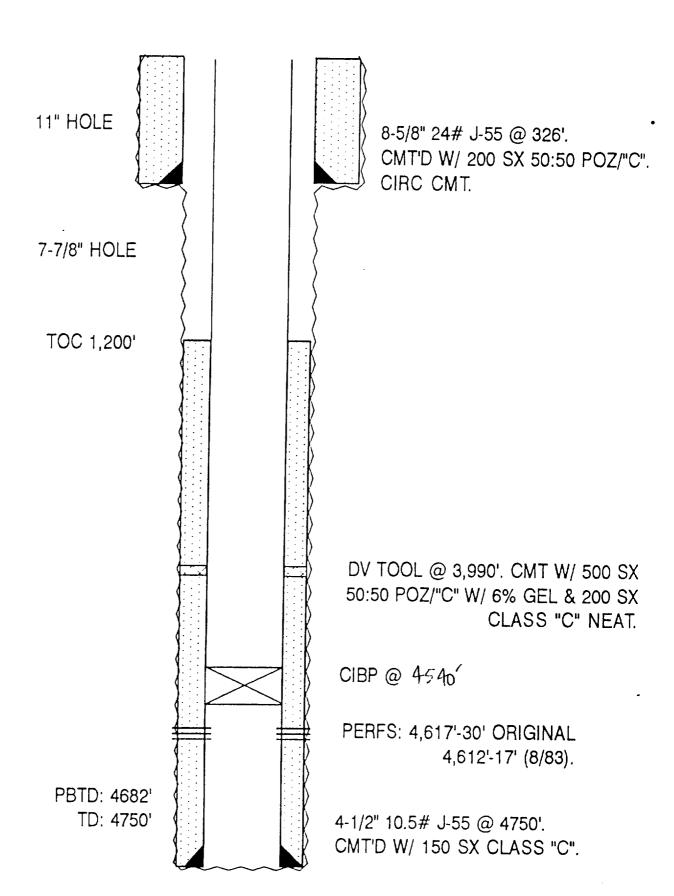

SEMGSAU#9 -PROPOSED PWGGING -

ELEV: KB 4061' GL 4049'

