

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-02022
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name	
Bridges State	
8. Well No.	#63
9. Pool name or Wildcat	Vacuum Grayburg (San Andres)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☐ GAS WELL ☐ OTHER ☒ Injector	2. Name of Operator Mobil Producing TX & NM Inc.* Mobil Exploration & Producing US Inc., as agent for MPTM
3. Address of Operator P.O. Box 633, Midland, TX 79702	4. Well Location Unit Letter <u>K</u> : 1980 Feet From The <u>South</u> Line and 1980 Feet From The <u>West</u> Line Section <u>13</u> Township <u>17S</u> Range <u>34E</u> NMPM Lea County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) KB 4020	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- MIRU PU. DIG PIT. FLOW WELL BACK TO PIT. ND WH. NU BOP.
- RIH W/ WS TO 4035'. LOAD HOLE W/ 10 PPG GELLED BRINE. PUH TO 2840'. SPOT 40 SX CLASS C NEAT CMT PLUG ACROSS SALT BASE @ 2790' AND TOC @ 2730' FROM 2840-2880'.
- PUH TO 1845'. CUT AND PULL 7" CSG OR PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG ACROSS SALT TOP @ 1795' FROM 1845-1745'. PLUG MUST BE TAGGED!
- PUH TO 880'. SPOT 50 SX CLASS C NEAT CMT PLUG ACROSS 10-3/4" CSG SHOE @ 830' FROM 880-780'. (IF 7" CSG NOT RECOVERED, PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG). PLUG MUST BE TAGGED!
- PUH TO 30'. SPOT 15 SX CLASS C NEAT CMT PLUG FROM 30'-SURFACE. POOH W/ WS.
- ND BOP. RD PU. DIG OUT CELLAR AND CUT CSG 3' BELOW SURFACE. WELD STEEL PLATE ON CSG STUB. ERECT P&A MARKER WITH WELL NAME AND PLUGGED DATE. FILL CELLAR AND CLEAN SURFACE LOCATION.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kaye Pollock TITLE Regulatory Technician DATE 08-16-93
TYPE OR PRINT NAME Kaye Pollock TELEPHONE NO. 915-688-2584

(This space for State Use)

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____ TITLE _____ DATE AUG 20 1993

CONDITIONS OF APPROVAL, IF ANY:

BRIDGES STATE # 63 WIW
VACUUM GRAYBURG (SAN ANDRES) FIELD
LEA COUNTY, NEW MEXICO



RECOMMENDED WORKOVER PROCEDURE

1. MIRU PU. DIG PIT. FLOW WELL BACK TO PIT. ND WH. NU BOP.
2. RIH W/ WS TO 4035'. LOAD HOLE W/ 10 PPG GELLED BRINE. PUH TO 2840'. SPOT 40 SX CLASS C NEAT CMT PLUG ACROSS SALT BASE @ 2790' AND TOC @ 2730' FROM 2840-2680'.
3. PUH TO 1845'. CUT AND PULL 7" CSG OR PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG ACROSS SALT TOP @ 1795' FROM 1845-1745'. **PLUG MUST BE TAGGED!**
4. PUH TO 880'. SPOT 50 SX CLASS C NEAT CMT PLUG ACROSS 10-3/4" CSG SHOE @ 830' FROM 880-780'. (IF 7" CSG NOT RECOVERED, PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG). **PLUG MUST BE TAGGED!**
5. PUH TO 30'. SPOT 15 SX CLASS C NEAT CMT PLUG FROM 30'-SURFACE. POOH W/ WS.
6. ND BOP. RD PU. DIG OUT CELLAR AND CUT CSG 3' BELOW SURFACE. WELD STEEL PLATE ON CSG STUB. ERECT P&A MARKER WITH WELL NAME AND PLUGGED DATE. FILL CELLAR AND CLEAN SURFACE LOCATION.

BRIDGES STATE
WELL # 63 WIW
VACUUM GRAYBURG (SAN ANDRES) FIELD
LEA COUNTY, NEW MEXICO
CURRENT COMPLETION

KB = 4020'
GL = 4009'

K. 13, T 17-S, R 34-E, 1980' FSL, 1980' FWL

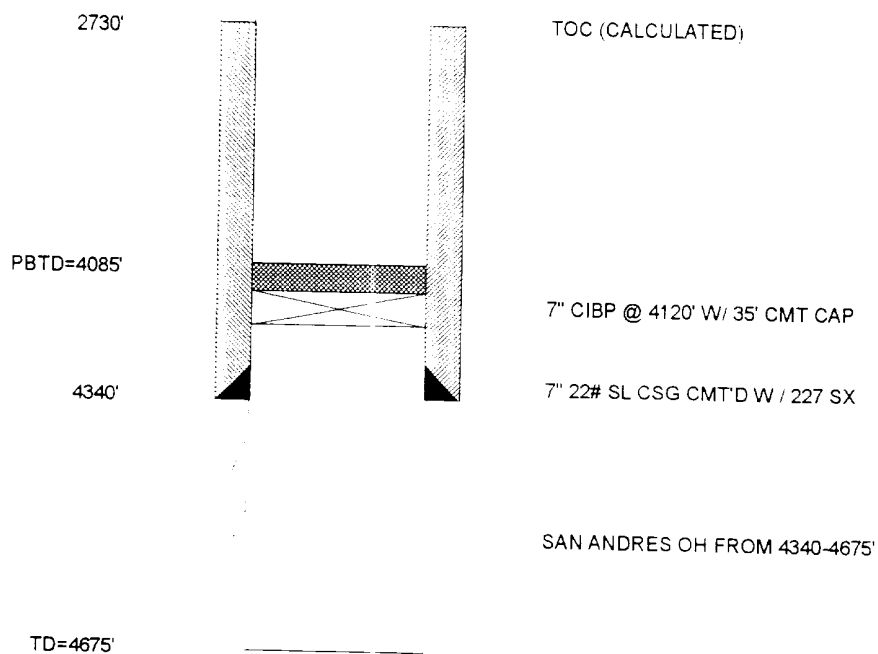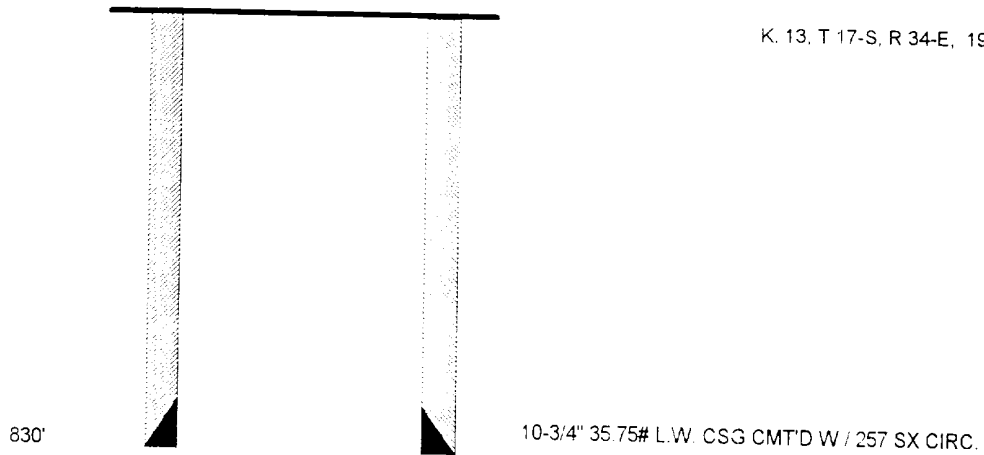


BRIDGES STATE
WELL # 63 WIW
VACUUM GRAYBURG (SAN ANDRES) FIELD
LEA COUNTY, NEW MEXICO
PROPOSED COMPLETION

K. 13, T 17-S, R 34-E, 1980' FSL, 1980' FWL

KB = 4020'


GL = 4009'

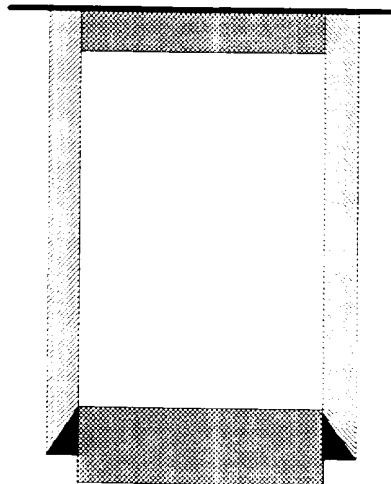

15 SX CLASS C NEAT CMT PLUG
FROM 30'-SURFACE


10-3/4" 35.75# L.W. CSG @ 830'
CMT'D W / 257 SX CIRC.

50 SX CLASS C NEAT CMT PLUG ACROSS CSG SHOE
FROM 880-780'
PLUG MUST BE TAGGED!



50 SX CLASS C NEAT CMT PLUG ACROSS SALT TOP @
1795' AND 7" CSG STUB FROM 1845-1745'
PLUG MUST BE TAGGED!

TOC @ 2730' (CALCULATED)

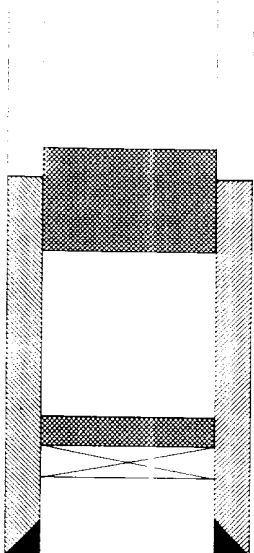

40 SX CLASS C NEAT CMT PLUG ACROSS SALT BASE @
2790' AND TOC @ 2730' FROM 2840-2680'

PBTD=4085'

7" 22# SL CSG @ 4340'
CMT'D W / 227 SX

7" CIBP @ 4120' W/ 35' CMT CAP

SAN ANDRES OH FROM 4340-4675'

TD=4675'