


PLUGGING & ABANDONMENT WORKSHEET

(2 STRING CSNG)

OPERATOR Texaco Exploration & Production Inc.
LEASENAME VACUUM GRAYBURG SA UNIT

SECT D TWN 18S RNG 34 E
FROM 330 NSL 330 EWL
TD: 4902 FORMATION @ TD VACUUM GRAYBURG
PBDT: FORMATION @ PBDT SA

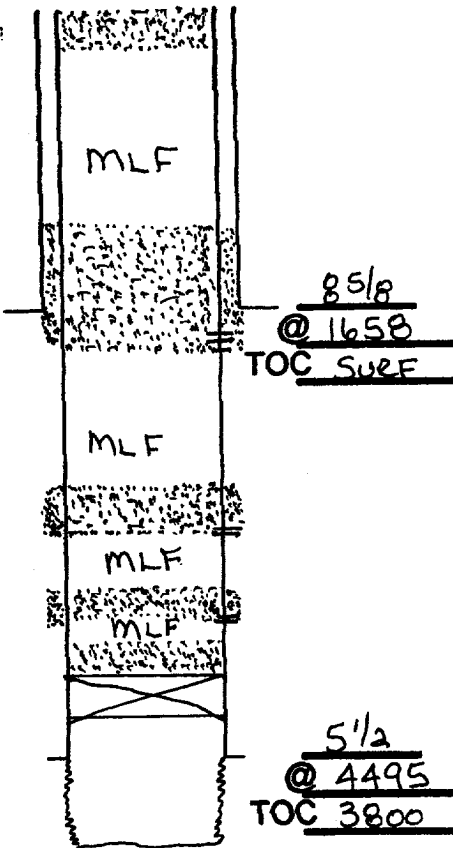

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	8 5/8	1658	SURF	CIRC
INTMED 1				
INTMED 2				
PROD	5 1/2	4495	3800	CALC
	SIZE	TOP	BOT	TOC DETERMINED BY
LINER 1				
LINER 2				
CUT & PULL @			TOP - BOTTOM	
INTMED 1			PERFS	4500 - 4690
INTMED 2			OPENHOLE	-
PROD				

*REQUIRED PLUGS DISTRICT I

RUSTLER (ANYTD)	
YATES	
QUEEN	
GRAYBURG	
SAN ANDREW	
CANTAN REEF	
DELAWARE	
BELL CANYON	
CHERRY CANYON	
BROOKLYN CANYON	
BONE SPRING	
GLOBETA	
BLUENRY	
TUBB	
DRINKARD	
ABO	
WC	
PENN	
STRAWN	
ATOKA	
MORROW	
AMM	
DEVONIAN	

PLUG	TYPE	SACKS	DEPTH
PLUG	PLUG	CMNT	
EXAMPLE			
PLUG #1	OH	35 SKS	6400'
PLUG #2	SHOE	50 SKS	5350'-5450'
PLUG #3	CIBP/35'		4800'
PLUG #5	CIBP	25 SKS	4800'
PLUG #4	STUB	50 SKS	3600'-3700'
PLUG #5	RETRN SQZ	200 SKS	400'
PLUG #6	SURF	10 SKS	0-10'
PLUG #1	Gray Burg SA	25 SKS	4415-4215
PLUG #2	QUEEN	50 SKS	3800-3600
PLUG #3	YATES	50 SKS	2800-2600
PLUG #4	8 5/8 S	125 SKS	1800-1500
PLUG #5	SURF	10 SKS	10'-SURF
PLUG #6			
PLUG #7			
PLUG #8			
PLUG #9			
PLUG #10			
PLUG #11			
PLUG #12			
PLUG #13			
PLUG #14			
PLUG #15			
PLUG #16			
PLUG #17			
PLUG #18			
PLUG #19			
PLUG #20			

TD 4902