

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 300-2503099
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. 011122
7. Lease Name or Unit Agreement Name Central Vacuum Unit
8. Well No. 124
9. Pool name or Wildcat Vacuum Grayburg

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	
2. Name of Operator Texaco E&P Inc.	
3. Address of Operator P.O. BOX 730 Hobbs, NM 88240	
4. Well Location Unit Letter <u>C</u> : <u>330</u> Feet From The <u>North</u> Line and <u>1904</u> Feet From The <u>West</u> Line Section <u>7</u> Township <u>18S</u> Range <u>35E</u> NMPM <u>Lea</u> County <u></u>	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3985 DF	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data.	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☒
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

This is a dual completion. The central vacuum Unit #124 is completed in the same well bore as the New Mexico "R" State NCT-4 #1.

2-6-95 Notify NMOCD of intent to plug & abandon wells. Talked to Jerry Sexton.
2-7-95 Set CIBP @ 4543'. Cap w/35' cmt. @ 25sx cmt. Cal TOC 4508. NMOCD Buddy Hill on location. Load csg. /w 25# per bbl. salt gel.
2-8-95 Spot 10sx cmt. plug @ 4000 Cal TOC 3594.
2-13-95 Spot 10sx cmt. plug @ 3140 Cal TOC 2734.
2-14-95 RUWL & cut 2-7/8" csg. @ 1722 & pull same.
2-14-95 2-7/8" stub plug. After plugging New Mexico "R" NCT-4 #1; Central Vacuum Unit #124.
2-14-95 Spot 50sx @ 1722. WOC tag @ 1472.
2-15-95 Perf. @ 450' esting. rate 3BPM @ 800 PSI w/no returns up 8-5/8" & 10-3/4" csg. Set CICR @ 400 Sqz. 110sx below ret. cap CICR w/40sx Cal. TOC 246'
2-15-95 Spot 25sx cmt. plug f/60-surface;
2-15-95 Dig out cellar; cut off well head; cap well & install dry hole marker. clean location & rig down Pool plugging equipment.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Jim Calder TITLE P&A Supervisor (Pool Agent) DATE 2-15-95

TYPE OR PRINT NAME JD Calder TELEPHONE NO. 915-687-4912

(This space for State Use)

APPROVED BY Jerry W. Hill TITLE DATE


CONDITIONS OF APPROVAL, IF ANY:

OIL & GAS INSPECTOR

FEB 1994
Received
Texaco
Hobbs Area

MAY 08 1995

TEXACO E&P INC
CENTRAL VACUUM UNIT NO. 124
API# 30 025 03099

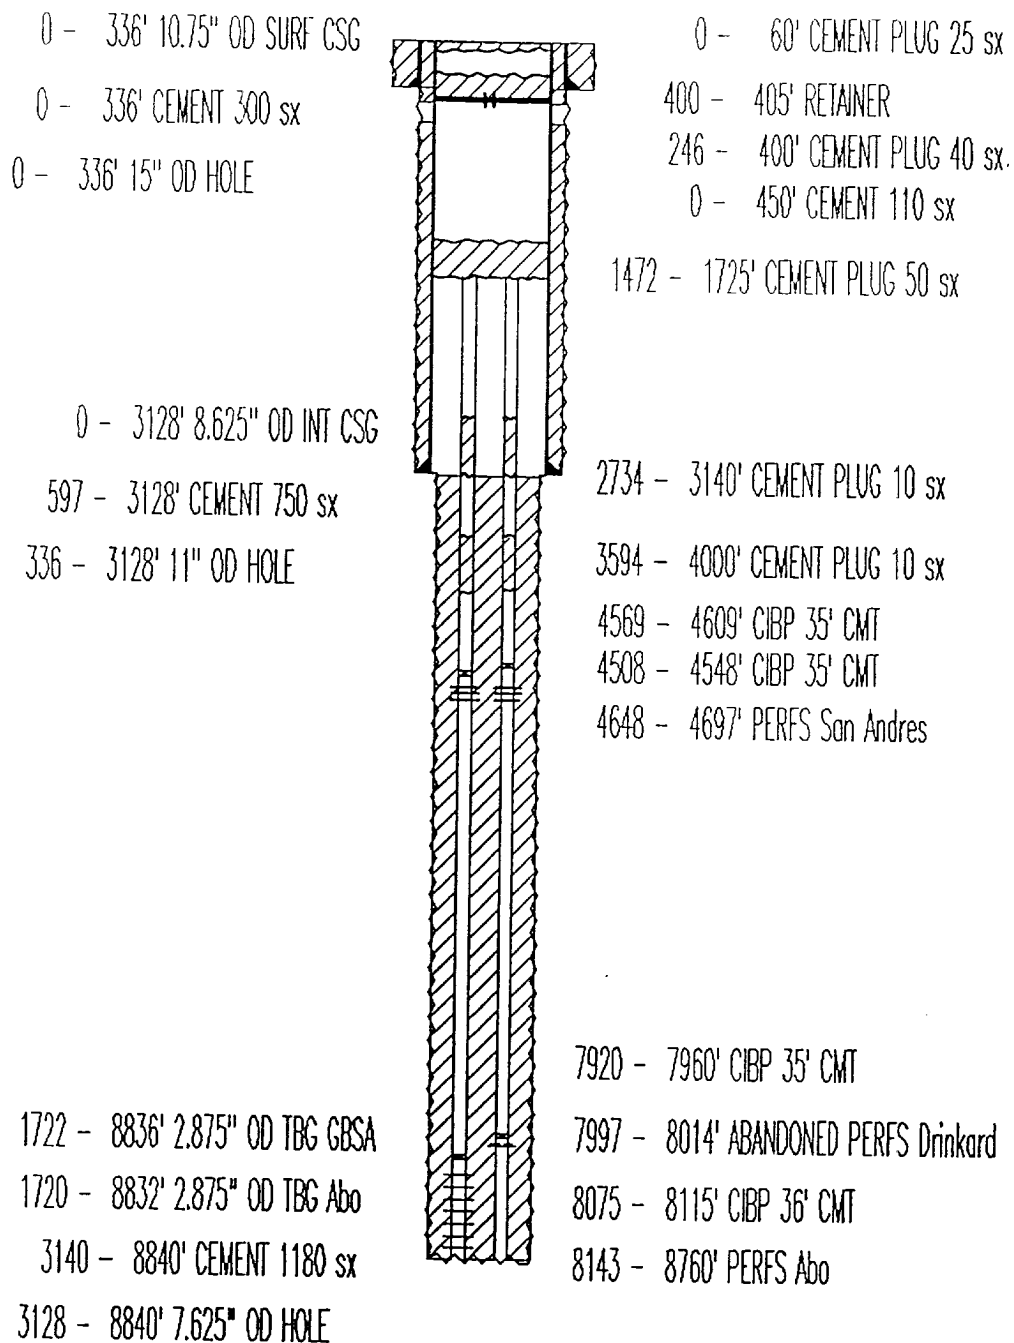

330 FNL & 1904 FNL
SEC 7, TWN 18 S, RANGE 35 E
ELEVATION: 3986 DF
COMPLETION DATE: 03-07-62

COMPLETION INTERVAL: 8143 - 8760 (ABRF)
SECOND CMPL INTRVL: 4648 - 4697 (GBSA)
Dual w/ Texaco NM "R" State NCT-4 #1