

Submit 3 Copies To Appropriate District
Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Bruzos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO. 30-025-03104
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. E-7653
7. Lease Name or Unit Agreement Name: State AN
8. Well No. 4
9. Pool name or Wildcat Vacuum, ABO, REEF

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator

Chevron USA, Inc.

3. Address of Operator

15 Smith Rd. Midland, Tx 79705

4. Well Location

Unit Letter H : 1650 feet from the north line and 990 feet from the east line

Section 7 Township 18-S Range 35-E NMPM County lea

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐


COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Notify OCD 24 hrs prior to MI & RU
2. RIH Tag 5 1/2 CIBP @ +/- 8550(Vacuum, ABO, REEF) spot 25sx plug 8550-8350 WOC Tag.
3. Displace hole w/MLF 9.5# Brine w/25# Gel P/BBL.
4. Spot 25sx plug 4700-4500(Grayburg)
5. Spot 25sx plug 3900-3700(Queen)
6. Spot 50sx plug 3400-2900(8 5/8 shoe, Yates, B-salt)WOC Tag.
7. Spot 25sx plug 1600-1400(T-salt)WOC Tag.
8. Spot 40sx plug 375-surf (13 3/8 shoe, surf)WOC Tag.
9. Install dry hole marker.

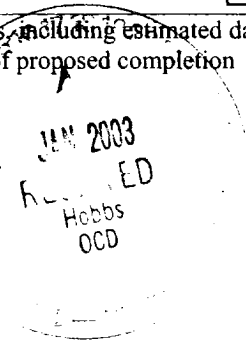

THIS FORM IS NOT TO BE NOTIFIED 24
HOURS PRIOR TO THE BEGINNING OF
PROPOSED WORK. RETURN FOR THE C-103
TO BE REVIEWED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

G.R. Bledsoe

TITLE

HES Specialist

DATE

1/15/2003

Type or print name

G.R. Bledsoe

Telephone No.

915-681-7153

(This space for State District SUPERVISOR/GENERAL MANAGER)

ORIGINAL SIGNED BY
CHRIS WILLIAMS

APPROVED BY

DISTRICT SUPERVISOR/GENERAL MANAGER

DATE

JAN 17 2003

Conditions of approval, if any: