


OIL CONSERVATION COMMISSION

Santa Fe, New Mexico

MISCELLANEOUS REPORTS ON WELLS

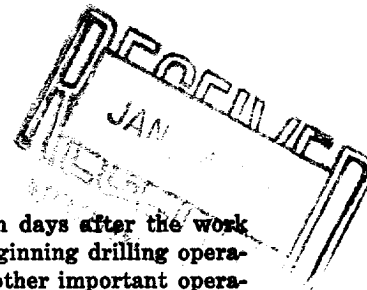

Submit this report in triplicate to the Oil Conservation Commission or its proper agent within ten days after the work specified is completed. It should be signed and sworn to before a notary public for reports on beginning drilling operations, results of shooting well, results of test of casing shut off, result of plugging of well, and other important operations, even though the work was witnessed by an agent of the Commission. Reports on minor operations need not be signed and sworn to before a notary public. See additional instructions in the Rules and Regulations of the Commission.

Indicate nature of report by checking below.

REPORT ON BEGINNING DRILLING OPERATIONS		REPORT ON REPAIRING WELL	
REPORT ON RESULT OF SHOOTING OR CHEMICAL TREATMENT OF WELL		REPORT ON PULLING OR OTHERWISE ALTERING CASING	
REPORT ON RESULT OF TEST OF CASING SHUT-OFF		REPORT ON DEEPENING WELL	
REPORT ON RESULT OF PLUGGING OF WELL	X		

January 1, 1950

Mormont, New Mexico

Date

Place

OIL CONSERVATION COMMISSION,
SANTA FE, NEW MEXICO
Gentlemen:

Following is a report on the work done and the results obtained under the heading noted above at the _____
Amerada Petroleum Corporation **State WMA** Well No. **1** in the

Company or Operator _____ Lease _____
C/NE/4 NE/4 of Sec. **33**, T. **18-S**, R. **37-E**, N. M. P. M.,
Wildcat Field, **Los** County.

The dates of this work were as follows: **December 31, 1949**

Notice of intention to do the work was ~~submitted~~ submitted on Form C-102 on **December 30,** 19 **49**
and approval of the proposed plan was ~~obtained~~ obtained. (Cross out incorrect words.)

DETAILED ACCOUNT OF WORK DONE AND RESULTS OBTAINED

4525' - Total Depth - Line. Ran Schlumberger's Electrical & Gamma Ray Surveys. Ran drill pipe open end and spotted 30 sacks cement from 4525' to 4392'. Shot off 7-5/8" casing at 1605' and pulled 7-5/8" casing from that depth. Spotted 20 sacks cement from 1605' to 1565'. Plugged 10-3/4" surface casing from 38' to surface with 20 sacks cement. Put 4" line pipe, as marker, 4' above surface of ground in the center of the hole. Finished at 7:45 P.M., 12-31-49.

Witnessed by **G. E. Nichols** **Amerada Petroleum Corporation** **Farm Boss**
Name Company Title

Subscribed and sworn before me this _____

I hereby swear or affirm that the information given above is true and correct.

3rd. day of **January** 19 **50**

Name **Don Tomp**

Position **Assistant District Superintendent**

Representing **Amerada Petroleum Corporation**
Company or Operator

Notary Public

My commission expires **10-24-53**

Address **Drawer D, Mormont, New Mexico**

Remarks:

Ray Guchowich
Name
Title


 J. Edgar Hoover
 Director