

MISCELLANEOUS REPORTS ON WELLS

(Submit to appropriate District Office as per Commission Rule 1106)

DUPLICATE
HOBBS OFFICE OCC

Name of Company J. M. HUBER CORPORATION		Address 610 Midland Natl. Bank Bldg., Midland, Tex.				
Lease Keohane	Well No. 1	Unit Letter I	Section 2	Township 18S	Range 38E	
Date Work Performed	Pool Wildcat			County Lea		

THIS IS A REPORT OF: (Check appropriate block)

- ☐ Beginning Drilling Operations ☒ Casing Test and Cement Job ☒ Other (Explain):
☐ Plugging ☐ Remedial Work

Detailed account of work done, nature and quantity of materials used, and results obtained.

Drill 7-7/8" hole to 6400' = T.D. 6-10-60
Ran electric logs. Set 4-1/2" 9.5# J-55 R-2 new casing at 5536 and cemented with 125 sx. cement with 4% gel. Ran Gamma Ray tie in log and perforate 4 jets per foot 5428-30. Wash with M.C.A. Perforate 2 jets per foot 5354-5428, wash with M.C.A. Swab down to 1-1/2 BW per hour (acid water). Acidize with 3000 gal.-15%. Well swabbed 15 BSW per hour. Sour gas will not burn. Set bridge plug at 5337 and perforate with 4 jets per foot 5303-09. Wash with 200 M.C.A. Well swabbed 10 BSW per hour with sour gas. No shows of live oil.
P. & A. 6-16-60.

Witnessed by Robert W. Scarth	Position Dist. Supt.	Company J. M. HUBER CORPORATION
----------------------------------	-------------------------	------------------------------------

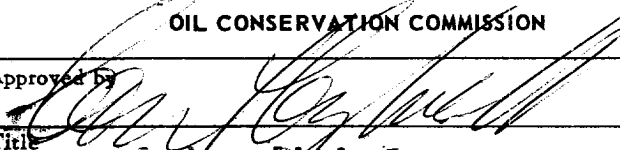
FILL IN BELOW FOR REMEDIAL WORK REPORTS ONLY

ORIGINAL WELL DATA

D F Elev.	T D	P B T D	Producing Interval	Completion Date
Tubing Diameter	Tubing Depth	Oil String Diameter	Oil String Depth	
Perforated Interval(s)				
Open Hole Interval		Producing Formation(s)		

RESULTS OF WORKOVER

Test	Date of Test	Oil Production BPD	Gas Production MCFPD	Water Production BPD	GOR Cubic feet/Bbl	Gas Well Potential MCFPD
Before Workover						
After Workover						

OIL CONSERVATION COMMISSION		I hereby certify that the information given above is true and complete to the best of my knowledge.	
Approved by 	Name Robert W. Scarth		
Title Engineer District	Position District Superintendent		
Date AUG 3 1960	Company J. M. Huber Corporation		

610 Midland Natl. Bank Bldg.