

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.
B-871

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT --" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-	7. Unit Agreement Name
2. Name of Operator TEXACO Inc.	8. Form or Lease Name New Mexico 'AE' State
3. Address of Operator P. O. Box 728, Hobbs, New Mexico 88240	9. Well No. 6
4. Location of Well UNIT LETTER L 1980 FEET FROM THE South LINE AND 660 FEET FROM THE West LINE, SECTION 12 TOWNSHIP 18-S RANGE 34-E N.M.P.M.	10. Field and Pool, or Wildcat Vacuum Abo Reef
15. Elevation (Show whether DF, RT, GR, etc.) 3996 (DF)	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>

SUBSEQUENT REPORT OF:

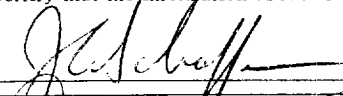
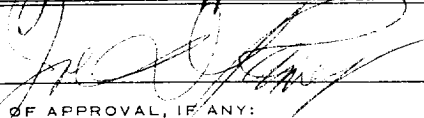
REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input checked="" type="checkbox"/> Water Shut Off

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

The following work has been completed on subject well:

1. Pull rods and pump.
2. Could not retrieve retrievable bridge plug, left @8625'.
3. Pump 50 bbls of lease crude containing 2 gal Hyflo #2 and 5 bbls diesel oil containing 2 gal Hyflo #2.
4. Pump 100 sx Class H cement mixed with 500 gal diesel oil containing 4 gal of DOC-3 followed w/5 bbls diesel oil.
5. Displace w/50 bbls lease crude.
6. Run rods and pump, test, return to production.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE Assistant District Superintendent	DATE January 7, 1970
APPROVED BY 	TITLE	DATE
CONDITIONS OF APPROVAL, IF ANY:		