

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

FORM APPROVED  
Budget Bureau No. 1004-0135  
Expires: March 31, 1993

**SUNDRY NOTICES AND REPORTS ON WELLS**

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals

**SUBMIT IN TRIPLICATE**

1. Type of Well <input checked="" type="checkbox"/> Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other	5. Lease Designation and Serial No. NM-6863
2. Name of Operator Mewbourne Oil Company	6. If Indian, Allottee or Tribe Name
3. Address and Telephone No. P.O. Box 5270 Hobbs, New Mexico 88241	7. If Unit or CA, Agreement Designation
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) Unit Letter M: 990' FSL 990' FWL Sec. 27-T18S-R32E	8. Well Name and No. Anadarko Federal #4
	9. API Well No. 30-025-24742
	10. Field and Pool, or Exploratory Area
	11. County or Parish, State Lea Co., N.M.

**CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA**

TYPE OF SUBMISSION	TYPE OF ACTION
<input checked="" type="checkbox"/> Notice of Intent	<input checked="" type="checkbox"/> Abandonment
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Plugging Back
	<input type="checkbox"/> Casing Repair
	<input type="checkbox"/> Altering Casing
	<input type="checkbox"/> Other
	<input type="checkbox"/> Change of Plans
	<input type="checkbox"/> New Construction
	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Water Shut-Off
	<input type="checkbox"/> Conversion to Injection
	<input type="checkbox"/> Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

*NOTIFY BLM @ 393-3612 PRIOR TO COMMENCING PLUGGING OPERATION*  
Set CIBP at 3830'<sup>±</sup>. Set 3 sx. cement plug on CIBP. Displace hole with mud.  
Cut off and pull out of hole with 2700'<sup>±</sup> of casing. Set 30 sx. plug 50' ABOVE/  
below cut off. Wait on cement and tag top of plug.\* Set 45 sx. plug at  
370'. Set 20 sx. plug at 50' and circulate cement to surface. Cut off  
wellhead and install P & A marker. Mud between all plugs.  
\* SET 100' CEMENT PLUG AT TOP OF SALT (1320'-1220'). TAG.  
CEMENT: USE CLASS "C" w/2% CaCl<sub>2</sub>, MIXED WITH 6.3 GALS. WTR./SACK.  
MUD: USE MUD OF AT LEAST 9.0 PPG.

14. I hereby certify that the foregoing is true and correct

Signed Willie Samy Title District Supt. Date 06/06/91


(This space for Federal or State office use)

Approved by Willie Samy Title District Supt. Date 6-10-91

Conditions of approval, if any:



ANADARKO Federal #4  
 OPERATOR: Lewis B. Buckson  
 590 PSL #NL 27-18-32  
 SEA Co. N. M.

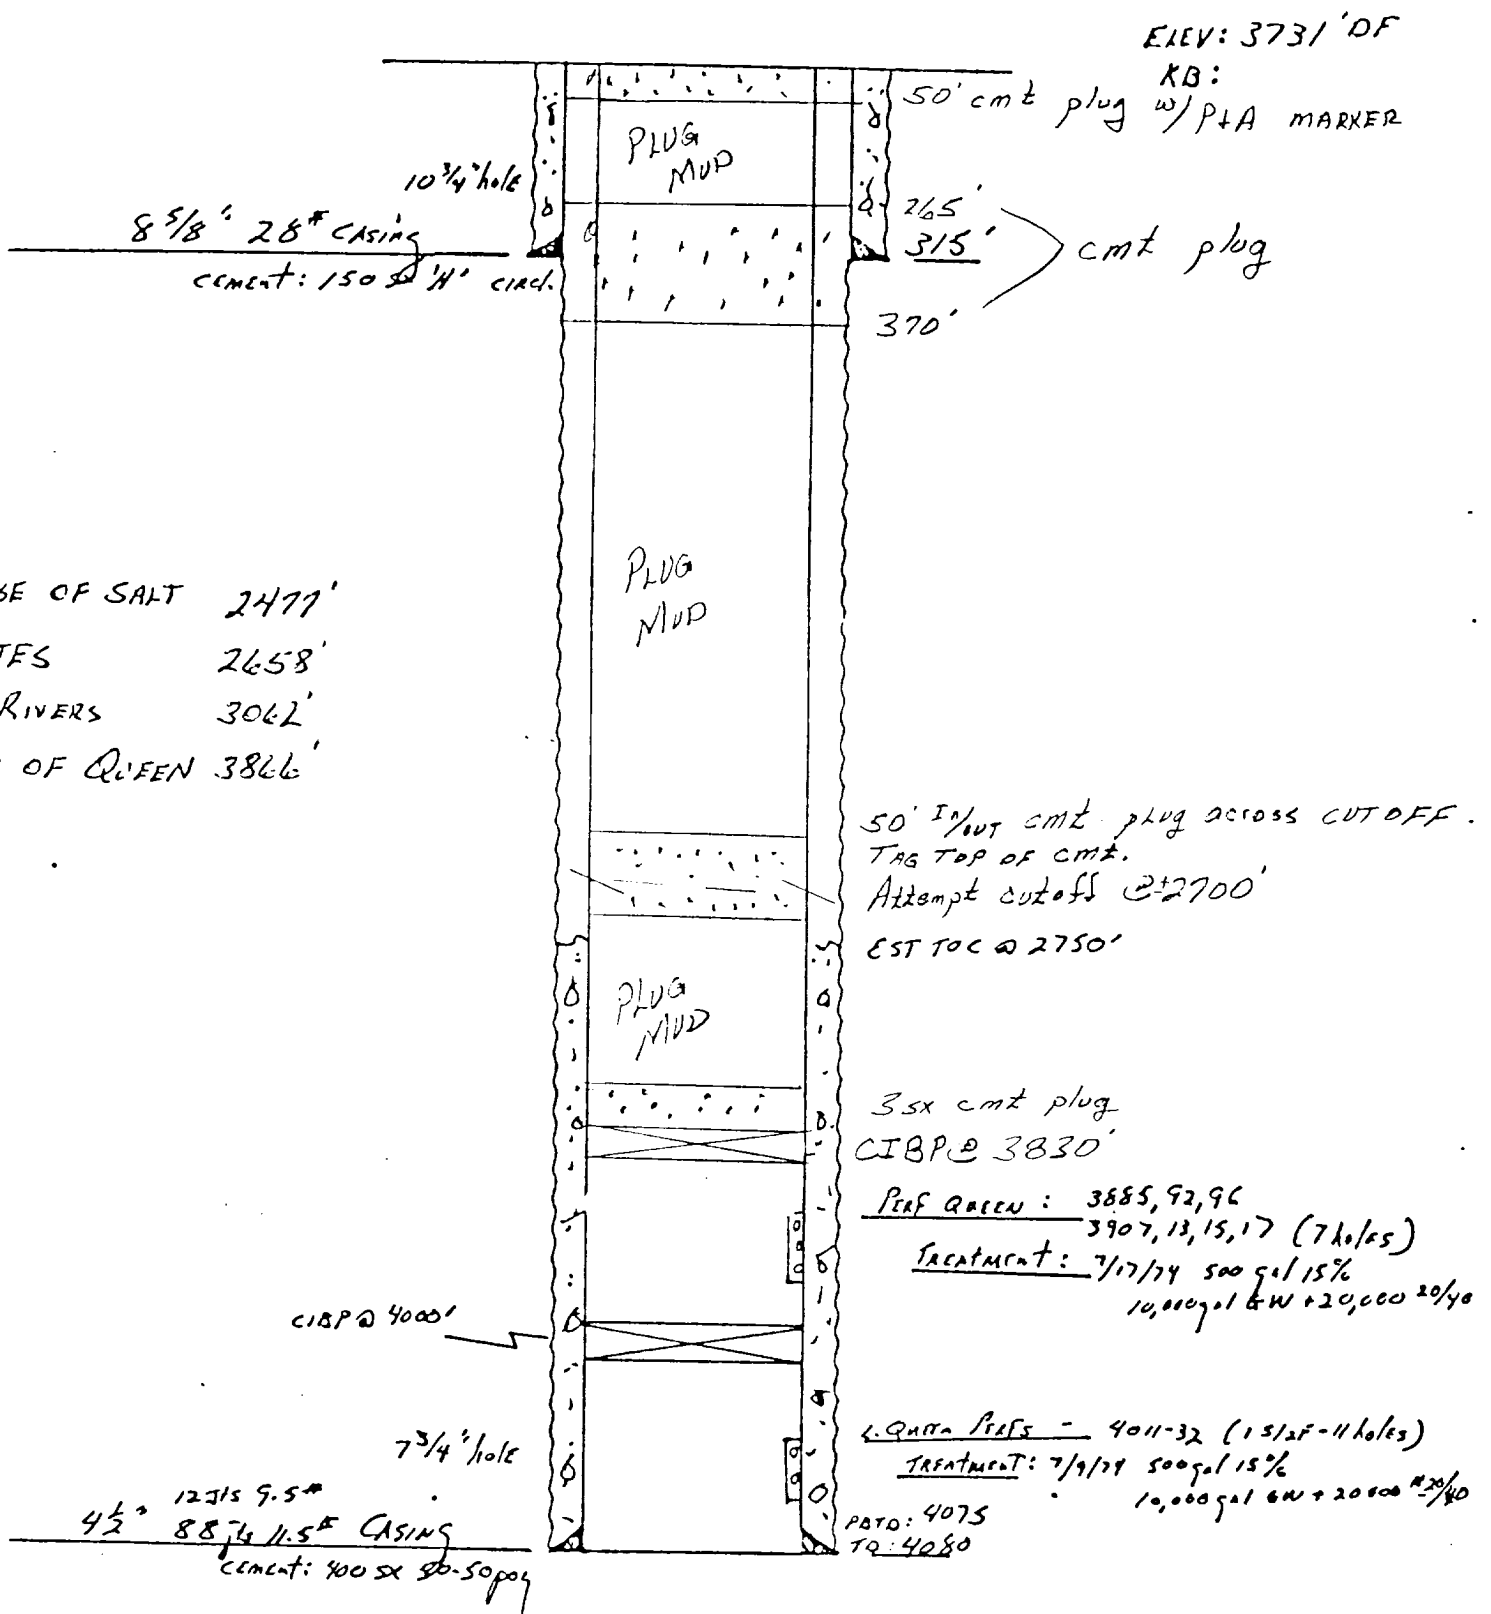

Pumping Unit - Make:  
 Size:  
 Serial No:

.PV



100-100000

JUN 2 1951

Q-1  
MAY 1951