

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO. 3002525822
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. 011122
7. Lease Name or Unit Agreement Name Central Vacuum Unit
8. Well No. 129
9. Pool name or Wildcat Vacuum Grayburg San Andres

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER injection	2. Name of Operator Texaco E&P Inc.	3. Address of Operator P.O. Box 730 Hobbs, NM 88240	4. Well Location Unit Letter <u>C</u> : <u>1260</u> Feet From The <u>North</u> Line and <u>2560</u> Feet From The <u>West</u> Line Section <u>7</u> Township <u>18S</u> Range <u>35E</u> NMMPM <u>Lea</u> County 10. Elevation (Show whether DF, RKB, RT, GR, etc.) <u>3966 GR</u>
--	--	--	--

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data.			
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☒
PULL OR ALTER CASING ☐		CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2-20-95 Notify NMOCD of intent to plug & abandon well.
2-21-95 RU Pool & NUBOP TOH w/prod. string laydown same.
2-21-95 TIH w/4½" CICR Set @ 4512'. 140sx cmt. below retainer.
SITP 1200 PSI. Cap CICR w/10sx cmt. from 4512-4412.
2-22-95 TIH w/2-3/8" work string @ 4000' circ. csg. w/25# per bbl. salt gel mud.
2-22-95 Spot 25sx cmt. plug f/4000'-3694'. WOC & tag @ 3694'.
2-22-95 Spot 30sx cmt. plug f/3000'-2548'. WOC & tag @ 2548'.
2-22-95 Spot 30sx cmt. plug f/1755'-1325'. WOC & tag 2-23-95 @ 1325'.
2-23-95 Spot 30sx cmt. plug f/410'-0'.
2-24-95 Cut off well head; cap well & install dry hole marker. Clean location & move off.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Calder TITLE P&A Supervisor DATE 2-25-95

TYPE OR PRINT NAME J. Calder TELEPHONE NO.


(This space for State Use)

APPROVED BY Carry D. Hill TITLE OIL & GAS INSPECTOR DATE

CONDITIONS OF APPROVAL, IF ANY:

P&A: 2-24-95

TEXACO E&P INC
CENTRAL VACUUM UN NO. 129 WIW
API# 30025258220000

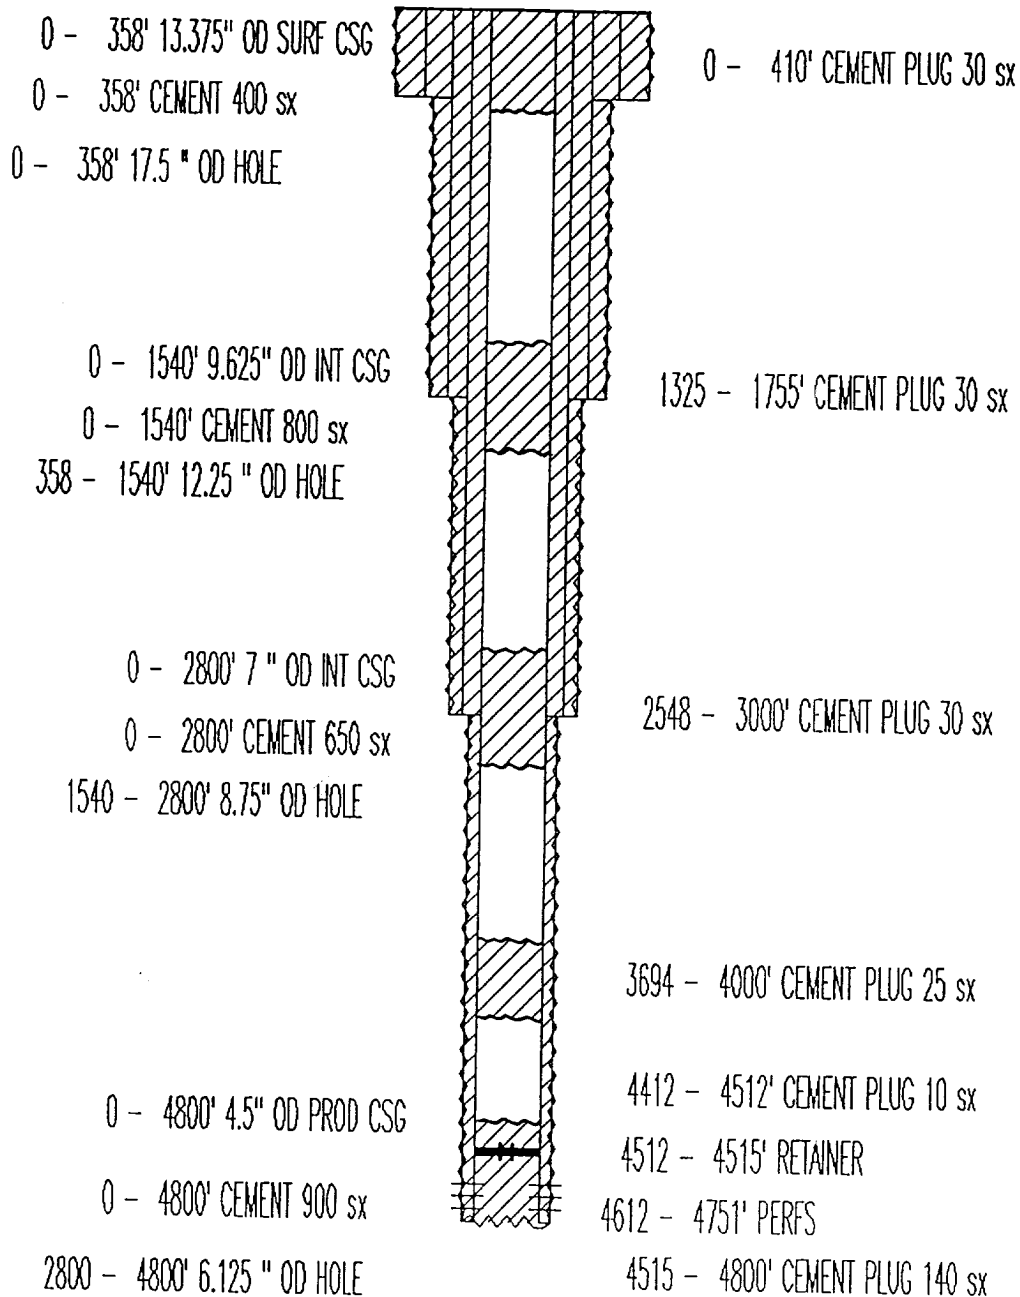

1260 FNL & 2560 FNL
SEC 7, T11N 18 S, RANGE 35 E
ELEVATION: 3966 GR
COMPLETION DATE: 09-24-79