

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

H. H. CHASE COMPANY
P. O. BOX 670
HOBBS, NEW MEXICO 88240

SUBMIT IN TRIPLICATE
(Other instructions on reverse side)

Form Approved
Budget Bureau No. 42-11124

SUNDRY NOTICES AND REPORTS ON WELLS
(Do not use this form for proposals to drill or to deepen or plug back in a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. ☐ OIL WELL ☐ GAS WELL ☐ OTHER

2. NAME OF OPERATOR
Gulf Oil Corporation

3. ADDRESS OF OPERATOR
P. O. Box 670, Hobbs, NM 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface
1980' FSL + 1980' FWL

14. PERMIT NO.

15. ELEVATIONS (Show whether OF, ST, CR, etc.)
3693' GL

5. LEASE DESIGNATION AND SERIAL NO.
NM-25877

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
Henderson Fed Com

9. WELL NO.

10. FIELD AND TROOL, OR WILDCAT
N. Buck Throckm

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec 33-T18S-R32E

12. COUNTY OR PARISH
Lea

13. STATE
NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF	☐	WATER SHUT-OFF	☐
FRACTURE TREAT	☐	FRACTURE TREATMENT	☐
SHOOT OR ACIDIZE	☐	SHOOTING OR ACIDIZING	☐
REPAIR WELL	☐	REPAIRING WELL	☐
(Other)	☐	(Other) <i>with pressure test report</i>	☒
PULL OR ALTER CASING	☐	ALTERING CASING	☐
MULTIPLE COMPLETE	☐	ABANDONMENT*	☐
ABANDON*	☐		
CHANGE PLANS	☐		

(Note: Report results of multiple completion or Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Gulf Buck plug set in Et recip @ 12,814'.
Lead the 4" BKF. Spout (4) 1/2" hole in the 12,810'-12'.
Sub. Bailed trash off plug. Janned plug free + P.O.H.
Set collar stop @ 12,762'. Install surface plunger lift
spt. Sub. Install equalizing line between the-csg.
Equalize the-csg. Dr. plunger sub + plunger. Flow
655 mcf gas, 4 BO, 3 BW in 24 hrs. Before work, well
would not flow.

18. I hereby certify that the foregoing is true and correct

SIGNED

R. P. Stee

TITLE

Area Engineer

(This space for Federal or State office use)


APPROVED BY

G.W.G.

TITLE

DATE

MAY 17 1984

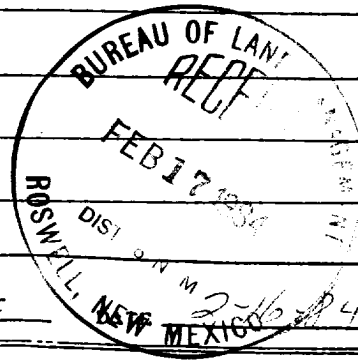

Carlisle

NEW MEXICO

*See Instructions on Reverse Side

RECEIVED

MAY 15 1984

O.C.D.
HOBBS OFFICE