

Submit 3 Copies To Appropriate District  
Office  
District I  
1625 N. French Dr., Hobbs, NM 87240  
District II  
811 South First, Artesia, NM 87210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-103  
Revised March 25, 1999

OIL CONSERVATION DIVISION  
2040 South Pacheco  
Santa Fe, NM 87505

|   |
|---|
| WELL API NO.<br>30-025-29949  |
| 5. Indicate Type of Lease<br>STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/> |
| 6. State Oil & Gas Lease No.<br>B-2229  |
| 7. Lease Name or Unit Agreement Name:<br><br>PHILMEX  |
| 8. Well No.<br>20   |
| 9. Pool name or Wildcat<br>VACUUM GRAYBURG/SAN ANDRES   |

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

|  |  |
|--|--|
| 1. Type of Well:<br>Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other | 2. Name of Operator<br>Phillips Petroleum Company  |
| 3. Address of Operator<br>4001 Penbrook Street Odessa, TX 79762  | 4. Well Location<br>Unit Letter <u>D</u> <u>660</u> feet from the <u>NORTH</u> line and <u>660</u> feet from the <u>WEST</u> line<br>Section <u>36</u> Township <u>17S</u> Range <u>33E</u> NMPM County <u>LEA</u> |
| 10. Elevation (Show whether DR, RKB, RT, GR, etc.)<br>4127' KB 4118' GL                                  |  |

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

- PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐  
OTHER: ☐

SUBSEQUENT REPORT OF:

- REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER: FISH, CLEAN OUT, & REACTIVATE WELL ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.


10/10/01 MIRU DDU ND WH COOH W/RODS 62 7/8 70 3/4.

10/11/01 GIH W/SINKER BARS ON SANDLIN W/DEPTH THOMETER & TAG TOP FISH @ 3427' MIRU  
JSI GIH W/2-7/8 IMPRESSION BLK TAG TOP FISH @ 3396' PIN OF 3/4 ROD LKNG UP  
GIH W/SHORTCATCH OVERSHOT ON RODS LATCH ON FISH PULL 20 PT OVER ROD STRING  
& PULLED OFF FISH COOH W/RODS & SHORT CATCH OVERSHOT GIH W/ROTARY WL &  
FREEPOINT TBG ABOVE FISH.

10/12/01 WO ROTARY WL STANDBY

10/15/01 MIRU ROTARY WL GIH & BK TBG OFF @ 3356' COOH W/TBG GIH W/TBG & PORT SUB GIH  
W/WL & BK TBG OFF @ 3452' COOH W/TBG LD 107 2-7/8 JTS NUM 107 & 106 JTS WERE  
EGGED IN 1' SECTION BKED OFF TBG @ 3452' TOP OF 3/4 FISH @ 3408' APPROX 46'  
OF RODS OUT OF TBG.

(CONTINUED ON BACK)

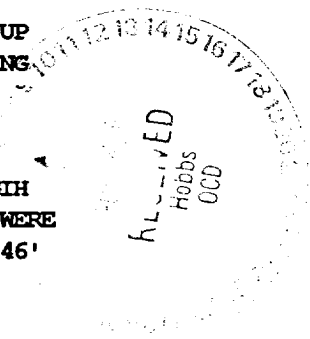

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Larry M. Sanders TITLE SUPVR., REGULATION/PRODUCTION DATE 10-31-01

Type or print name LARRY M. SANDERS Telephone No. 915/368-1488

(This space for State use)

APPROVED BY PAUL F. KAUTZ TITLE ORIGINAL SIGNED BY DATE NOV 06 2001  
Conditions of approval, if any: PETROLEUM ENGINEER

10/17/01 COOH W/TBG & FISH TL ASSMBL FISH TL KILO & GIH ON 109 JTS LATCH ON FISH BAK RODS OFF COOH W/TBG & FISH TL CAME OUT W/14' RODS TWISTED UP GIH W/TBG OPEN END W/PORT SUB TRIED SCREW INTO TBG NO LUCK COOH W/TBG.

10/18/01 GIH W/SHOE & WASH PIPE ON TBG MILL OVER @ 5452' WASH OVER 65' TBG COOH W/TBG & COLLARS WASH PIPE & SHOE GIH W/SHOE W/KNIVES WASH PIPE & COLLARS ON TBG CUT ON TBG CAME OUT W/WASH PIPE & SHOE EMPTY.

10/19/01 GIH W/OVERSHOT F/TBG CLR ON BMPR SUB SET JARS 4 3-1/2 DCS ON 106 JTS 2-7/8 TBG LATCH ON FISH & JAR ON TBG COOH W/TBG & FISH TLS CAME OUT W/10' PCE 2-7/8 TBG BTM JTS HAD COLLAR SPLIT & EGGED GIH W/KILO FISH TL ON 110 JTS 2-7/8 TBG LATCH ON RODS BK OFF COOH W/TBG & FISH TL CAME OUT W/3-3/4 RODS 1 SINGLE & 2 RODS SCREWED TOGETHER.

10/22/01 GIH W/OVERSHOT & LATCH ON TBG COOH W/TBG & OVERSHOT CAME OUT W/10' PC 2-7/8 TBG SPOT WHERE CUTOFF MADE ON 10/18/01 GIH W/OVERSHOT T/FISH 2-7/8 TBG TAG 10' HI COULDN'T LATCH ON FISH @ 3488-90' GIH W/IMPRESSION BLK ON SANDLINE IMPRESSION SHOWS ¾ RODBOX GIH W/KILO FISH TL ON 110 JTS TBG LATCH ON FISH & BK OFF COOH W/TBG & FISH TL CAME OUT W/TBG OPEN ENDED LEFT 7 STDS TBG IN HOLE.

10/23/01 GIH W/SCREW ON SUB ON 95 JTS SCREW ON TBG & PULL RODS COOH W/TBG & FISH TL CAME OUT W/3' PCE ROD GIH W/OVERSHOT F/TBG W/EXTEN T/GO OVER 7' OF RODS & LATCH ON TBG JAR ON TBG MOVED 30' UP JAR ON FISH FISH PULLED UP & ACTED LIKE SOMETHING LOOSE COOH W/TBG & FISH TLS CAME OUT EMPTY ON FISH TL GIH W/OVERSHOT W/10' EXTEN BMPR SUB JARS DCS ON 106 JTS TBG JAR TBG.

10/24/01 JAR ON FISH LATCH ON TBG @ 3488-3494' RU SWIVEL WK FISH TL OFF FISH CAME THRU TIGHT SPOT W/FISH ON FISH TL COOH W/TBG DCS JARS OVERSHOT CAME OUT W/8 JTS TBG & 2 PCS 1 10' & 1 5-6' LONG W/RODS STUCK IN TBG CUT 4 JTS HAD DBL RODS STK IN TBG ALSO HAD T/CUT RODS PULL TIL RODS WERE SINGLE CAME OUT W/25 ¾ RODS LD TOT RODS CAME OUT W/35 ¾ RODS 10 RODS WERE DBLD CALC TOP TBG IN HOLE @ 3775' TOP OF RODS @ 4249'.

10/25/01 GIH W/OVERSHOT F/2-7/8 TBG ON 4' EXTEN BMPR SUB JARS 4 DCS ON 116 JTS TBG LATCH ON WO ROTARY WL MIRU ROTARY RIH W/WL DO FREEPOINT LOCATED BTM 4' EXTEN 4' OVERSHOT @ 3795' WENT T/3818' STACKED OUT W/WL INDICATIONS SHOW OVERSHOT NOT LATCHED ON TBG COOH W/WL COOH W/TBG & COLLARS JARS EXT OVERSHOT OVERSHOT MARKED ON OUTSIDE & TAPERED CSG SHOWS COLLAPSED @ 3780' WO EQMT COLLARS SWEDGES GIH W/4-1/4 SWEDGE ON BMPR SUB JARS 8 COLLARS & 106 JTS TBG.

10/26/01 GIH W/SWEDGE ON TBG BAD CSG @ 3779-80' SWEDGE ON CSG W/4-1/4 SWDG F/3779-83' MOVED FREE F/3783-3785' COULDN'T SWDG THRU TIGHT SPOT COOH W/TBG & SWDG CK MARKINGS ON SWDG NO VISUAL MARKS @ BTM END MARKING @ 4" - 4-1/4" GIH W/4-3/4 SWDG ON BMPR SUB JARS 8 DCS & TBG T/3779' SWDG 3779-3785' COOH INSPECT NO MARKING @ BTM GIH W/LEAD BLK ON SANDLN T/3779-3785' COOH LD BLK HAD MARKS ON TOP SIDE BLK INDICATIONS SHOW CSG PARTED OR SPLIT NO IMPRESSIONS BMT LEAD BLK INDICATED IT HIT ON TOP OF SOMETHING.

10/29/01 GIH W/MILL ON 8 DCS & TBG PU SWVL & START MILL ON CSG TAG @ 3775' MILL 18' COULDN'T MK MORE HOLE COOH W/TBG & COLLARS & MILL MILL SHOWED WEAR & MARKINGS LIKE TOP OF TBG.

10/30/01 GIH W/OVERSHOT BMPR SUB JARS 8 DCS ON 106 JTS 2-7/8 TBG FAIL T/LATCHON FISH COOH TAG @ 3782-84' LD DCS BMPR SUB JARS RD SMITH INT GIH W/TBG OPEN END 118 JTS GIH W/RODS COOH W/RODS LD 62 7/8 RODS 1 ¾ ROD.

10/31/01 COOH W/69 ¾ RODS LD COOH W/118 JTS 2-7/8 TBG LD ND BOP NU WH 20 JTS 2-7/8 TBG LEFT IN HOLE & 17 ¾ RODS & PMP LEFT TURN OVER T/DRLG - DROP F/DIMS REPORT