

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-30674
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. LG 6631
7. Lease Name or Unit Agreement Name Cal-Mon 15 State
8. Well No. 2
9. Pool name or Wildcat Mescalero Escarpe Bone Spring
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3829.4' GL

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	2. Name of Operator Harvey E. Yates Company
3. Address of Operator P.O. Box 1933, Roswell, New Mexico 88202	4. Well Location Unit Letter C : 1980 Feet From The West Line and 660' Feet From The North Line Section 15 Township 18S Range 33E NMPM Lea County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3829.4' GL	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐  
OTHER: ☐

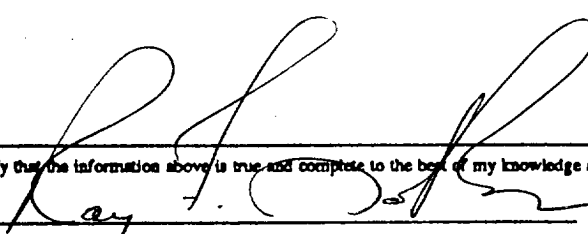
SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER: Perf, Acdz & sqzq ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

12-19-89 Perf 8726-30' (4' - 9 holes)  
12-20-89 Acdz w/1200 gals 20%  
12-27-89 Sqzq perfs 8726-30 w/150 sx Cl "H" w/.8% Halad 9 & 25 sx Cl "H" Neat,  
drill out & test to 1500#, held ok  
12-31-89 Abrasa jet cuts @ 8726', jet 500 gals 20% MSR + 500 gals same washed  
1-6-90 Sqz cuts @ 8726 w/150 sx Class "H" w/.8% Halad 9 & 39 sxs Class "H" Neat,  
drill out  
1-11-90 Run SN to 9454' & anchor @ 8807', run pmp and rods  
1-12-90 Hang on production

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE Production Mgr/Engineer DATE 1-11-90  
TYPE OR PRINT NAME Ray F. Nokes skh TELEPHONE NO. 623-6601

(This space for State Use)

ORIGINAL SIGNED BY JERRY SEXTON  
DISTRICT I SUPERVISOR

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY:

JAN 17 1990