Submit 3 Copies To Appropriate District State of New Mexico Form C-103 Office En. y, Minerals and Natural Resources Revised March 25, 1999 District I WELL API NO. 1625 N. French Dr., Hobbs, NM 87240 30-025-30717 District II OIL CONSERVATION DIVISION 811 South First, Artesia, NM 87210 5. Indicate Type of Lease 2040 South Pacheco District III 1000 Rio Brazos Rd., Aztec, NM 87410 Santa Fe, NM 87505 STATE X FEE  $\square$ District IV 6. State Oil & Gas Lease No. 2040 South Pacheco, Santa Fe, NM 87505 B-1080 SUNDRY NOTICES AND REPORTS ON WELLS 7. Lease Name or Unit Agreement Name: (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) Vacuum Grayburg San Andres Unit 1. Type of Well: Oil Well 🗶 Gas Well 🗌 Other 2. Name of Operator 8. Well No. Chevron U.S.A. Inc. 157 3. Address of Operator 9. Pool name or Wildcat 15 Smith Road - Midland, Texas 79705 Vacuum Grayburg San Andres 4. Well Location 710 2530 Unit Letter feet from the North line and feet from the line Section Township 188 Range **NMPM** County Lea 10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3993' GR 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING **TEMPORARILY ABANDON CHANGE PLANS** COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING CASING TEST AND **MULTIPLE** COMPLETION **CEMENT JOB** OTHER: Temporarily Abandon OTHER: X 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation. 09-17-02 MIRU. ND well head; NU BOP. 09-18-02 TIH w/bit & tbg. Tag @ 4962'. 09-19-02 Bled well down & kill well w/30 bbls brine water. 09-20-02 TIH w/bit & csg scraper w/2-7/8" tbg to 4099'. TIH w/CIBP & 2/7/8" tbg to 4090'. Tried to set CIBP; would not set. TOH w/tbg & CIBP; CIBP not dragging on way up. 09-23-02 CIBP not on end of tool. TIH w/bit and tbg to tag @ 49601. CIBP pushed to bottom. RU Baker. TIH w/CIBP to 4015' & set CIBP, pull up and tag CIBP. Load csg & pre-test to 500 psi for 30 mins (good). TIH/w/tbg and sub. 09-24-02 Circ pkr fluid. Test & chart to 560 psi; tested good./ Rig down. FINAL REPORT. Request "Temporarily Abandon" well status. This Approval of Temporary Original chart w/copy attached. Abandormant Explines I hereby certify that the information above is true and complete to the best of my knowledge and belief. **SIGNATURE** TITLE Regulatory Specialist Type or print name Laura Skinner Telephone No. (This space for State use) HOWER SHE WILLIAM


508 W

TITLE

DATE

APPROVED BY

Conditions of approval, if any:

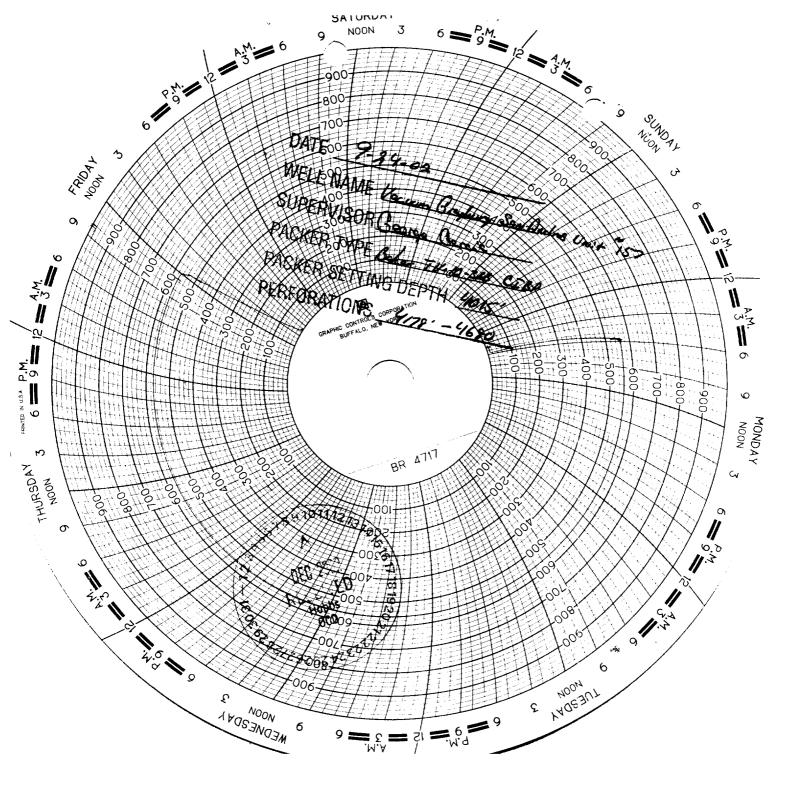

9:50 % 10:25 Am

9:24.00

Menny Musery

SEC1, T185, R34E

C18P 4015

PBTD 4962

TD 4990

parls 4178-4680