

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-02078

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☐ GAS WELL ☐ OTHER ☐ WIW ☐

2. Name of Operator Mobil Producing TX & NM Inc.*
Mobil Exploration & Producing US Inc. as agent for MPTM

3. Address of Operator
P.O. Box 633, Midland, TX 79702

4. Well Location

Unit Letter A : 660 Feet From The North Line and 660 Feet From The East Line

Section 23

Township 17-S

Range 34E

NMPM Lea

County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
KB - 4028

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- MIRU PU. DIG PIT. FLOW WELL BACK TO PIT. ND WH. NU BOP.
- RIH W/ WS TO 3050'. LOAD HOLE W/ 10 PPG GELLED BRINE. SPOT 25 SX CLASS C NEAT CMT PLUG ACROSS SALT BASE @ 3000' AND TOC @ 2980' FROM 3050-2930'.
- PUH TO 1790'. CUT AND PULL 7" CSG OR PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG ACROSS SALT TOP @ 1740' FROM 1790-1690'. **PLUG MUST BE TAGGED!**
- PUH TO 914'. SPOT 50 SX CLASS C NEAT CMT PLUG ACROSS 10-3/4" CSG SHOE @ 864' FROM 914-814'. (IF 7" CSG NOT RECOVERED, PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG). **PLUG MUST BE TAGGED!**
- PUH TO 30'. SPOT 15 SX CLASS C NEAT CMT PLUG FROM 30'-SURFACE. POOH W/ WS.
- ND BOP. RD PU. DIG OUT CELLAR AND CUT CSG 3' BELOW SURFACE. WELD STEEL PLATE ON CSG STUB. ERECT P&A MARKER WITH WELL NAME AND PLUGGED DATE. FILL CELLAR AND CLEAN SURFACE LOCATION.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kaye Pollock TITLE Regulatory Technician DATE 08-03-93
TYPE OR PRINT NAME Kaye Pollock TELEPHONE NO. 688-2584

(This space for State Use)

Orig. Signed by
Paul Kautz
Geologist

APPROVED BY _____ TITLE _____ DATE AUG 05 1993

CONDITIONS OF APPROVAL, IF ANY:

BRIDGES STATE # 21 WIW
VACUUM GRAYBURG (SAN ANDRES) FIELD
LEA COUNTY, NEW MEXICO


RECOMMENDED WORKOVER PROCEDURE

1. MIRU PU. DIG PIT. FLOW WELL BACK TO PIT. ND WH. NU BOP.
2. RIH W/ WS TO 3050'. LOAD HOLE W/ 10 PPG GELLED BRINE. SPOT 25 SX CLASS C NEAT CMT PLUG ACROSS SALT BASE @ 3000' AND TOC @ 2980' FROM 3050-2930'.
3. PUH TO 1790'. CUT AND PULL 7" CSG OR PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG ACROSS SALT TOP @ 1740' FROM 1790-1690'. **PLUG MUST BE TAGGED!**
4. PUH TO 914'. SPOT 50 SX CLASS C NEAT CMT PLUG ACROSS 10-3/4" CSG SHOE @ 864' FROM 914-814'. (IF 7" CSG NOT RECOVERED, PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG). **PLUG MUST BE TAGGED!**
5. PUH TO 30'. SPOT 15 SX CLASS C NEAT CMT PLUG FROM 30'-SURFACE. POOH W/ WS.
6. ND BOP. RD PU. DIG OUT CELLAR AND CUT CSG 3' BELOW SURFACE. WELD STEEL PLATE ON CSG STUB. ERECT P&A MARKER WITH WELL NAME AND PLUGGED DATE. FILL CELLAR AND CLEAN SURFACE LOCATION.

BRIDGES STATE
WELL # 21 WIW
VACUUM GRAYBURG (SAN ANDRES) FIELD
LEA COUNTY, NEW MEXICO
CURRENT COMPLETION

KB = 4028'
GL = 4028'

A, 23, T 17-S, R 34-E, 660' FNL, 660' FEL

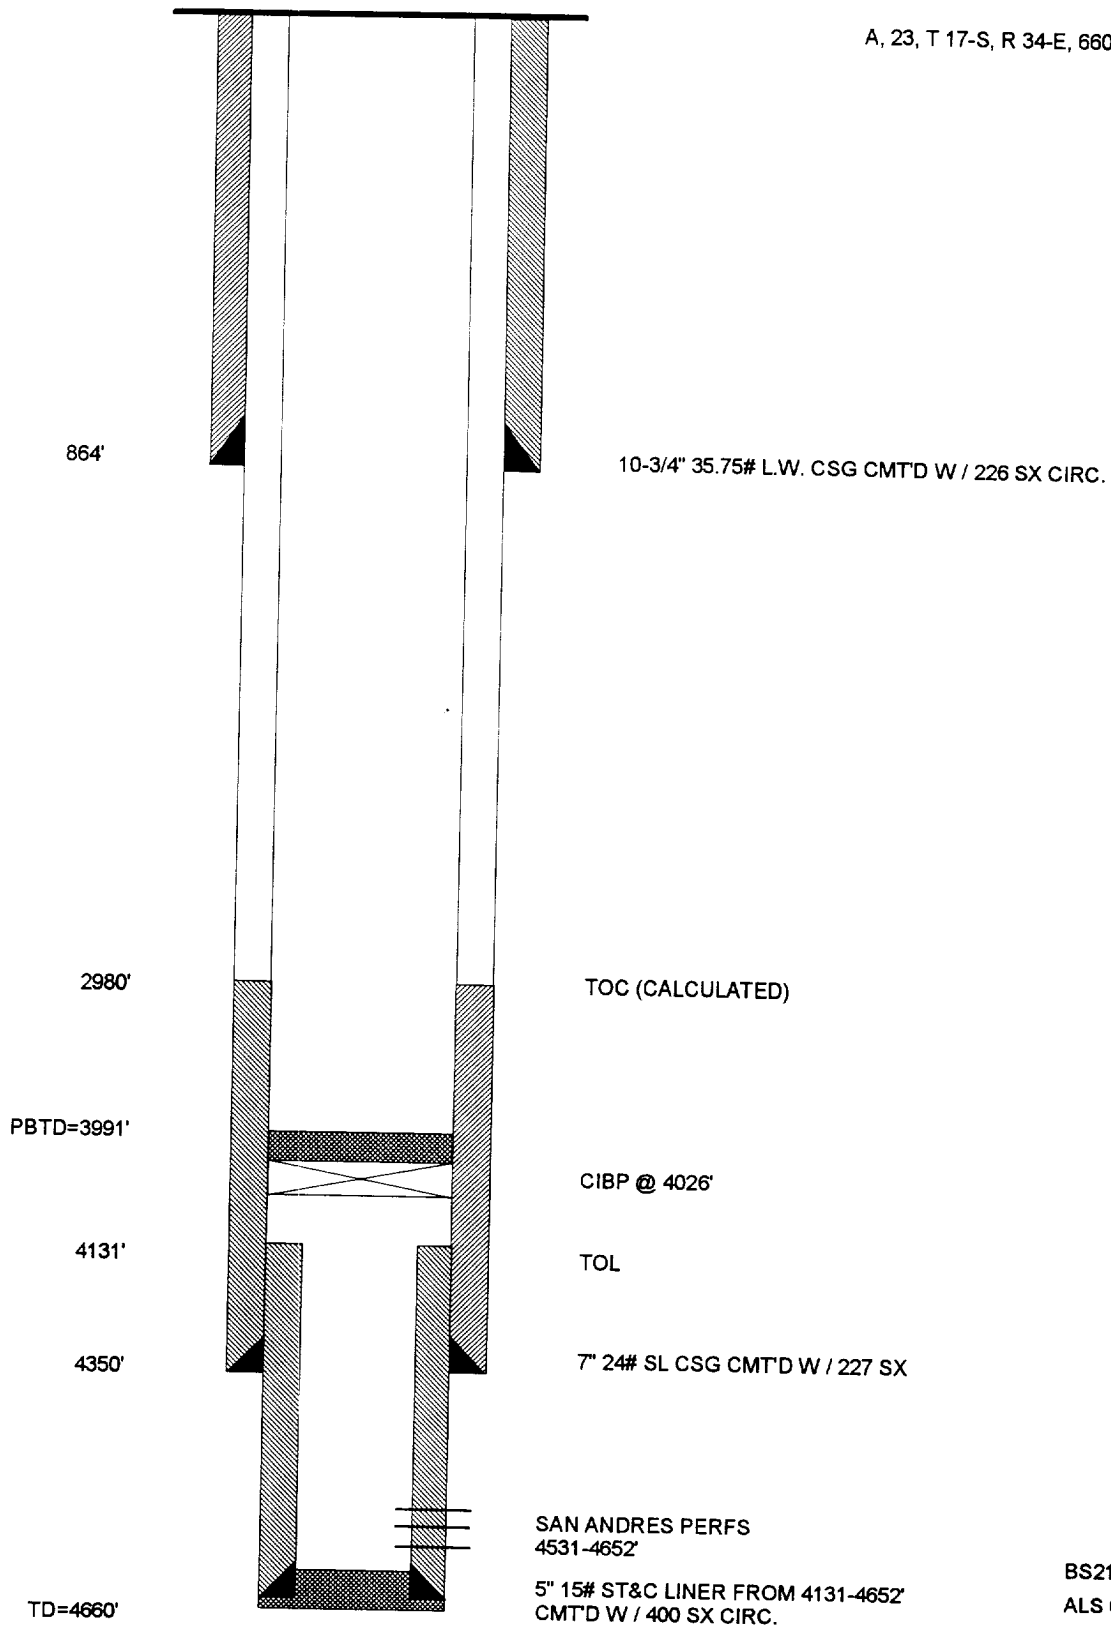

BS21C.PRE
ALS 08/02/93

BRIDGES STATE
WELL # 21 WIW
VACUUM GRAYBURG (SAN ANDRES) FIELD
LEA COUNTY, NEW MEXICO
PROPOSED COMPLETION

A, 23, T 17-S, R 34-E, 660' FNL, 660' FEL

KB = 4028'

GL = 4017'

15 SX CLASS C NEAT CMT PLUG
FROM SURFACE-30'

10-3/4" 36# L.W. CSG CMT'D
W / 226 SX CIRC. @ 864'

50 SX CLASS C NEAT CMT PLUG ACROSS CSG SHOE
FROM 914-814'

50 SX CLASS C NEAT CMT PLUG ACROSS SALT TOP @
1740' AND 7" CSG STUB FROM 1790-1690'

TOC @ 2980' (CALCULATED)

30 SX CLASS C NEAT CMT PLUG ACROSS SALT BASE @
3000' AND TOC @ 2980' FROM 3050-2930'

PBTD=3991'

CIBP @ 4026'

TOL @ 4131'

7" 24# SL CSG CMT'D
W / 227 SX @ 4350'

SAN ANDRES PERFS
4531-4652'

TD=4660'

5" 15# ST&C LINER FROM 4131-4652'
CMT'D W / 400 SX CIRC.

BS21P.PRE
ALS 08/02/93

