

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-02131
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name	Bridges State
8. Well No.	488
9. Foot name or Wildcat	Vacuum Grayburg (San Andres)

SUNDY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE 'APPLICATION FOR PERMIT' (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☐ GAS WELL ☐ OTHER ☒ Injector

2. Name of Operator Mobil Producing TX & NM Inc.*
*Mobil Exploration & Producing US Inc. as agent for MPTM

3. Address of Operator
P.O. Box 633, Midland, TX 79702

4. Well Location
Unit Letter I : 1980 Feet From The South Line and 660 Feet From The East Line
Section 27 Township 17-S Range 34-E NMPM Lea County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) KB 4047

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐		CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.
- MIRU PU. DIG PIT. FLOW WELL BACK TO PIT. ND WH. NU BOP.
 - RIH W/ WS TO 2820'. LOAD HOLE W/ 10 PPG GELLED BRINE. SPOT 40 SX CLASS C NEAT CMT PLUG ACROSS SALT BASE @ 2770' AND TOC @ 2649' FROM 2820-2599'.
 - PUH TO 1720'. CUT AND PULL 7" CSG OR PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG ACROSS SALT TOP @ 1670' FROM 1720-1620'. **PLUG MUST BE TAGGED!**
 - PUH TO 872'. SPOT 50 SX CLASS C NEAT CMT PLUG ACROSS 10-3/4" CSG SHOE @ 822' FROM 872-772'. (IF 7" CSG NOT RECOVERED. PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG). **PLUG MUST BE TAGGED!**
 - PUH TO 30'. SPOT 15 SX CLASS C NEAT CMT PLUG FROM 30'-SURFACE. POOH W/ WS. ND BOP. RD PU. DIG OUT CELLAR AND CUT CSG 3' BELOW SURFACE. WELD STEEL PLATE ON CSG STUB. ERECT P&A MARKER WITH WELL NAME AND PLUGGED DATE. FILL CELLAR AND CLEAN SURFACE LOCATION.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kaye Pollock TITLE Regulatory Technician DATE 08-04-93

TYPE OR PRINT NAME Kaye Pollock TELEPHONE NO. 915-688-2584

APPROVED BY Paul Kautz Geologist TITLE _____ DATE AUG 09 1993

CONDITIONS OF APPROVAL, IF ANY: **THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.**

BRIDGES STATE # 48 WIW
VACUUM GRAYBURG (SAN ANDRES) FIELD
LEA COUNTY, NEW MEXICO


RECOMMENDED WORKOVER PROCEDURE

1. MIRU PU. DIG PIT. FLOW WELL BACK TO PIT. ND WH. NU BOP.
2. RIH W/ WS TO 2820'. LOAD HOLE W/ 10 PPG GELLED BRINE. SPOT 40 SX CLASS C NEAT CMT PLUG ACROSS SALT BASE @ 2770' AND TOC @ 2649' FROM 2820-2599'.
3. PUH TO 1720'. CUT AND PULL 7" CSG OR PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG ACROSS SALT TOP @ 1670' FROM 1720-1620'. **PLUG MUST BE TAGGED!**
4. PUH TO 872'. SPOT 50 SX CLASS C NEAT CMT PLUG ACROSS 10-3/4" CSG SHOE @ 822' FROM 872-772'. (IF 7" CSG NOT RECOVERED, PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG). **PLUG MUST BE TAGGED!**
5. PUH TO 30'. SPOT 15 SX CLASS C NEAT CMT PLUG FROM 30'-SURFACE. POOH W/ WS.
6. ND BOP. RD PU. DIG OUT CELLAR AND CUT CSG 3' BELOW SURFACE. WELD STEEL PLATE ON CSG STUB. ERECT P&A MARKER WITH WELL NAME AND PLUGGED DATE. FILL CELLAR AND CLEAN SURFACE LOCATION.

BRIDGES STATE
WELL # 48 WIW
VACUUM GRAYBURG (SAN ANDRES) FIELD
LEA COUNTY, NEW MEXICO
CURRENT COMPLETION

KB = 4047'
GL = 4036'

I, 27, T 17-S, R 34-E, 1980' FSL, 660' FEL

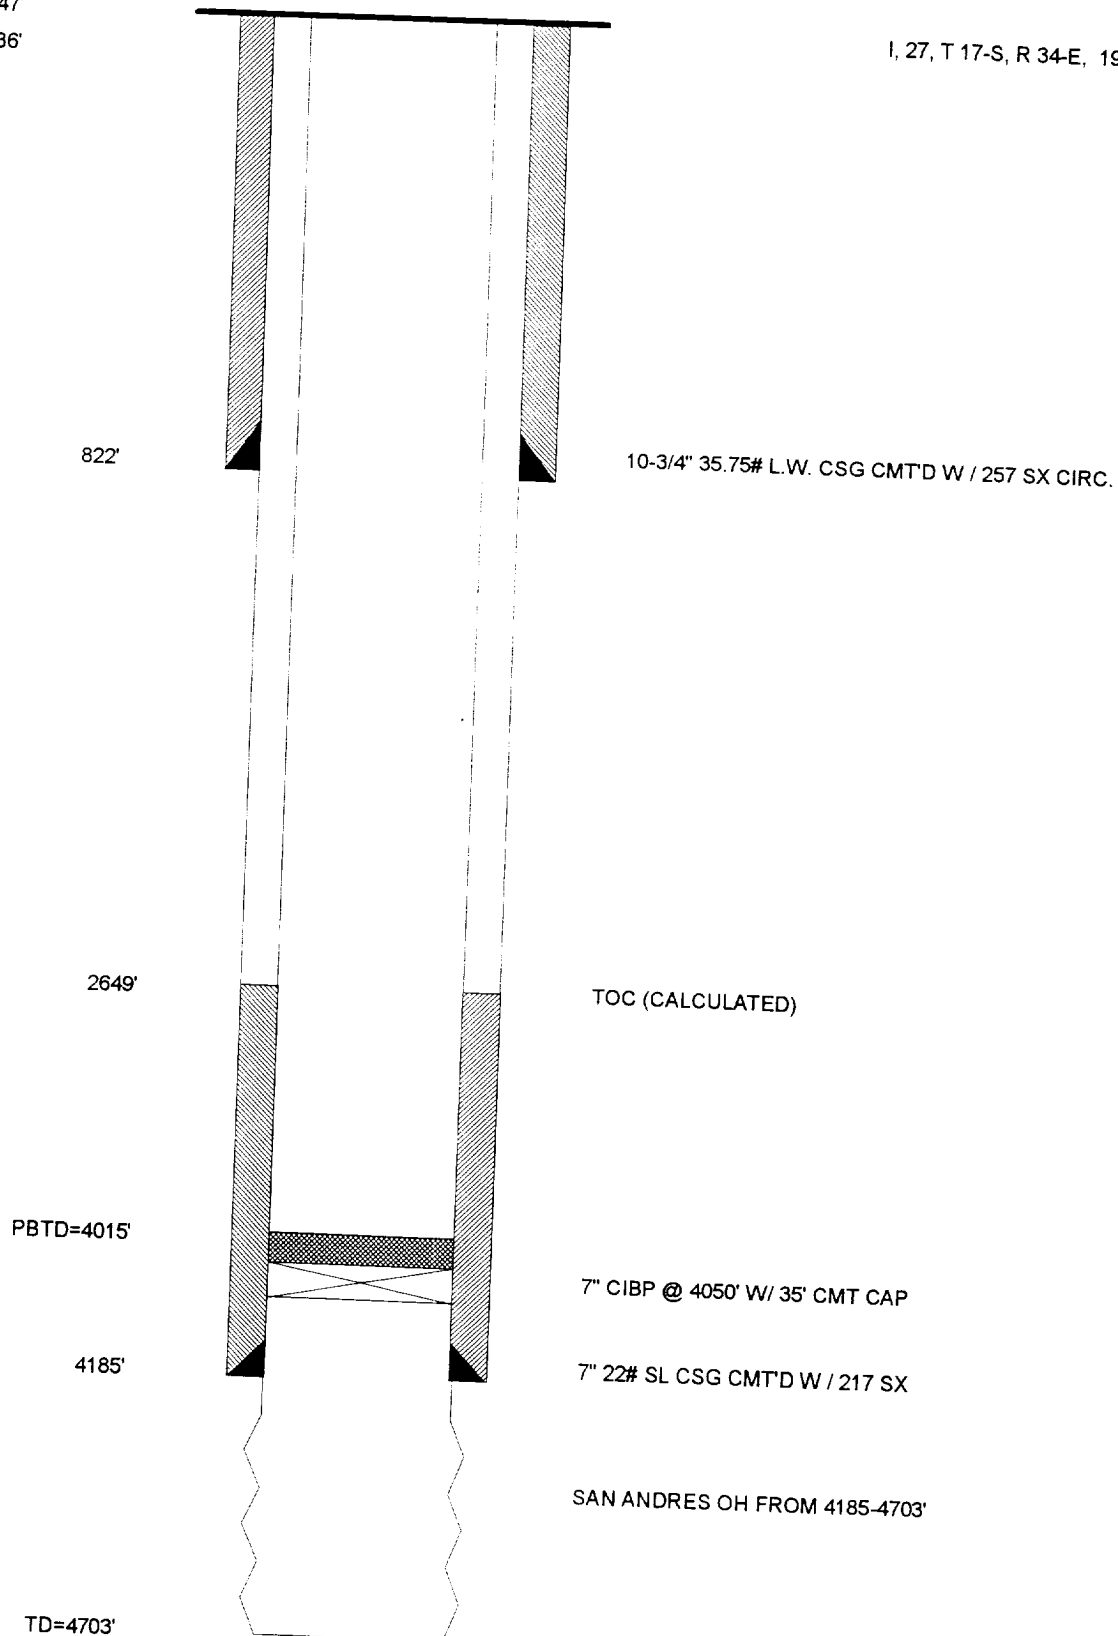

BRIDGES STATE
WELL # 48 WIW
VACUUM GRAYBURG (SAN ANDRES) FIELD
LEA COUNTY, NEW MEXICO
PROPOSED COMPLETION

KB = 4047'
GL = 4036'

I, 27, T 17-S, R 34-E, 1980' FSL, 660' FEL

10-3/4" 35.75# L.W. CSG @ 822'
CMT'D W / 257 SX CIRC.

15 SX CLASS C NEAT CMT PLUG
FROM 30'-SURFACE

50 SX CLASS C NEAT CMT PLUG ACROSS CSG SHOE
FROM 872-772'
PLUG MUST BE TAGGED!

50 SX CLASS C NEAT CMT PLUG ACROSS SALT TOP @
1670' AND 7" CSG STUB FROM 1720-1620'
PLUG MUST BE TAGGED!

TOC @ 2649' (CALCULATED)

40 SX CLASS C NEAT CMT PLUG ACROSS SALT BASE @
2770' AND TOC @ 2649' FROM 2820-2599'

PBTD=4015'

7" CIBP @ 4050' W/ 35' CMT CAP

7" 22# SL CSG @ 4185'
CMT'D W / 217 SX

SAN ANDRES OH FROM 4185-4703'

TD=4703'