

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

811 South First, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO. 30-025-02196	
5. Indicate Type of Lease STATE ☒ FEE ☐	
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name: Vacuum Grayburg San Andres	
8. Well No. 32	
9. Pool name or Wildcat West Vacuum Unit	

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well ☐ Gas Well ☐ Other Injector ☐	
2. Name of Operator Texaco Exploration & Production, Inc.	
3. Address of Operator P. O. Box 3109, Midland, TX 79702	
4. Well Location Unit Letter O : 660 feet from the South line and 1980 feet from the East line Section 33 Township 17S Range 34E NMPM Lea County	
10. Elevation (Show whether DR, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒	REMEDIAL WORK ☐ ALTERING CASING ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐	CASING TEST AND CEMENT JOB ☐
OTHER: ☐	OTHER: ☐

- 12. Describe proposed or completed operations.** (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.
- Set 5 1/2" CIBP @ 4350', Spot 25 Sx plug 4350'-4150' (Grayburg- San Andres WOC Tag.
 - Displace hole w/MLF, 9.5# Brine w/25# gel P/BBL.
 - Spot 25 Sx plug 3800'-3600' (Queen)
 - Spot 25 Sx plug 2900'-2700' (Yates, B-Salt) WOC Tag
 - Spot 25 Sx plug 1700'-1500' (T-Salt) WOC Tag.
 - Perf 6 holes @ 960', Sqz 125 Sx plug 960'-700' (8 5/8" shoe) WOC Tag.
 - 10 Sx Surf, Install dry hole marker.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF DRILLING OPERATIONS FOR THE Casing TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE James T. Corbett TITLE FACILITY ENGINEER DATE 8/27/01
Type or print name JAMES T. CORBITT Telephone No. 915 688-4438
(This space for State use)


APPROVED BY _____ TITLE _____ DATE AUG 27 2001
Conditions of approval, if any:

PLUGGING & ABANDONMENT WORKSHEET

(2 STRING CSNG)

OPERATOR TEXACO Exploration & Production
LEASENAME VACUUM GRAYBURG SAN ANDRES

SECT 33 TWN 17S RNG 34 E
FROM 660 NSL 1980 EWL
TD: 4740 FORMATION @ TD GRAYBURG
PBDT: FORMATION @ PBDT S. ANDRES

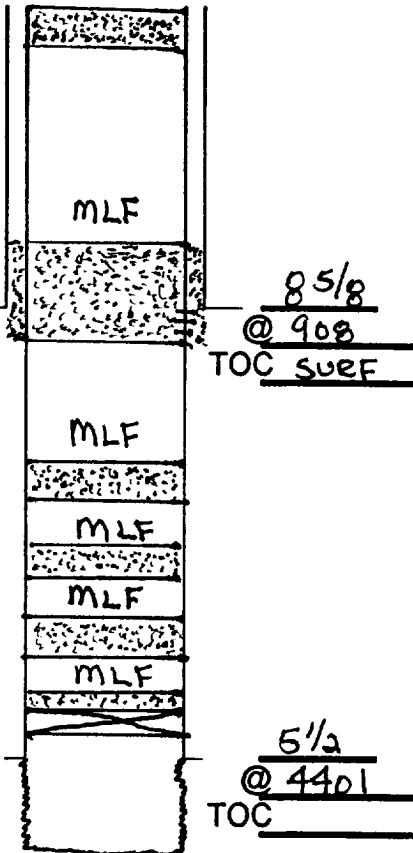

	SIZE	SET @	TOC	TOC DETERMINED BY	
SURFACE	8 5/8	908	SURF	Circ	
INTMED 1					
INTMED 2					
PROD	5 1/2	4401	700	CALC	
	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					
CUT & PULL @			TOP - BOTTOM		
INTMED 1			PERFS	-	
INTMED 2			OPENHOLE	4401 - 4740	
PROD					

*REQUIRED PLUGS DISTRICT I

RUSTLER (ANHYD)	
YATES	
QUEEN	
GRAYBURG	
SAN ANDRES	
CAPTAN REEF	
DELAWARE	
BELL CANYON	
CHERRY CANYON	
BRUBBY CANYON	
BONE SPRING	
GLORIETA	
BLINEBRY	
TUBB	
DRINKARD	
ABO	
WC	
PENN	
STRAWN	
ATOKA	
MORROW	
MISS	
DEVONIAN	

PLUG	TYPE	SACKS	DEPTH
PLUG	PLUG	CMNT	
EXAMPLES			
PLUG #1	OH	35 SXS	6400'
PLUG #2	SHOE	50 SXS	5350'-5450'
PLUG #3	CIBP/35'		4800'
PLUG #5	CIBP	25 SXS	4800'
PLUG #4	STUB	50 SXS	3600'-3700'
PLUG #5	RETRN SQZ	200 SXS	400'
PLUG #6	SURF	10 SXS	0-10'
PLUG #1	CIBP	25 SX	4350-4450
PLUG #2	QUEEN	25 SX	3800-3600
PLUG #3	YATES	25 SX	2900-2700
PLUG #4	T-SALT	25 SX	1700-1500
PLUG #5	85/8 S	125 SX	960-700
PLUG #6	SURF	10 SX	10'-SURF
PLUG #7			
PLUG #8			
PLUG #9			
PLUG #10			
PLUG #			
PLUG #			

TD 4740

