

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO.
30-025-02209

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.
858150

7. Lease Name or Unit Agreement Name:

West Vacuum Unit

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator

Chevron USA, Inc.

3. Address of Operator

15 Smith Rd. Midland, Tx 79705

8. Well No.
26

9. Pool name or Wildcat
Vacuum, Grayburg, S.A.

4. Well Location

Unit Letter L : 1980 feet from the south line and 660 feet from the west line

Section 34 Township 17-S Range 34-E NMPM County Lea

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐


COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Notify OCD 24 hrs prior to MI & RU
2. RIH Tag 5 1/2 CIBP @ 4082 spot 25sx plug 4083-3900 (Grayburg, San Andres) WOC Tag.
3. Displace hole w/MLF 9.5# Brine w/25 # Gel P/BBL.
4. Spot 25sx plug 2700-2500(B-salt)
5. Perf 4 holes @ 1600, sqz 40sx plug 1600-1500(T-salt) WOC Tag.
6. Perf 4 holes @ 950, sqz 40sx plug 950-800(8 5/8 shoe) WOC Tag.
7. Perf 4 holes @ 300, sqz 75sx plug 300-surf(surf) WOC Tag.
8. Install dry hole marker.

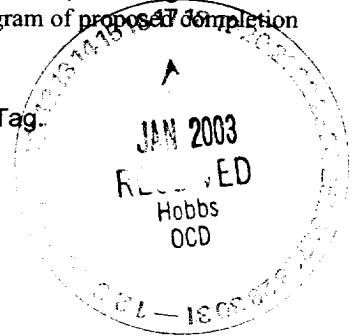

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE G.R. Bledsoe TITLE HES Specialist DATE 1/15/2003

Type or print name G.R. Bledsoe Telephone No. 915-687-7153

(This space for State Use) ORIGINAL SIGNED BY

CHRIS THAMMS

APPROVED BY OC DISTRICT SUPERVISOR/GENERAL MANAGER

DATE JAN 17 2003

Conditions of approval, if any: