

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-02897
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil & Gas Lease No.	B-2840
7. Lease Name or Unit Agreement Name	EAST VACUUM GB / SA TRACT #2739
8. Well No.	003
9. Pool name or Wildcat	VACUUM GRAYBURG/SAN ANDRES
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3937' RKB, 3927' GL	

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	
2. Name of Operator Phillips Petroleum Company	
3. Address of Operator 4001 Penbrook Street, Odessa, TX 79762	
4. Well Location Unit Letter J : 1980' Feet From The SOUTH Line and 1980' Feet From The EAST Line Section 27 Township 17-S Range 35-E NMPM LEA County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3937' RKB, 3927' GL	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: REPAIR LEAK & RET T/INJECTION ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2/04/97 MIRU DA&S WS #291, PMP BRINE T/KILL, NU BOP & PAN, REL PKR, COOH W/TBG, RACK WS TBG & TALLY, PU GIH W/RBP & PKR T/+-1900', SISD.

2/05/97 KILL W/BRINE, FIN GIH W/PRK & RBP, SET RBP @ 4100' & PKR @ 4070', TST TOOLS T/1000# OK, OPEN PKR BYPASS, LD BKSIDE, PMP INTO CST @ 2 BPM @ 400#, REL PKR, MOVE T/2022', RESET, LD & TST BELOW PKR, SML LK, REL PKR, MOVE DWN T/2054', RESET, LD & TST T/500# BELOW PKR, OK, REL PKR, MOVE UP T/1991', LD & TST BKSIDE T/500# OK, ESTAB INJ RATE BETWEEN 1991' & 2054' 3 BPM @ 300# T/500#, DMP 10' SAND ON TOP RBP, SISD.

2/06/97 REL PKR, COOH, GIH W/TBG OPEN ENDED T/1841', CIRC HOLE W/BRINE, MIRU HES CMT CREW, MIX & PMP 250 SKS CL C NEAT, DISPLACE W/4 BBL FR WTR, PRESSURE @ 840#, FLOW BK 4 BBL WTR & 5 BBL CMT DISPL 7 BBL W/PRESS @ 900# DISPL 11 BBL W/PRESS @ 1000# WOC OPEN UP W 1000# ON TBG FLOW BK FR WTR, CMT & SOME BRINE CIRC 27 BBL FR WTR COOH W/TBG, SISD.
(CONTINUED ON BACK)

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

TITLE Senior Regulation Analyst

DATE

3/04/97

TYPE OR PRINT NAME

Larry M. Sanders

TELEPHONE NO. (915) 368-1488

(This space for State Use) ORIGINAL SIGNED BY

GARY WINK
FIELD REP. II

APPROVED BY

TITLE

DATE

MAR 10 1997

CONDITIONS OF APPROVAL, IF ANY:

02/07/97 GIH W/SCRAPER & TBG, TAG @ 1841', DRL W/SCRAPER T/+-1847', FIN RU REV UNIT, CO STRINGERS T/2050', ESTAB RATE 2.3 BPM @ 300#, COOH W/TBG & SCRAPER, GIH W/CMT RET T/1930', SISD.

02/09/97 W/CMT RET @ 1930', PMP THRU RET, DISPL TBG & BKSIDE W/75 BBL FR WTR, SET RET & TST T/1500# OK, TST BKSIDE T/500# OK, STING OUT OF RET, MIX & SPOT 9 BBL CMT SLURRY T/RET, STING INTO RET, MIX & PMP REST OF 300 SKS CL C NEAT CMT (70.7 BBL SLURRY) @ 1.1 BPM @ 600-700#, SD WASH UP, DISPL W/7.5 BBL FR WTR W/980# ON TBG, WAIT 5 MIN W/960# ON TBG STING OUT OF RET, REV OUT TBG, COOH W/TBG, PU START IN HOLE W/BIT, COLLARS & TBG, SISD.


02/10/97 FIN GIH W/TBG, TAG @ 1926', DRL OUT RET & CMT, PRESS UP T/500#, OK, COOH W/TBG, SISD.


02/11/97 COOH LD COLLARS & BIT, GIH W/RETRIEVING TL, WASH SAND OFF RBP, REL COOH, GIH W/TBG, COOH LD WS, SISD.

02/12/97 KILL, COOH LD REST WS, TRY T/MIRU TBG TSTRS, BAD WEATHER, SISD.

02/13/97 KILL, MIRU TBG TSTRS, TST IN HOLE W/PKR & TBG, CLNING PINS & PUT ON SEALLUBE THREAD DOPE, RD TBG TSTRS, SD BAD WEATHER.

02/16/97 KILL, MIRU TBG TSTRS, FIN TSTG TBG IN HOLE, RDMO TBG TSTRS, CIRC PKR FLUID, ND PAN & BOP, SET PKR @ 4137', FLNG UP WH, LD & TST T/500#, BLD OFF AIR/GAS DUE T/INCREASE IN PRESS, TST LEFT OK, RDMO DDU, HOOK UP F/INJ.

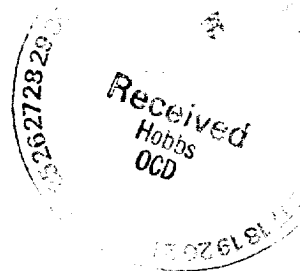COMPLETE DROP F/REPORT

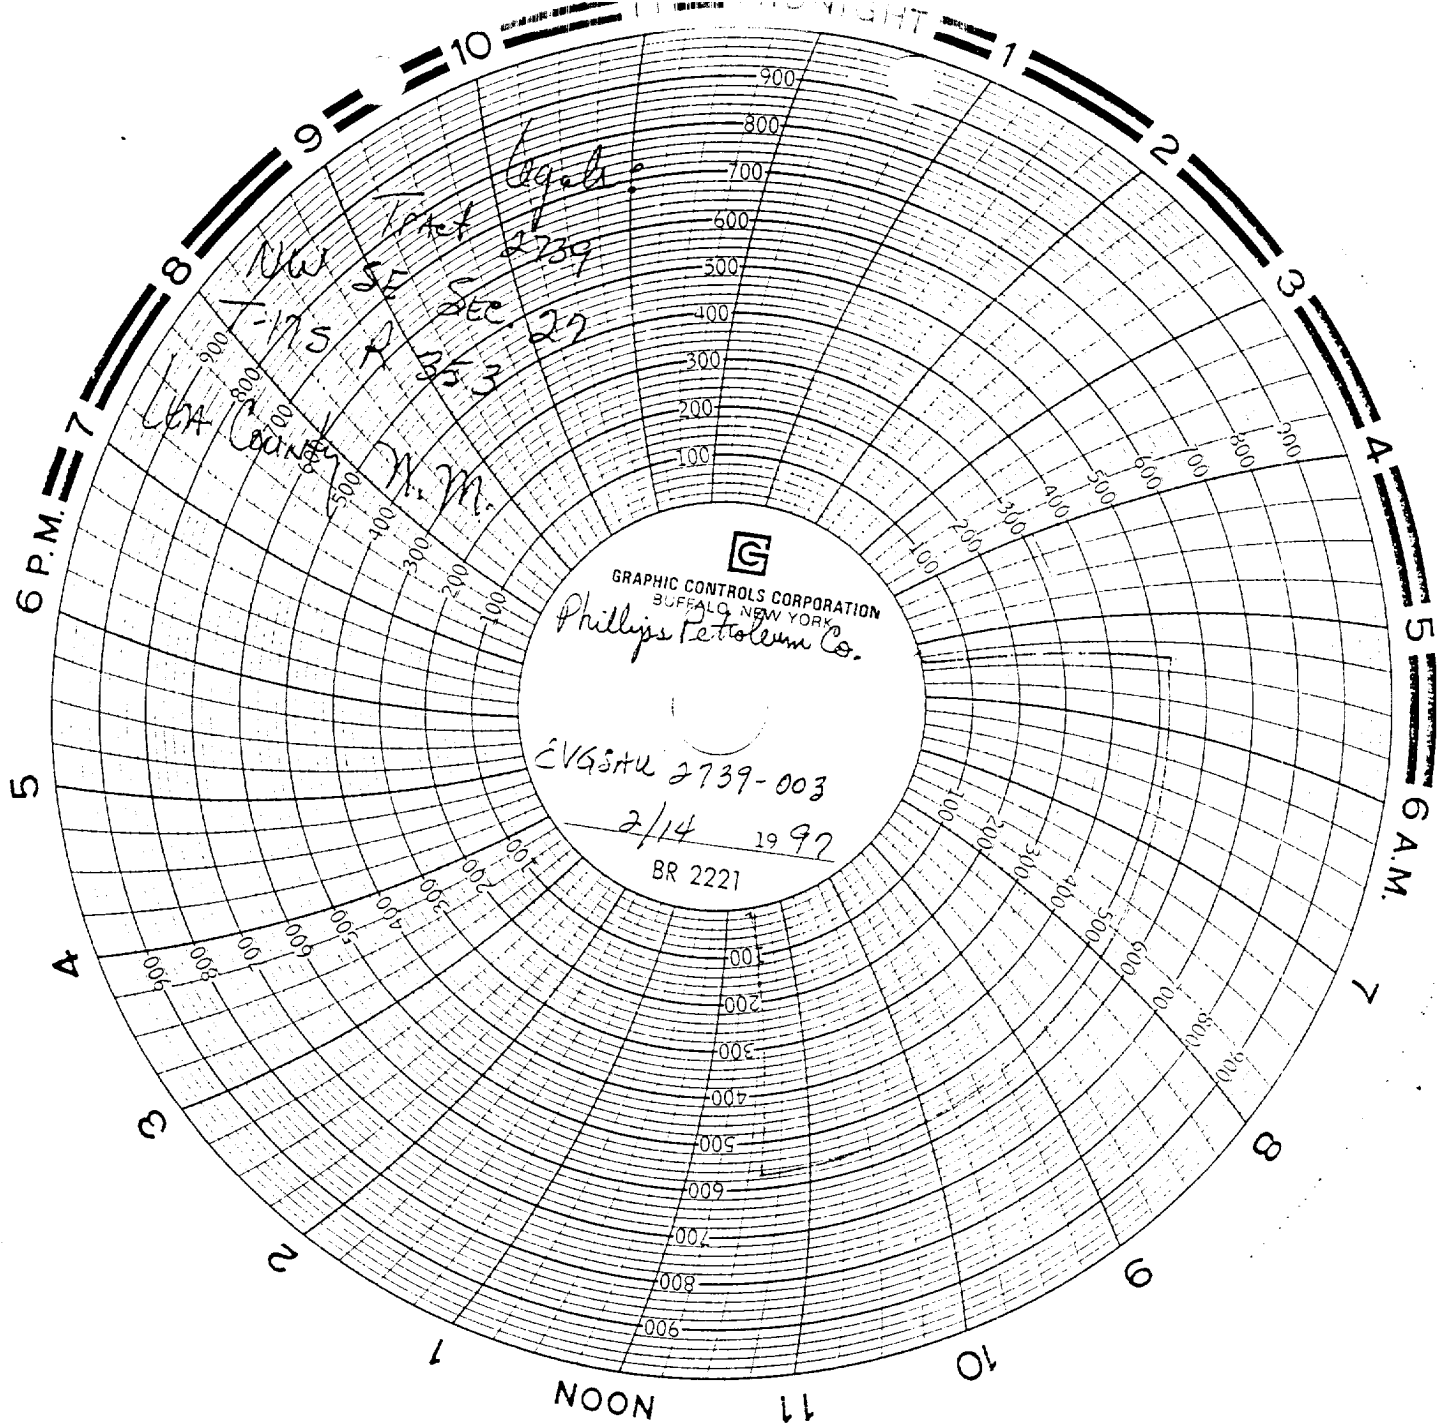

This chart was mailed 2/20/97
d

