

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO. 30 - 025 - 20125	
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil / Gas Lease No. B-155-1	
7. Lease Name or Unit Agreement Name NEW MEXICO -O- STATE NCT-1	
8. Well No. 17	
9. Pool Name or Wildcat VACUUM WOLFCAMP	

SUNDRY NOTICES AND REPORTS ON WELL
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:	OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	P.O. BOX 730, HOBBS, NM 88240
4. Well Location Unit Letter <u>N</u> : <u>760</u> Feet From The <u>SOUTH</u> Line and <u>2080</u> Feet From The <u>WEST</u> Line Section <u>36</u> Township <u>17-S</u> Range <u>34-E</u> NMPM <u>LEA</u> COUNTY	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3997' GL	

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐
PULL OR ALTER CASING ☐	
OTHER: ☐	


SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒	ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐	PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐	
OTHER: ☐	ADDED UPPER WOLFCAMP PERFS ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

11/1/94 - 11/30/94

X String: 2 7/8" original Wolfcamp string
Y String: 2 7/8" Upper Penn string
Z String: 3 1/2" current Wolfcamp string

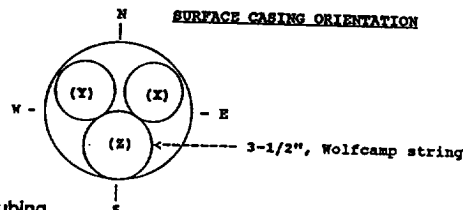

- MIRU. Pulled rods and pump from Z string (current 3 1/2" Wolfcamp string). NU BOP and POH with tubing.
- In X string, TIH w/ 2 5/16" shoe on 1 5/8" WS to 9076', TOH w/ shoe. Set CIBP @ 9000' & capped w/ 35' cmt, PBTD @ 8965'. Tstd csg to 340# on chart, held ok. (ORIGINAL CHART ATTACHED, COPY OF CHART ON BACK)
- In Y string, TIH w/ 2 5/16" shoe on 1 5/8" WS, tagged up @ 6740', D/O 49' of cmt to 6789'. Circled clean. Tstd csg to 300# on chart from 6789' to surface. Held ok. (ORIGINAL CHART ATTACHED, COPY OF CHART ON BACK)
- In Z string, TIH w/ 2-7/8" shoe on 1 5/8" & 2 1/16" WS to 10,087'. TOH w/ WS. Set CIBP @ 9950' & capped w/ 35' cmt. Attempted to test acsg, would not hold pressure. TIH w/ pkr & set @ 9876'. Attempted to test from pkr to CIBP @ 9950', plug would not load. Loaded annulus & tstd backside, held ok. TOH w/ pkr.
- In Z string, set CIBP @ 9875', tstd to 400#, held ok. Dumped 35' cmt on top of CIBP, PBTD @ 9840'. Tstd csg tp 560# on chart, held ok. (ORIGINAL CHART ATTACHED, COPY OF CHART ON BACK)
- In the progress of perforating by use of 2 1/8" strip guns, one of the strips hung up in hole, leaving strip @ app. 9605'. TIH w/ overshot & caught fish @ 9655'. TOH w/ fish. TIH w/ 2 7/8" shoe & tagged remainder of strip @ 9655'. Washed over strip & worked down to 9802' (15' below bottom perf)
- Perforated the following Wolfcamp intervals using a 2-1/8" strip gun, 120° phasing, @ 2 SPF: (136' net perfs) 9341'-50', 9379'-84', 9414'-27', 9432'-42', 9455'-59', 9464'-66', 9476'-79', 9500'-05', 9521'-29', 9603'-57', 9770'-74', 9780'-87'.
- TIH w/ 3-1/2" treating packer & set @ 9292'. Loaded backside & tested to 500#, held ok. Acidized new perfs from 9341'-9787' w/ 15,000 gals 15% NEFE. Max P = 4500#, AIR = 5.2 bpm. Swabbed back. TOH w/ treating pkr.
- Swab tested well. Effective 11/30/94, left well shut-in pending further evaluation.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Monte C. Duncan TITLE Engr Asst

DATE 1/23/95

TYPE OR PRINT NAME Monte C. Duncan

Telephone No. 397-0418

(This space for State Use)

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT SUPERVISOR

APPROVED BY JERRY SEXTON TITLE DISTRICT SUPERVISOR

DATE JAN 23 1995

CONDITIONS OF APPROVAL, IF ANY:

PRINTED IN U.S.A.

TEXACO EXPLORATION AND PRODUCTION INC

PO BOX 730
HOBBS NEW MEXICO 88541-0730

LT N 56-36 T-MS R-394-E
CP-10-4 N-1-4
30-025-20125

CALIBRATED
CHARTS

N.M. State NCT 1-17

ENTER NUMBER

TIME PUT IN

TIME TAKEN OUT

11-4 74

TIME PUT IN

TIME TAKEN OUT

11-4 74

BR-2221
B 0-1000-8

Y Strips

DAY

NIGHT

11-4-94

N.M. O STATE

TEST 2 3/8 1 NOT #

17

Ⓢ WEST SIDE

6789' TO SURF

Y. String (West String)

11-4-94

WELL NAME

N.M. O' State NOT-1 #17

SUPERVISOR

Tom Sebastian


PACKER TYPE

~~PACKER~~

PACKER SETTING DEPTH

PERFORATIONS

PRINTED IN U.S.A.

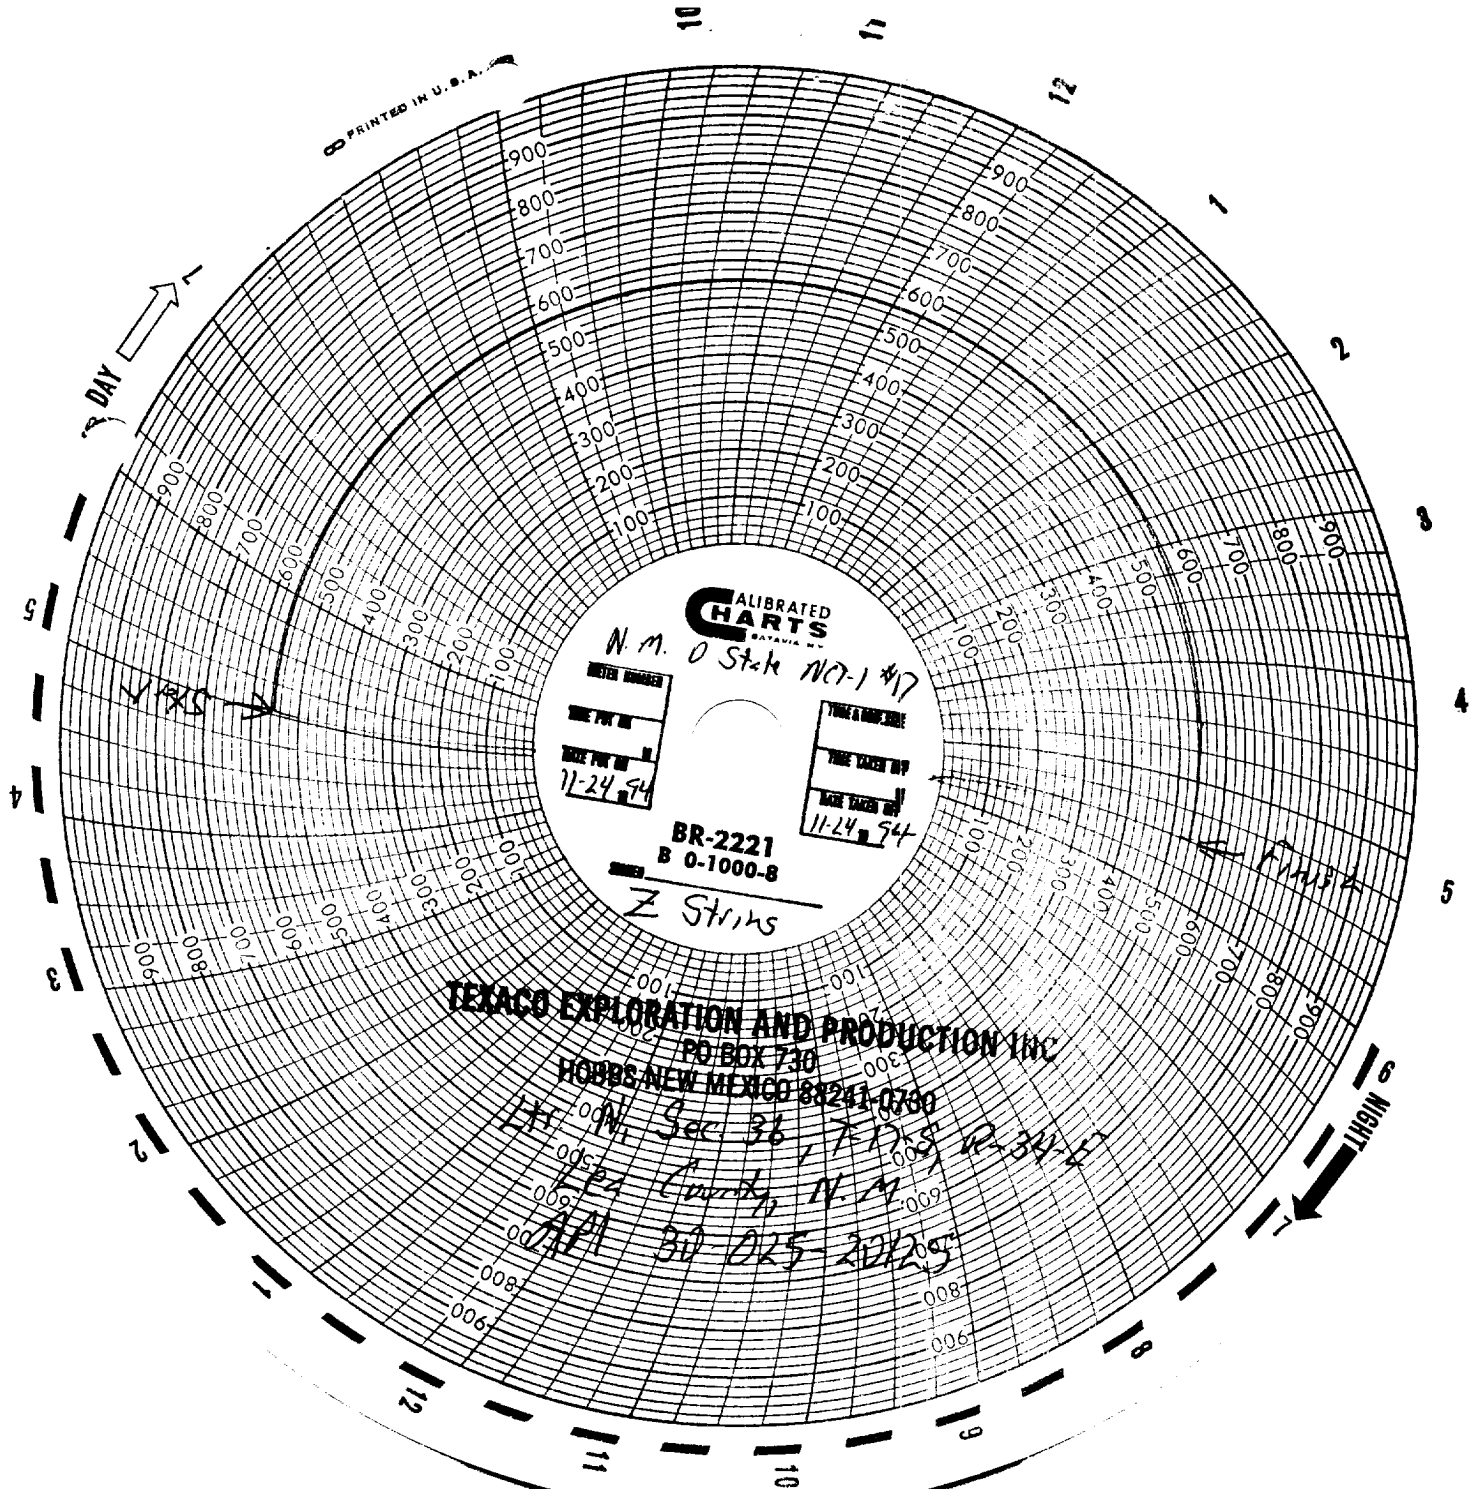

CALIBRATED
CHARTS
BATAVIA, NY

N. M. 0 Stk NO-1 #17

METER NUMBER
TIME TAKEN IN
DATE TAKEN IN
11-24-94

TIME TAKEN OUT
DATE TAKEN OUT
11-24-94

BR-2221
B 0-1000-8

Z Strips

TEXACO EXPLORATION AND PRODUCTION INC
PO BOX 730
HOBBS NEW MEXICO 88241-0730

LT N. Sec 36, T17S, R34E
La Brea County, N. M.
API 30-025-20225

Z Strings

DATE 11/24/94

WELL NAME New Mexico O Stake NCT-1#17

SUPERVISOR Tom Sebastain


PACKER TYPE CIBP


PACKER SETTING DEPTH 9875 w/ 35' cnt

REMARKS

PBTD 9840 (35' of cnt)

3 1/2 CSS Strings

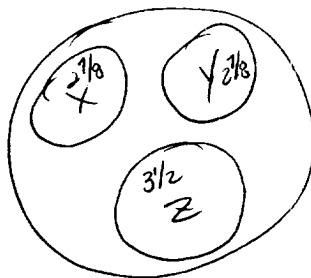

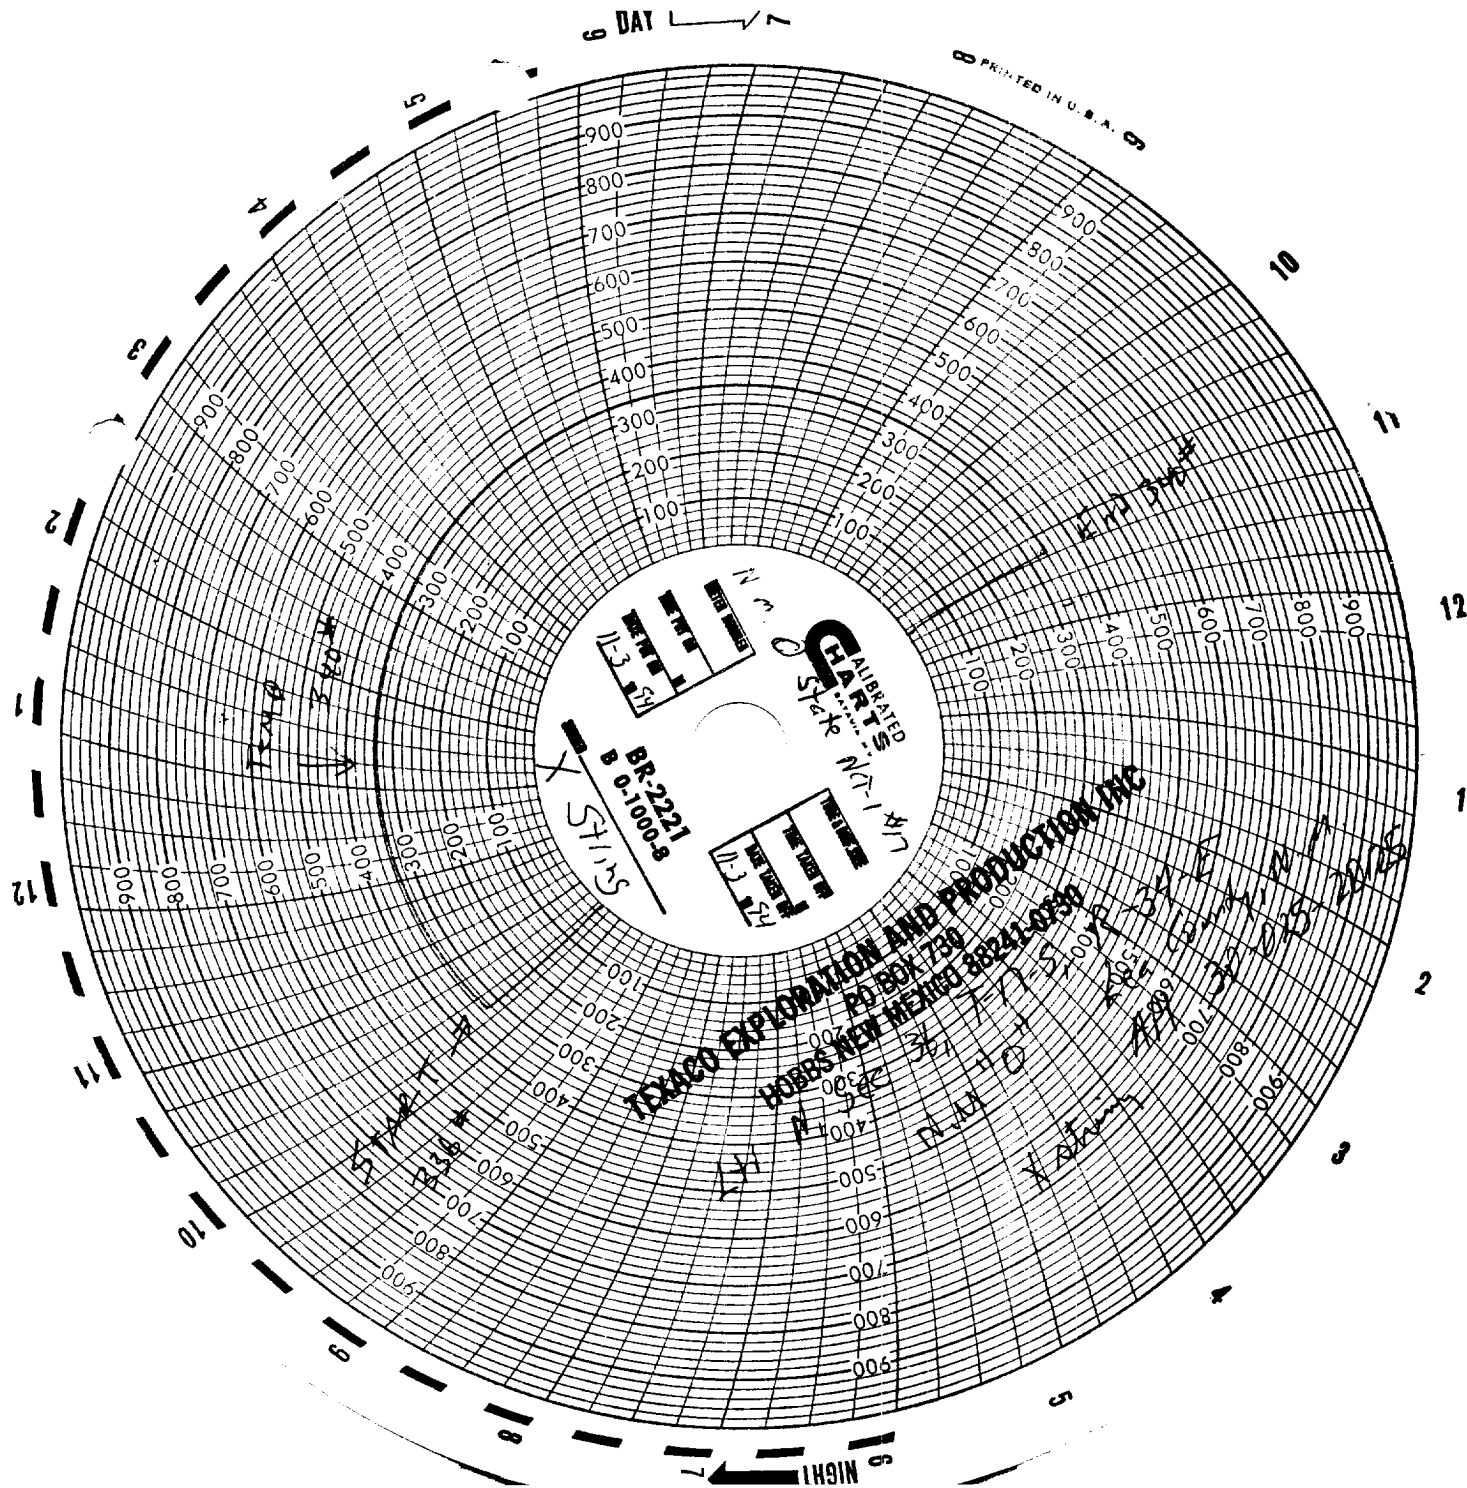

X-String (East String)

WELL NAME NM 0 5th NCF-1 #17

SUPERVISOR 11/13/94

PACKER TYPE Tom Seabastain

CIBP ~~PACKER~~ SETTING DEPTH CIBP

PERFORATIONS 9000 w/ 35' cnt

PGTD 8965' (35' of cnt)