

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-20172
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. B-155-1
7. Lease Name or Unit Agreement Name NEW MEXICO "Q" STATE
8. Well No. 5
9. Pool name or Wildcat VACUUM GLORIETA/BLINEBRY

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL ☒ GAS ☐ OTHER ☐	
2. Name of Operator TEXACO E & P INC.	
3. Address of Operator PO BOX 3109; MIDLAND, TEXAS 79701	
4. Well Location Unit Letter <u>O</u> : <u>460</u> Feet From The <u>SOUTH</u> Line and <u>2080</u> Feet From The <u>EAST</u> Line Section <u>25</u> Township <u>17S</u> Range <u>34E</u> NMPM <u>LEA</u> County <u></u>	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3997 (GR)	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐	REMEDIAL WORK ☐
PULL OR ALTER CASING ☐	ALTERING CASING ☐
OTHER: ☐	COMMENCE DRILLING OPNS. ☐
	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.
- 1) NOTIFY NMOCDD OF INTENT TO PLUG AND ABANDON WELL.
 - 2) RIG UP ON X-SIDE OF WELL. (THIS IS A DUAL COMPLETION W/ 2 STRINGS OF 2 7/8" TUB AS CSG FOR PRODUCTION
 - 3) SET RETAINER @ 5900' & SQZ 55 SX CMT BELOW RETAINER INTO PERFS @ 5941'-6290'
 - 4) CIRC CSG W/ 25#/ BBL SALT GEL MUD SPOT 10 SX CMT F/ 5900'-5600' (T GLORIETA @ 5884')
 - 5) SPOT 10 SX CMT F/ 4370'-4070' (T SAN ANDRES 4320')
 - 6) SPOT 10 SX CMT F/ 3733'-3433' (T QUEENS 3683')
 - 7) PERF @ 3308' & SQZ 60 SX CMT BELOW CMT RETAINER @ 3200'. (8 5/8" CSG SHOE @ 3305')
 - 8) SPOT 20 SX CMT F/ 3200'-2700'
 - 9) PERF & SQZ @ 1720' W/ 60 SX CMT BELOW RETAINER @ 1500' UNSTING F/ RETAINER & CAP W/ 100' CMT (T SALT 1670' 11 3/4" CSG SHOE 1550')
 - 10) SPOT 10 SX CMT F/ 300'-SURFACE' (NOTE X-SIDE OF WELL PLUGGED)
 - 11) RIG UP Y-SIDE SET CMT RETAINER @ 6040' & SQZ 55 SX CMT BELOW RETAINER INTO PERFS @ 6090'-6094' CIRC CSG W/ 25#/BBL SALT GEL MUD
 - 12) SPOT 10 SX 6040'-5740' (T GLORIETA @ 5884')

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE R.J. Harding III TITLE OPERATIONS ENGINEER DATE 915/688/4816
TYPE OR PRINT NAME R.J. HARDING III TELEPHONE NO. 915/688/4816

(This space for state use)

ORIGINAL SIGNED BY RENEE J. SEXTON

APPROVED BY RENEE J. SEXTON TITLE DATE JUL 27 1995

CONDITIONS OF APPROVAL, IF ANY:

Not
P. 10-12

- 13) SPOT 10 SX CMT F/ 4370'-4070' (T SAN ANDRES 4320')
- 14) SPOT 30 SX CMT F/ 3733'-2700' (T QUEENS 3683' T YATES 2790')
- 15) SPOT 10 SX CMT F/ 1720'-1500' (T SALT @ 1670' 11 3/4" CSG SHOE 1550')
- 16) SPOT 10 SX CMT F/ 300'-SURFACE
- 17) NIPPLE DOWN BOP & CUT OFF WELL HEAD; CAP WELL; INSTALL DRY HOLE MARKER
- 18) CLEAN UP LOCATION RIG DOWN & MOVE OFF.

RECEIVED

TEXACO
NEW MEXICO Q STATE NO. 5
API# 30025201720000
PROPOSED

Y - Blinberry
X - Gloria

0 - 1550' Cement 1100 sx
10 sx 300' - SURFACE

0 - 1550' 15" OD Openhole

Spot 10 sx 41720' - 1500

0 - 1550' 11.75" OD Surface Casing

1550 - 3305' 11" OD Openhole

2600' - 3305' Cement 500 sx (CALC)

Spot 22 sx 3355 - 2700

3305 - 6850' Cement 1400 sx (CBL)

0 - 3305' 8.625" OD Intermediate Casing

Spot 10 sx 41 3733 - 3433

Spot 10 sx 4370 - 4070

3305 - 6850' 7.875" OD Openhole

Spot 10 sx 6040' - 5740'

SET CIRC @ 6040' & SQZ 55 sx below Ret.

6090 - 6094' Perfs (COMMUNICATE STRINGS)


6170 - 6180' CIBP (CAP W/ 30' CMT)

6400 - 6410' Fish (PART OF MILLED CIBP)

6598 - 6771' Abandoned Perfs

0 - 6850' 2.875" OD Tubing

0 - 6848' 2.875" OD Tubing

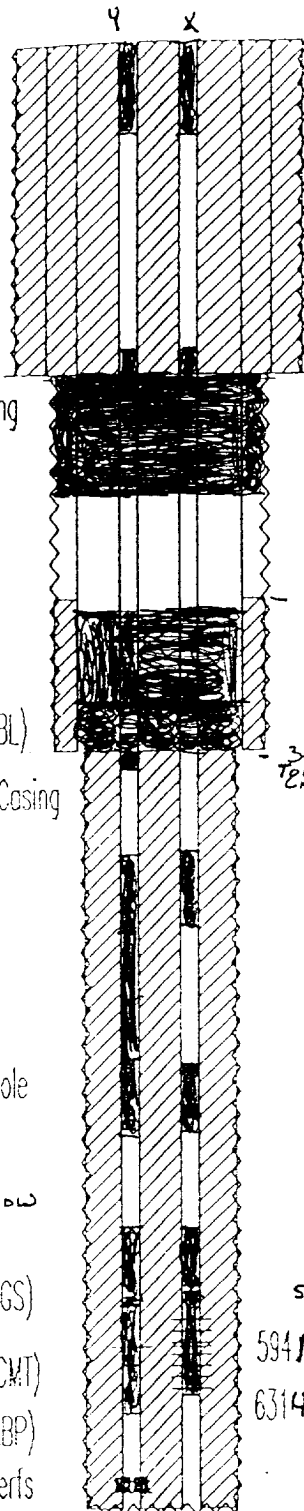

10 sx 300 - SURFACE

Perf @ SQZ @ 1720' & SQZ 50 sx below Ret.
@ 1500' unsting & CAP W/ 100' CMT.

Spot 120 sx 3200 - 2700 (TATES 2790)

Perf 2 7/8" CIP @ 3300' & SQZ 140 sx below Ret.
@ 3200' (8 7/8" CIP shoe @ 3305')

Spot 10 sx 41 3733 - 3433

Spot 10 sx 4370 - 4070 (TOP SAN ANDRES 4320')

LOAD CIP W/ 25# per bbl. SAN ANDRES mud.

Spot 10 sx 5900' - 5600' (TOP GLORIA @ 5884')
SET CIRC @ 5900' & SQZ 55 sx below Ret.

5941 - 6290'

6314 - 6324 CIBP @ 6310'

TD: 6850'

TEXACO
NEW MEXICO Q STATE NO. 5
API# 30025201720000

