

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. <u>30-025-20543</u>
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator <u>MYCO Industries Inc.</u>		6. State Oil & Gas Lease No. <u>015445</u>
3. Address of Operator <u>P.O. Box 840 Artesia, NM 88211-840</u>		7. Lease Name or Unit Agreement Name: <u>TPC+O State</u>
4. Well Location Unit Letter <u>I</u> : <u>1650</u> feet from the <u>South</u> line and <u>330</u> feet from the <u>East</u> line Section <u>24</u> Township <u>17-S</u> Range <u>35-E</u> NMPM County <u>Lea</u>		8. Well No. <u>1</u>
10. Elevation (Show whether DR, RKB, RT, GR, etc.) <u>3898 GR</u>		9. Pool name or Wildcat <u>Vacuum-Abo</u>

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

- PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

- REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☒
OTHER: ☐


12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

Start date 8-14-2001 - MIEPU - RU - pull pump - ND well - Nu 50P Pull tubing run scraper to 8802. Pull scraper, run RBP + packer - set RBP @ 8484. Load + test casing to 750 psi - hold quad. Rig up wireline cement + barrel Log - Fract + to c @ 3545' FS Per F 5 1/2 @ 3400' FS. Set cement + ret. @ 3341 - pump 300 sacks 35:65:16 + 2% CACL - 2 cm. Followed w/ 100 sacks C + 2% CM + down 8 5/8" circ cm + to surface, squeeze 3 bbl cm + in 8 5/8. Pump 150 sacks C + 2% CACL into 13 3/8 csg. Drill cm + from 3341 to 3401, circ clean test 5 1/2 csg to 1000 psi - 20 min hold quad. Acidize well + put back on pump - Rig down 8 5/8 + 13 3/8 csg - No pressure 8-29-2001 - Job finished - Rig down Move out

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Randy Dutton TITLE Foreman DATE 9-18-2001
Type or print name Randy Dutton Telephone No. 505-748-7614
(This space for State use)

APPROVED BY OFFICIAL TITLE SEP 20 2001 DATE
Conditions of approval, if any:

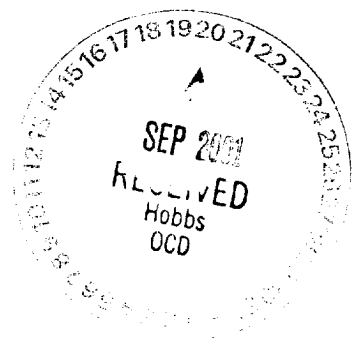

MYCO Industries Inc.

TPC #0 State #1

Unit I Sec. 24 Twp 17-S Rge - 35-E Lea County N.M.

casing diagram

