

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 3002520957
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. 011026
7. Lease Name or Unit Agreement Name New Mexico CG State NCT-2
8. Well No. 1
9. Pool name or Wildcat Vacuum Glorietta
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3978 DF

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	2. Name of Operator Texaco E&P Inc.
3. Address of Operator P.O. Box 730 Hobbs, NM 88240	4. Well Location Unit Letter <u>F</u> : <u>2310</u> Feet From The <u>North</u> Line and <u>1750</u> Feet From The <u>West</u> Line Section <u>29</u> Township <u>17S</u> Range <u>35E</u> NMPM Lea County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3978 DF	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data.

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☒
PULL OR ALTER CASING ☐	OTHER: ☐	CASING TEST AND CEMENT JOB ☐	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Notify NMOCD prior to moving on well.
2. This well has 2-7/8" tub for production csg.
3. 1-26-95 TIH w/ 2-1/16" tub to 6044' Spot 10sx cmt. plug f/6044 to cal. TOC 5638'. Talked w/Jerry Sexton @ 9:30am 1-26-95 w/NMOCD he OK to spot plug w/NO tag required. Load cas. w/25# per bbl salt gel plug mud.
4. POH w/2-1/16" tub to 4500' Spot 5 cmt. plug f/4500' CAL TOC top 4297.
5. POH w/2-1/16" tub to 3000' Spot 15sx cmt. plug f/3000' CAL TOC 2391'.
6. POH w/2-1/16" tub to 1750' Spot 10sx cmt. plug f/1750' CAL TOC 1344'.
7. POH w/2-1/16" tub to 350' Spot 15sx cmt. plug f/350' to surface.
8. RD Pool WOrig & Pool plugging equip. Cut off wellhead; weld on cap & install dryhole marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Calder TITLE P&A Supervisor (Pool Agent) DATE 1-27-95

TYPE OR PRINT NAME J. Calder TELEPHONE NO. _____


(This space for State Use)

APPROVED BY [Signature] OIL & GAS INSPECTOR DATE MAY 08 1995

CONDITIONS OF APPROVAL, IF ANY: _____

P&A: 1-27-95

TEXACO E&P INC.
NM "CG" State NCT-2 No. 1
API# 3002520957

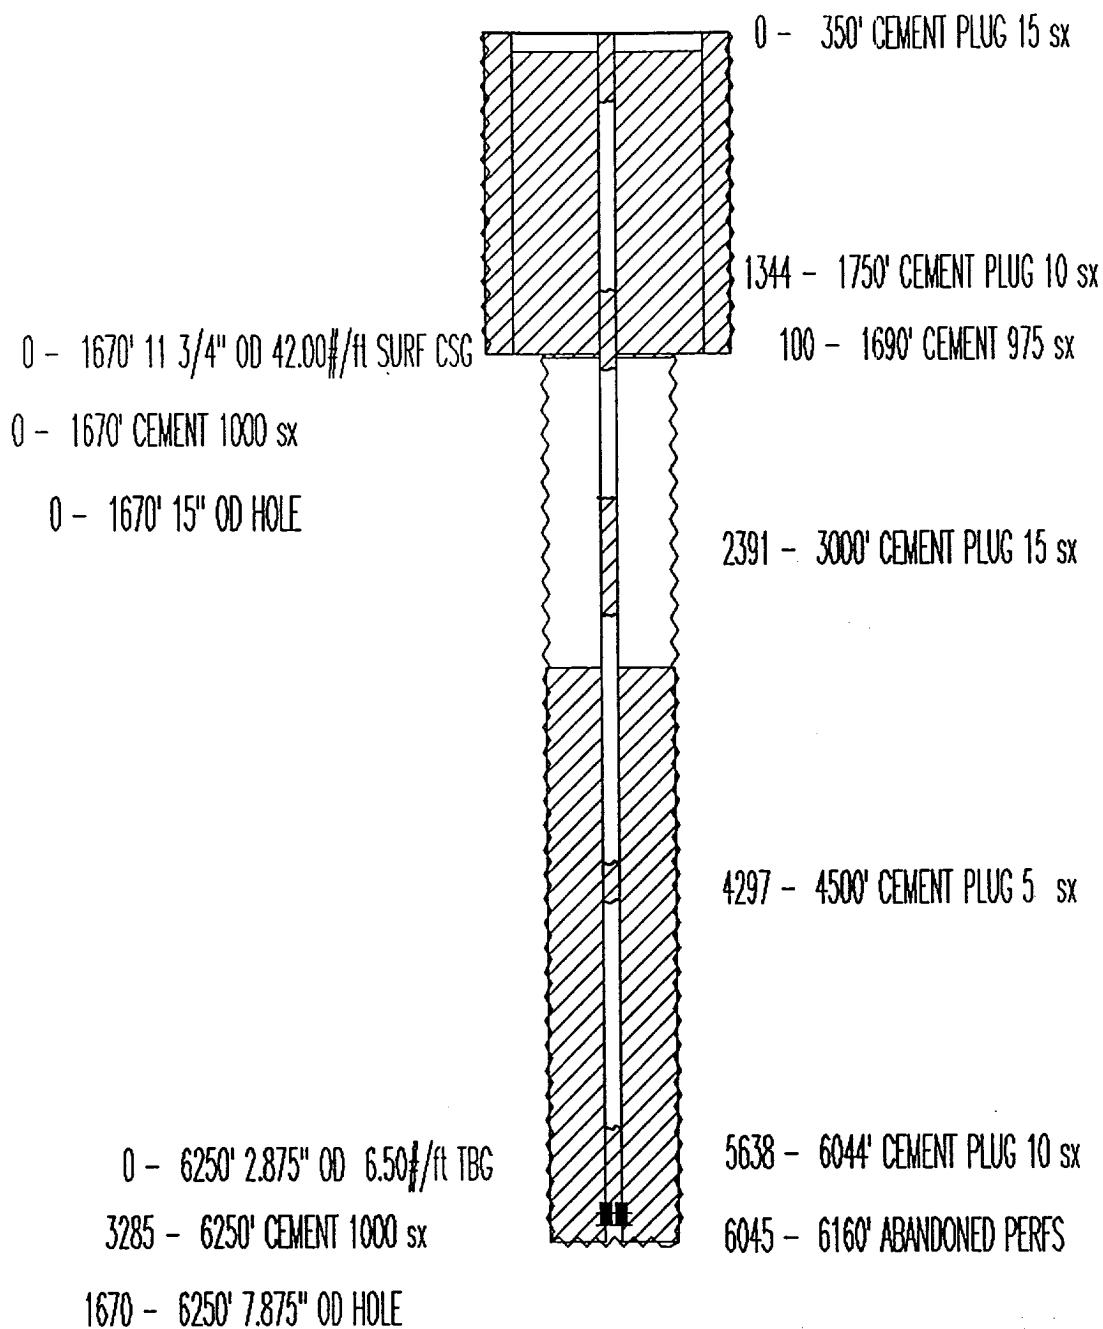

2310 FNL & 400 FEL
SEC 30, TWN 17 S, RANGE 35 E
ELEVATION: 3978 ES
COMPLETION DATE: 08-17-64

COMPLETION INTERVAL: 6045 - 6160 (GLOR)